

## Futures Fire Risk Assessment

Futures Homescape, Community Centre Manor Farm, Queen Street: DE56 1NR, - UPRN: 8 / 173529 / QA Approved / Andy Cloke

**Complete**

Flagged items	2	Actions	18
---------------	---	---------	----

### SITE NAME:

Futures Homescape,  
Community Centre Manor  
Farm, Queen Street: DE56 1NR,  
- UPRN: 8, Fire Risk  
Assessments, Futures  
Homescape

### PROPERTY IMAGE



Photo 1

**UPRN:** 8

**JOB NUMBER:** 173529

**FRA COMPLETED BY:** Pennington Choices Limited

**FIRE RISK ASSESSOR NAME:** Adrian Gallimore

**INSPECTION DATE:** 23 Aug 2023

**REPORT STATUS:** QA Approved

**REASSESSMENT PRIORITY:** Medium - 2 Years

**VALID TO: (QA Use Only)** 15 Sep 2025

**VALIDATION DATE: (QA Use Only)** 15 Sep 2023

**VALIDATED BY: (QA Use Only)** Andy Cloke

**VALIDATOR'S SIGNATURE: (QA Use Only)**



Photo 2

---

## Flagged items & Actions

2 flagged, 18 actions

### Flagged items

2 flagged, 0 actions

Assessment Risk Ratings / Premises Risk Rating

**Accordingly, it is considered that the risk to life from fire at these premises is:**

MODERATE

Assessment Risk Ratings

**On satisfactory completion of all remedial works the risk rating of this building may be reduced to**

TOLERABLE

### Other actions

18 actions

Detailed Risk Assessment Part 2 / A - Electrical Ignition Sources / A1

**Is the fixed electrical installation periodically inspected and tested, (include dates if known)?**

Unknown

There was no date label on the electrical consumer unit to confirm the last fixed wiring test. Refer to Policy Principle.

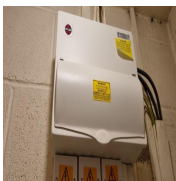


Photo 4

**Open** | Priority Low | Due 16 Sep 2024 3:54 PM UTC | Created by Adrian Gallimore

A1

Management should ensure that the fixed wiring has been tested inline with Policy Principle.

Detailed Risk Assessment Part 2 / A - Electrical Ignition Sources / A3

**Is there a policy for personal electrical appliances (consider restrictions of communal supply points such as outlets and T pin outlets)?**

Unknown

No personal electrical appliances were identified as the centre was not in use at the time of assessment. It was not possible to establish the policy for community centre users that may use their own electrical appliances such as charging of mobile phones etc.

**Open** | Created by Adrian Gallimore

A3

Management should confirm the policy on the use of personal electrical appliances within the community centre and ensure that it is communicated to centre users.

Detailed Risk Assessment Part 2 / B - Smoking Policies / B2

**Is the policy being adhered to and are "No smoking" signs**

No

### provided in the common areas?

There was no evidence of illicit smoking at the time of assessment. Signage is not displayed.

**Open** | Priority Low | Due 16 Sep 2024 3:58 PM UTC | Created by Adrian Gallimore

B2

Management should ensure that no smoking signs are displayed within the Laundry and within the community centre at point of entry. Wording on signage should state 'It is against the law to smoke on these premises'.

Detailed Risk Assessment Part 2 / C - Arson / C2

**Are bins secured or fire loading stored in a suitable location?  
(Please state bin type, location, if and how it is secured)**

Unknown

It was not possible to establish the arrangement for waste as no waste bins were identified at the time of assessment.

**Open** | Created by Adrian Gallimore

C2

Where waste bins are provided, management should ensure that they are stored in a safe place away from the building.

Detailed Risk Assessment Part 2 / E - Cooking / E1

**Are reasonable measures in place to prevent fires as a result  
of cooking, including replacing filter(where necessary)?**

Unknown

There is an electrical cooker within the community centre kitchen. It was not possible to establish how often the kitchen is used or what rules are in place for cooking etc.



Photo 10

**Open** | Priority High | Due 16 Oct 2023 4:06 PM UTC | Created by Adrian Gallimore

E1

Management should consider removing the electric cooker in favour of a microwave only if cooking is not frequent. Where the cooker is to remain it is advisable that it is only used for low risk activities and that high risk (deep fat frying etc) is prohibited. Rules for the use of the kitchen should be disseminated to users.

Detailed Risk Assessment Part 2 / F - Lightning / F1

**Does the building have a lightning protection system?**

No

FHG Policy Principal confirms that there is no lightning protection installed.

**Open** | Created by Adrian Gallimore

F1

It is PCL recommendation that advice is sought from a competent person to determine whether lightning protection is required or not for the building in accordance with BS EN 62305-2:2012.

Detailed Risk Assessment Part 2 / G - Housekeeping / G3

**Are mobility scooters or electric vehicles stored in the means of escape? If yes has an assessment been undertaken in line with the NFCC "Mobility Scooter Guidance for Residential Buildings"?**

Unknown

No mobility scooters were identified however, the centre was not used at the time of assessment. It is likely that members of the local community may attend the centre in a mobility scooter. It was not possible to establish if a risk assessment has been completed as the information was not accessible at the time of assessment.

**Open** | Created by Adrian Gallimore

G3

Management should confirm if they allow the charging of mobility scooters within the community centre. Where charging is allowed, management should ensure that there is a suitable risk assessment in place. Any risk assessment should take into account any risks associated with Lithium Ion batteries.

Detailed Risk Assessment Part 2 / H - Hazards Introduced by Contractors / H1

**Is there satisfactory control over works carried out in the building by contractors (e.g. hot work permits)?**

Unknown

It was not possible to establish contractor control procedures as the information was not available at the time of assessment.

**Open** | Priority Medium | Due 16 Dec 2023 5:11 PM UTC | Created by Adrian Gallimore

H1

Management should confirm that suitable and sufficient procedures are in place for controlling contractor activities to include Method Statements and Risk Assessments and Hot Work Permit where required.

Detailed Risk Assessment Part 2 / J - Other Significant Hazards / J1

**Are all issues deemed satisfactory? [1]**

Unknown

There is a tumble dryer and washing machine within the laundry. Both appliances are PAT tested however there is no information in relation to the cleaning of tumble dryer filters.



Photo 11

**Open** | Priority Medium | Due 16 Dec 2023 5:14 PM UTC | Created by Adrian Gallimore

J1

Management should establish arrangements of cleaning out of tumble dryer filters such as after use by each user. Arrangements should be communicated to laundry users.

#### Detailed Risk Assessment Part 2 / K - Means of Escape / K12

**Are there any other issues that could affect the means of escape, for example plastic conduit/loose cables not secured by fire rated fastening?**

Yes

Conduit and cables were noted and it was not possible to confirm that the requirements of Regulation 521.10.202 of the BS 7671 - 18th Edition of The IET Wiring Regulations, which requires all cables to be adequately supported using non-combustible fixings to prevent premature collapse in the event of a fire. The new regulation is not applied retrospectively so any wiring systems fitted before 2019 do not need to be immediately updated. Any new installation or additions and alterations to existing systems, including temporary wiring, have to comply with the regulations.



Photo 15

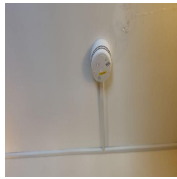


Photo 16

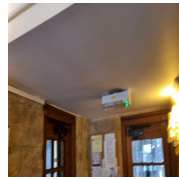


Photo 17

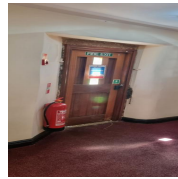


Photo 18



Photo 19

**Open** | Created by Adrian Gallimore

#### K12

Management is to consider the requirements of the Regulation 521.10.202 of the BS 7671 - 18th Edition The IET Wiring Regulations which requires all cables to be adequately supported using non-combustible fixings to prevent premature collapse in the event of a fire albeit not retrospective and seek the advice of a suitably qualified competent person or organisation and undertake any remediation identified by the aforementioned competent person or organisation.

#### Detailed Risk Assessment Part 2 / M - Common Area Fire Doors / M1

**Are all common area fire door and frames in good condition and appropriately fire rated?**

Unknown

Doors between sitting rooms and the kitchen are hardwood doors however they did not appear to be fire rated. In addition, it was not possible to determine fire rating. The kitchen has a serving hatch so compartmentation within could not be maintained. In addition, it was not possible to establish if the electrical intake cupboard or laundry doors are fire rated.

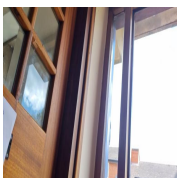


Photo 20

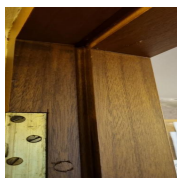


Photo 21

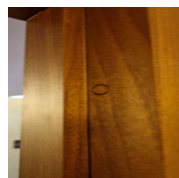


Photo 22



Photo 23



Photo 24



Photo 25

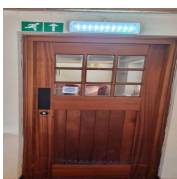


Photo 26

**Open** | Priority Medium | Due 16 Dec 2023 10:25 AM UTC | Created by Adrian Gallimore

## M1

Management should confirm fire rating of doors to the kitchen, sitting room, electrical intake room and laundry. Where doors do not conform they should be replaced with certified self closing doors to FD30 specification. Any installation should only be conducted by a certified fire door installer.

Detailed Risk Assessment Part 2 / N - Emergency Lighting / N2

**If EL not provided, is borrowed/artificial lighting sufficient for escape? (Internal and external)**

Unknown

There is no external emergency lighting present. It was not possible to establish if borrowed lighting is adequate as the assessment was conducted during daylight hours.



Photo 34



Photo 35

**Open** | Priority Low | Due 16 Sep 2024 9:29 AM UTC | Created by Adrian Gallimore

## N2

Management should ensure that external emergency lighting is installed above exits.

Detailed Risk Assessment Part 2 / P - Means of Giving Warning in Case of Fire / P1

**Is a reasonable fire detection and fire alarm system provided in the common areas, where necessary?**

Unknown

There is an automatic alarm system with AFD installed to all rooms (presumed BS5839:L2/L3 Specification). The alarm panel is installed to the entrance lobby and was in a health condition at the time of assessment.

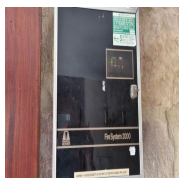


Photo 41

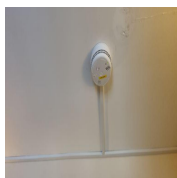


Photo 42

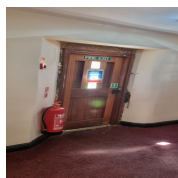


Photo 43



Photo 44



Photo 45

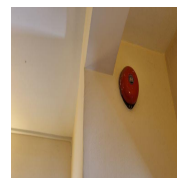


Photo 46



Photo 47

**Open** | Priority Low | Due 16 Sep 2024 9:42 AM UTC | Created by Adrian Gallimore

## P1

Management should confirm the specification of the alarm installation.

Detailed Risk Assessment Part 2 / P - Means of Giving Warning in Case of Fire / P5

**Where appropriate, has a fire alarm zone plan been provided?**

No

There is no alarm zone plan displayed. The alarm system appears to be basic and it is likely that there is only one zone however the assessor was not able to confirm with the information available. .



Photo 48

**Open** | Priority Low | Due 16 Sep 2024 9:38 AM UTC | Created by Adrian Gallimore

P5

Management should confirm how many zone are present on the alarm system. If there is more than one zone then a zone plan should be devised and displayed.

Detailed Risk Assessment Part 2 / P - Means of Giving Warning in Case of Fire / P6

**Where appropriate, are there adequate arrangements for silencing and resetting an alarm condition?**

Unknown

It was not possible to establish the arrangements for silencing and resetting the alarm system.

**Open** | Priority Medium | Due 16 Dec 2023 10:44 AM UTC | Created by Adrian Gallimore

P6

Management should confirm the arrangements for silencing and resetting the alarm system and ensure that it is communicated to community centre users

Detailed Risk Assessment Part 2 / Q - Measures to Limit Fire Spread and Development / Q1

**Is there adequate levels of compartmentation between floors and between flats and the common escape routes?**

Unknown

Walls are solid with emulsion painted finish. Ceilings are emulsion painted plastered with some having wooden beams. No major compartment breaches were identified however, it was not possible to confirm if compartmentation between the community centre and the dwelling above is adequate.

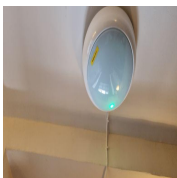


Photo 49

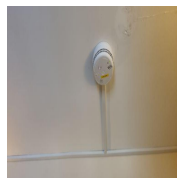


Photo 50

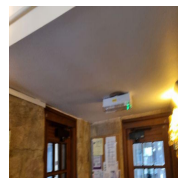


Photo 51

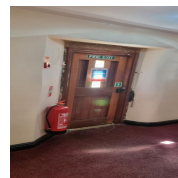


Photo 52

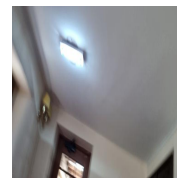


Photo 53

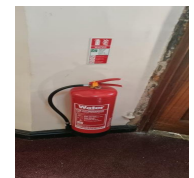


Photo 54

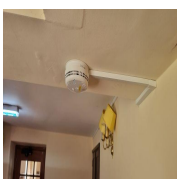


Photo 55

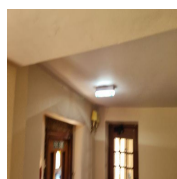


Photo 56

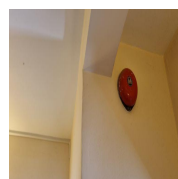


Photo 57

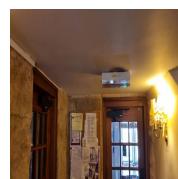


Photo 58

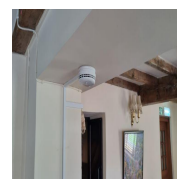


Photo 59

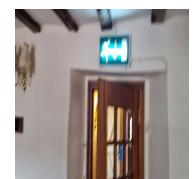


Photo 60

**Open** | Priority Low | Due 16 Sep 2024 9:47 AM UTC | Created by Adrian Gallimore

Q1



Management should inspect compartmentation between the community centre and dwelling above to establish if it is adequate.

Detailed Risk Assessment Part 2 / R - Fire Extinguishing Appliances / R1

**If required, is there reasonable provision of accessible portable fire extinguishers?**

Unknown

Extinguishers are installed in accordance with BS5306:Part 8. There are 2 x 6L 21A Water units and 1 x 2KG CO2 which is adequate for the compartment size. Extinguishers are maintained under service contract by Harmony with the last service completed in 02/23. Community centre users are unlikely to be trained on the use of FFE and no signage is displayed to state 'only to be used by trained persons'.

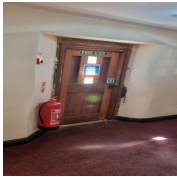


Photo 64

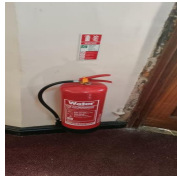


Photo 65



Photo 66

**Open** | Priority Medium | Due 16 Dec 2023 11:03 AM UTC | Created by Adrian Gallimore

R1

Management should display signage at fire points to state 'extinguishers should only be used by trained persons'.

Detailed Risk Assessment Part 2 / T - Procedures and Arrangements / T2

**Has a competent person(s) been appointed to assist in undertaking the preventative and protective measures including in house checks?**

Unknown

It was not possible to ascertain if there is a competent person appointed for this property.

**Open** | Created by Adrian Gallimore

T2

Management should confirm that there is a competent person in place to undertake the preventative and protective measures for this property.

## Detailed Risk Assessment Part 1

### 1. General Information

<b>1.1 FRA Type:</b>	Type 1 (Non-Destructive)
<b>1.2 Property Type:</b>	Converted Detached House
<b>1.3 Property Designation:</b>	Community Centre
<b>1.4 Responsible Person:</b>	Lindsey Williams - CEO Futures Housing Group
<b>1.5 No of Floors:</b>	1
<b>1.6 No of Flats (if applicable):</b>	N/A
<b>1.7 Ground Floor Area (m2):</b>	128
<b>1.8 Total Area of all Floors (m2)</b>	128

The premise is a ground floor community centre. There is a unconnected dwelling above that has own access door to the side of the building.

#### 1.9 Building Description:

A converted detached property to a community centre and laundry. There is a dwelling above the community centre which is not connected and has own access door to the left hand side of the property. There is a front entrance door which with the community centre door opposite and an entrance to the small laundry to the right hand side. The entrance to the community centre has small foyer with small sitting room to the right hand site. There is a toilet and kitchen leading from the foyer with another small sitting room leading off. There are two exits which are via the front entrance and side exit from the first sitting room.

#### 1.10 Building Construction:

Traditional Derbyshire stone considered to be built around late 1700. There are some wooden beams to ceilings with emulsion painted plaster. Walls within are emulsion painted rendered stone with solid floors.



Photo 3

#### 1.11 Extent of common areas:

laundry, two small sitting rooms, kitchen and entrance foyer.

#### 1.12 Areas of the building to which access was not available:

All of the community centre was accessible.

**1.13 If applicable, state which flats were sample inspected:**

N/A - The premise is a community centre with no dwellings attached.

## 2. The Occupants

**2.1 Management Extent**

Non Managed – eg GN

**2.2 Details of any onsite Management**

There were no on-site management at the property.

**2.3 Person managing fire safety in the premises**

Lindsey Williams, CEO, Futures Housing Group.

**2.4 Person consulted during the fire risk assessment**

No persons were consulted during the assessment.

**2.5 Number of occupants (maximum estimated)**

There were no persons onsite at the time of assessment and the community centre is rarely used by residents of the local housing scheme. There is seating for approximately 20 persons.

**2.6 Approximate maximum number of employees at any one time**

There were no employees present at the time of assessment. There may be staff from FHG that attend periodically to carry out routine checks and maintenance.

**2.7 Number of members of the public (maximum estimated)**

Refer to 2.5

**2.8 Identify any people who are especially at risk (Sleeping Occupants, Disabled Occupants, Occupants in remote areas and Lone Workers, Young Persons, Others)**

The community centre is unlikely to have sleeping occupants or young children present unless accompanied by a parent, guardian or responsible person. It is likely that community centre users may have varying disabilities however it is reasonable to assume that would be able to make their own way there or with the assistance of a carer or helper.

## 3. Fire Safety Legislation

**3.1 The following fire safety legislation applies to these premises**

Regulatory Reform (Fire Safety) Order 2005

**3.2 The above legislation is enforced by**

Derbyshire Fire and Rescue Service

**3.3 Other key fire safety legislation (other than Building Regs 2000)**

None

**3.4 The other legislation referred to above is enforced by**

N/A

**3.5 Guidance used as applicable to premises and occupation**

Small & Medium Places of Assembly

**3.6 Is there an alteration or enforcement notice in force?**

Unknown

None known to the assessor.

**3.7 Fire loss experience (since last FRA)**

Unknown

None known to the assessor. There was no evidence of fire loss or damage at the time of assessment.

## Detailed Risk Assessment Part 2

18 actions

### A - Electrical Ignition Sources

2 actions

#### A1

1 action

**Is the fixed electrical installation periodically inspected and tested, (include dates if known)?**

Unknown

There was no date label on the electrical consumer unit to confirm the last fixed wiring test. Refer to Policy Principle.

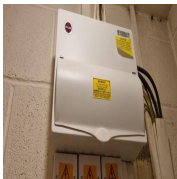


Photo 4

**Open** | Priority Low | Due 16 Sep 2024 3:54 PM UTC | Created by Adrian Gallimore

#### A1

Management should ensure that the fixed wiring has been tested inline with Policy Principle.

Policy Principle: FHG complete Fixed wire testing in line with current regulations every 5 years and complete an annual visual inspection on all properties.

**Action/Recommendation Required?:**

Yes

**Action Priority:**

Low - 12 Months

#### A2

**Is PAT testing in common areas carried out?**

Yes

Labels on portable electrical appliances confirms that PAT testing was completed in January 2023.



Photo 5



Photo 6

Policy Principle: PAT testing is complete at the time of the visual inspection as mentioned above. All items in the communal areas will be tested.

#### A3

1 action

**Is there a policy for personal electrical appliances (consider restrictions of communal supply points such as outlets and T pin outlets)?**

Unknown

No personal electrical appliances were identified as the centre was not in use at the time of assessment. It was not possible to establish the policy for community centre users that may use their own electrical appliances such as charging of mobile phones etc.

**Open** | Created by Adrian Gallimore

### A3

Management should confirm the policy on the use of personal electrical appliances within the community centre and ensure that it is communicated to centre users.

Policy Principle: PAT testing is complete at the time of the visual inspection as mentioned above. All items in the communal areas will be tested.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Recommendation - No Timescale

### A4

**Is the use of adapters and leads limited?**

N/A

No adaptors or leads were present at the time of assessment.

### A5

**Are there any PV cells installed and do they have the appropriate isolation systems and signage to assist the fire and rescue service?**

N/A

None present.

## B - Smoking Policies

1 action

### B1

**Are there suitable arrangements to prevent fire as a result from smoking?**

Yes

Policy Principle: No smoking policy in all communal areas- signage displayed.

### B2

1 action

**Is the policy being adhered to and are "No smoking" signs provided in the common areas?**

No

There was no evidence of illicit smoking at the time of assessment. Signage is not displayed.

**Open** | Priority Low | Due 16 Sep 2024 3:58 PM UTC | Created by Adrian Gallimore

### B2

Management should ensure that no smoking signs are displayed within the Laundry and within the

community centre at point of entry. Wording on signage should state 'It is against the law to smoke on these premises'.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Low - 12 Months

## C - Arson

1 action

### C1

**Are premises secure against arson by outsiders? (Please state how)**

Yes

Doors are secured by standard security lock. There is an outer door with a separate lock to the community centre to allow residents of the local housing scheme access to the laundry.



Photo 7

### C2

1 action

**Are bins secured or fire loading stored in a suitable location? (Please state bin type, location, if and how it is secured)**

Unknown

It was not possible to establish the arrangement for waste as no waste bins were identified at the time of assessment.

**Open** | Created by Adrian Gallimore

### C2

Where waste bins are provided, management should ensure that they are stored in a safe place away from the building.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Recommendation - No Timescale

## D - Portable Heaters and Installations

### D1

**If used, is the use of portable heaters regarded as safe?**

N/A

No portable heaters were identified at the time of assessment.

### D2

**Are fixed heating systems maintained annually?**

Yes

The Landlords Certificate shows that the last Gas Safety Inspection was completed 09/05/2023



Photo 8

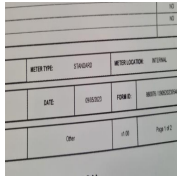


Photo 9

Policy Principle: All Safety inspections carried out annually by qualified persons.

**E - Cooking**

1 action

**E1**

1 action

**Are reasonable measures in place to prevent fires as a result of cooking, including replacing filter(where necessary)?**

Unknown

There is an electrical cooker within the community centre kitchen. It was not possible to establish how often the kitchen is used or what rules are in place for cooking etc.



Photo 10

**Open** | Priority High | Due 16 Oct 2023 4:06 PM UTC | Created by Adrian Gallimore

**E1**

Management should consider removing the electric cooker in favour of a microwave only if cooking is not frequent. Where the cooker is to remain it is advisable that it is only used for low risk activities and that high risk (deep fat frying etc) is prohibited. Rules for the use of the kitchen should be disseminated to users.

**Action/Recommendation Required?**

Yes

**Action Priority:**

High - 1 Month

**F - Lightning**

1 action

**F1**

1 action

**Does the building have a lightning protection system?**

No

FHG Policy Principal confirms that there is no lightning protection installed.

**Open** | Created by Adrian Gallimore

**F1**



It is PCL recommendation that advice is sought from a competent person to determine whether lightning protection is required or not for the building in accordance with BS EN 62305-2:2012.

Policy Principle: No lightning protection policy in place

**Action/Recommendation Required?**

Yes

**Action Priority:**

Recommendation - No Timescale

## G - Housekeeping

1 action

### G1

**Are combustible materials kept away from any sources of ignition, including gas and electrical intake cupboards?**

N/A

No issues were identified at the time of assessment.

### G2

**Are the escape routes kept clear of items combustible materials or waste and free of any trip hazards?**

Yes

Escape routes were clear at the time of assessment.

### G3

1 action

**Are mobility scooters or electric vehicles stored in the means of escape? If yes has an assessment been undertaken in line with the NFCC "Mobility Scooter Guidance for Residential Buildings"?**

Unknown

No mobility scooters were identified however, the centre was not used at the time of assessment. It is likely that members of the local community may attend the centre in a mobility scooter. It was not possible to establish if a risk assessment has been completed as the information was not accessible at the time of assessment.

**Open** | Created by Adrian Gallimore

### G3

Management should confirm if they allow the charging of mobility scooters within the community centre. Where charging is allowed, management should ensure that there is a suitable risk assessment in place. Any risk assessment should take into account any risks associated with Lithium Ion batteries.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Recommendation - No Timescale

## H - Hazards Introduced by Contractors

1 action

H1

1 action

**Is there satisfactory control over works carried out in the building by contractors (e.g. hot work permits)?**

Unknown

It was not possible to establish contractor control procedures as the information was not available at the time of assessment.

**Open** | Priority Medium | Due 16 Dec 2023 5:11 PM UTC | Created by Adrian Gallimore

H1

Management should confirm that suitable and sufficient procedures are in place for controlling contractor activities to include Method Statements and Risk Assessments and Hot Work Permit where required.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

## I - Dangerous Substances

I1

**If dangerous substances are used, has a risk assessment been carried out as required by the Dangerous Substances and Explosives Atmospheres Regulations 2002 and are they stored correctly?**

N/A

No dangerous substances were identified within common areas at the time of assessment. See Policy Principle.

Policy Principle: All contractors must submit RAMS for procurement processes, and these are reviewed annually by FHG. A specific risk assessment is to be completed for each job.

## J - Other Significant Hazards

1 action

J1

1 action

**Are all issues deemed satisfactory? [1]**

Unknown

There is a tumble dryer and washing machine within the laundry. Both appliances are PAT tested however there is no information in relation to the cleaning of tumble dryer filters.



Photo 11

**Open** | Priority Medium | Due 16 Dec 2023 5:14 PM UTC | Created by Adrian Gallimore

J1

Management should establish arrangements of cleaning out of tumble dryer filters such as after use by each user. Arrangements should be communicated to laundry users.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

J2

**Are all issues deemed satisfactory? [2]**

N/A

There were no additional significant hazards identified at the time of assessment.

## K - Means of Escape

1 action

K1

**Is the escape route design deemed satisfactory? (Consider current design codes)**

Yes

The escape route is satisfactory.

K2

**Is the fire-resisting construction (including any glazing) protecting escape routes and staircases of a suitable standard and maintained in sound condition?**

Yes

Walls are solid construction with emulsion painted finish. Some ceilings have wooden beams with emulsion painted plaster. Floors are of solid construction.

K3

**Is there adequate provision of exits (including exit Widths) for the numbers who may be present?**

Yes

Exits are via the front entrance and a side exit to the small sitting room. Exits / Widths are adequate for those that may be present.

K4

**Are doors on escape routes easily opened? (and are sliding or revolving doors avoided?)**

Unknown

The front exit has a yale type lever fitted. The side exit door has a push pad device fitted. Exit doors were tested and doors opened freely without obstruction. The final exit door also has a yale type lever fitted.

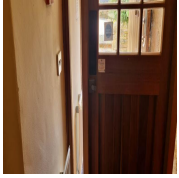


Photo 12

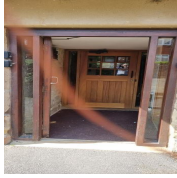


Photo 13

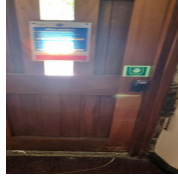


Photo 14

## K5

**Do final exits open in the direction of escape where necessary?**

Yes

The front exit opens inwardly. The side exit opens in the direction of travel.

## K6

**Are travel distances satisfactory? (consider single direction and more than one direction, property risk profile and occupancy characteristics)**

Yes

Travel distances are acceptable.

## K7

**Are there suitable precautions for all inner rooms?**

N/A

There are no inner room scenarios.

## K8

**Are escape routes separated where appropriate?**

N/A

Not required.

## K9

**Are corridors sub-divided where appropriate?**

N/A

Not required.

## K10

**Do escape routes lead to a place of safety?**

Yes

Escape routes lead to the external environment.

## K11

**Are the stairs and/or lobbies provided with adequate ventilation? (If considered satisfactory, please state provision)**

Yes

The premise is a ground floor property with no stairs. There is adequate ventilation from doors and

windows.

## K12

1 action

**Are there any other issues that could affect the means of escape, for example plastic conduit/loose cables not secured by fire rated fastening?**

Yes

Conduit and cables were noted and it was not possible to confirm that the requirements of Regulation 521.10.202 of the BS 7671 - 18th Edition of The IET Wiring Regulations, which requires all cables to be adequately supported using non-combustible fixings to prevent premature collapse in the event of a fire. The new regulation is not applied retrospectively so any wiring systems fitted before 2019 do not need to be immediately updated. Any new installation or additions and alterations to existing systems, including temporary wiring, have to comply with the regulations.

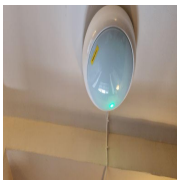


Photo 15

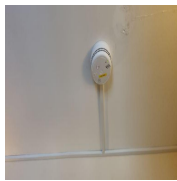


Photo 16

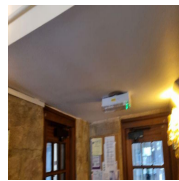


Photo 17

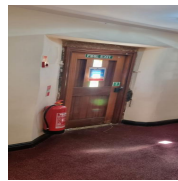


Photo 18



Photo 19

**Open** | Created by Adrian Gallimore

## K12

Management is to consider the requirements of the Regulation 521.10.202 of the BS 7671 - 18th Edition The IET Wiring Regulations which requires all cables to be adequately supported using non-combustible fixings to prevent premature collapse in the event of a fire albeit not retrospective and seek the advice of a suitably qualified competent person or organisation and undertake any remediation identified by the aforementioned competent person or organisation.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Recommendation - No Timescale

## L - Flat Entrance Doors

### L1

**Are the sample inspection flat entrance door or doors in good condition and appropriately fire rated?**

N/A

The premise is community centre with no dwellings.

## M - Common Area Fire Doors

1 action

### M1

1 action

**Are all common area fire door and frames in good condition and appropriately fire rated?**

Unknown

Doors between sitting rooms and the kitchen are hardwood doors however they did not appear to

be fire rated. In addition, it was not possible to determine fire rating. The kitchen has a serving hatch so compartmentation within could not be maintained. In addition, it was not possible to establish if the electrical intake cupboard or laundry doors are fire rated.

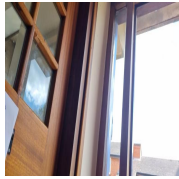


Photo 20



Photo 21

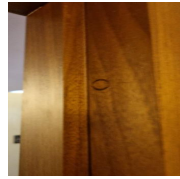


Photo 22



Photo 23



Photo 24

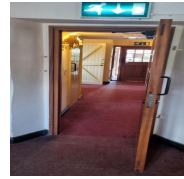


Photo 25



Photo 26

**Open** | Priority Medium | Due 16 Dec 2023 10:25 AM UTC | Created by Adrian Gallimore

### M1

Management should confirm fire rating of doors to the kitchen, sitting room, electrical intake room and laundry. Where doors do not conform they should be replaced with certified self closing doors to FD30 specification. Any installation should only be conducted by a certified fire door installer.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

## N - Emergency Lighting

1 action

### N1

**If emergency lighting is provided, is the coverage sufficient and in good repair? (Internal and external)**

Yes

Emergency lighting is installed and appears adequate. No defects were identified. (See Limitations Statement).

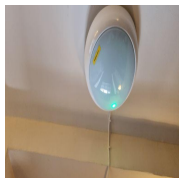


Photo 27

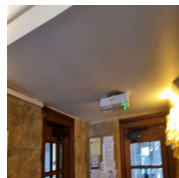


Photo 28

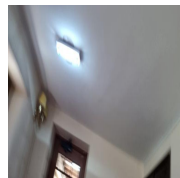


Photo 29

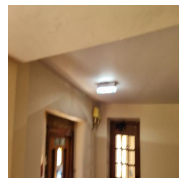


Photo 30

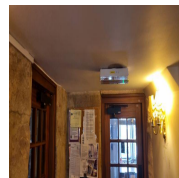


Photo 31

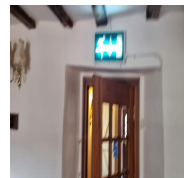


Photo 32

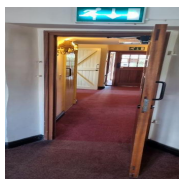


Photo 33

### N2

1 action

**If EL not provided, is borrowed/artificial lighting sufficient for escape? (Internal and external)**

Unknown

There is no external emergency lighting present. It was not possible to establish if borrowed lighting is adequate as the assessment was conducted during daylight hours.



Photo 34



Photo 35

**Open** | Priority Low | Due 16 Sep 2024 9:29 AM UTC | Created by Adrian Gallimore

N2

Management should ensure that external emergency lighting is installed above exits.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Low - 12 Months

**O - Fire Safety Signs and Notices**

O1

**Is there adequate provision of visible fire safety signs and notices? (Consider directional, exits, stairs, fire action notices, Fire door keep shut, fire equipment and 'do not use lift' signage)**

Yes

A Fire Action Notice is displayed. Illuminated exit signs are installed and fire doors have signs attached.

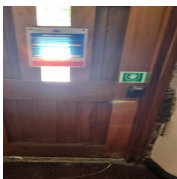


Photo 36



Photo 37

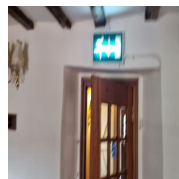


Photo 38

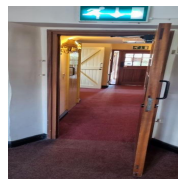


Photo 39

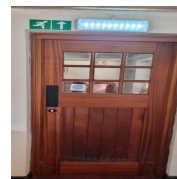


Photo 40

O2

**Wayfinding Signage (buildings over 11 metres in height). Are there clear markings for flat and floor recognition provided?**

N/A

Not required.

**P - Means of Giving Warning in Case of Fire**

3 actions

P1

1 action

**Is a reasonable fire detection and fire alarm system provided in the common areas, where necessary?**

Unknown

There is an automatic alarm system with AFD installed to all rooms (presumed BS5839:L2/L3 Specification). The alarm panel is installed to the entrance lobby and was in a health condition at the time of assessment.



Photo 41



Photo 42

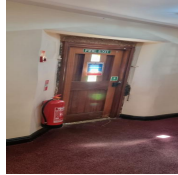


Photo 43



Photo 44



Photo 45

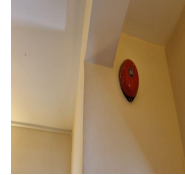


Photo 46



Photo 47

**Open** | Priority Low | Due 16 Sep 2024 9:42 AM UTC | Created by Adrian Gallimore

**P1**

Management should confirm the specification of the alarm installation.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Low - 12 Months

**P2**

**If installed, is the common area AFD adequate for the occupancy and fire risk?**

Yes

AFD is adequate.

**P3**

**If not installed, are the premises deemed safe without a common area AFD system?**

N/A

AFD is installed.

**P4**

**If there is a communal fire detection and fire alarm system, does it extend into the dwellings?**

N/A

There are no dwellings attached to the community centre. There is a separate dwelling above.

**P5**

1 action



**Where appropriate, has a fire alarm zone plan been provided?**

No

There is no alarm zone plan displayed. The alarm system appears to be basic and it is likely that there is only one zone however the assessor was not able to confirm with the information available. .



Photo 48

**Open** | Priority Low | Due 16 Sep 2024 9:38 AM UTC | Created by Adrian Gallimore

**P5**

Management should confirm how many zone are present on the alarm system. If there is more than one zone then a zone plan should be devised and displayed.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Low - 12 Months

**P6**

1 action

**Where appropriate, are there adequate arrangements for silencing and resetting an alarm condition?**

Unknown

It was not possible to establish the arrangements for silencing and resetting the alarm system.

**Open** | Priority Medium | Due 16 Dec 2023 10:44 AM UTC | Created by Adrian Gallimore

**P6**

Management should confirm the arrangements for silencing and resetting the alarm system and ensure that it is communicated to community centre users

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

**P7**

**If applicable, is a separate domestic hard-wired smoke/heat alarm within the flats installed to a suitable standard?**

N/A

There are no dwellings to the community centre.

**P8**

**If applicable (Sheltered scheme) is the smoke detection within the flats monitored by an alarm receiving centre/on site scheme manager via a telecare system?**

N/A

N/A - The premise is a community centre.

## Q - Measures to Limit Fire Spread and Development

1 action

### Q1

1 action

**Is there adequate levels of compartmentation between floors and between flats and the common escape routes?**

Unknown

Walls are solid with emulsion painted finish. Ceilings are emulsion painted plastered with some having wooden beams. No major compartment breaches were identified however, it was not possible to confirm if compartmentation between the community centre and the dwelling above is adequate.

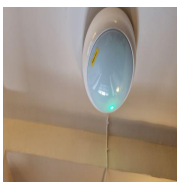


Photo 49

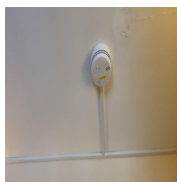


Photo 50

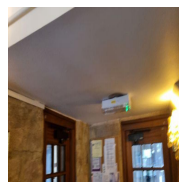


Photo 51

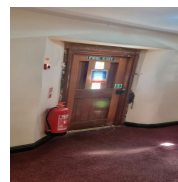


Photo 52

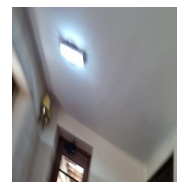


Photo 53

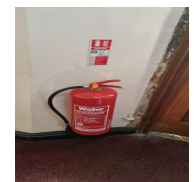


Photo 54



Photo 55

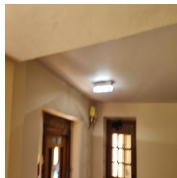


Photo 56

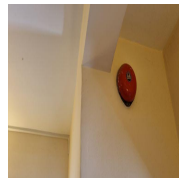


Photo 57

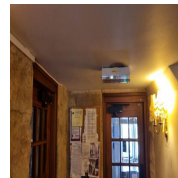


Photo 58



Photo 59

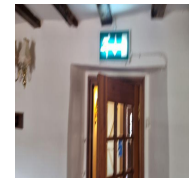


Photo 60

**Open** | Priority Low | Due 16 Sep 2024 9:47 AM UTC | Created by Adrian Gallimore

### Q1

Management should inspect compartmentation between the community centre and dwelling above to establish if it is adequate.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Low - 12 Months

### Q2

**Are hidden voids appropriately enclosed and/or fire-stopped? (consider above suspended ceilings)**

N/A

None present.

### Q3

**Is there adequately fire protected service risers and/or ducts in common areas, that will restrict the spread of fire and smoke?**

N/A

None present.

#### Q4

**Is compartmentation maintained in the roof space?**

N/A

The community centre is a ground floor property.

#### Q5

**Are electrics, including embedded meters, enclosed in fire rated construction?**

Unknown

The electrical intake is located within a cupboard off the corridor. It was not possible to establish if the door is fire rated (see M1).



Photo 61



Photo 62

#### Q6

**As far as can reasonably be ascertained, are fire dampers provided as necessary to protect critical means of escape against passage of fire, smoke and products of combustion in the early stages of a fire?**

N/A

None present.

#### Q7

**Is there reasonable limitation of linings to escape routes that might promote fire spread?**

Yes

Walls are solid with emulsion painted finish. Ceilings are emulsion painted plastered with some having wooden beams. Floors are solid.

#### Q8

**Are soft furnishings in common areas appropriate to limit fire spread/growth?**

Yes

Soft furnishings were inspected and were found to be of fire retardant materials.

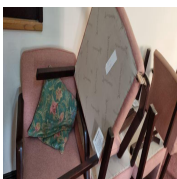


Photo 63

#### Q9

**Does the premises have any external balconies, cladding or materials which may promote external fire spread?**

N/A

None present.

## Q10

**Has a note been prepared of the external walls of the building and details of construction materials used? Does the note include and identify the level of risk that the design and materials used?**

N/A

Not required.

## Q11

**Does the External wall note include any mitigating circumstances that may have been taken to reduce the risk?**

N/A

Not required.

## Q12

**Has the responsible person reviewed the external wall note on a regular basis and revised it if there have been any significant changes in the external walls.**

N/A

Not required.

## Q13

**Are all other fire spread/compartmentation issues satisfactory?**

N/A

No further compartmentation issues were identified.

## R - Fire Extinguishing Appliances

1 action

### R1

1 action

**If required, is there reasonable provision of accessible portable fire extinguishers?**

Unknown

Extinguishers are installed in accordance with BS5306:Part 8. There are 2 x 6L 21A Water units and 1 x 2KG CO2 which is adequate for the compartment size. Extinguishers are maintained under service contract by Harmony with the last service completed in 02/23. Community centre users are unlikely to be trained on the use of FFE and no signage is displayed to state 'only to be used by trained persons'.

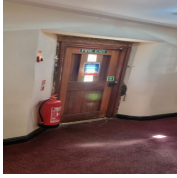


Photo 64



Photo 65



Photo 66

**Open** | Priority Medium | Due 16 Dec 2023 11:03 AM UTC | Created by Adrian Gallimore

R1

Management should display signage at fire points to state 'extinguishers should only be used by trained persons'.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

## S - Relevant Automatic Fire Extinguishing Systems

S1

**Are there any automatic fire suppressant systems on site?**

N/A

None present.

S2

**Are there any fixed fire fighting mains within the premises?**

N/A

None present.

S3

**If any other relevant systems / equipment is installed, state type of system and comment as necessary**

N/A

None present.

## T - Procedures and Arrangements

1 action

T1

**Recommended evacuation strategy for this building is:**

Simultaneous Evacuation

T2

1 action

**Has a competent person(s) been appointed to assist in undertaking the preventative and protective measures including in house checks?**

Unknown

It was not possible to ascertain if there is a competent person appointed for this property.

**Open** | Created by Adrian Gallimore

## T2

Management should confirm that there is a competent person in place to undertake the preventative and protective measures for this property.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Recommendation - No Timescale

## T3

**Are there appropriate documented fire safety arrangements and procedures in place in the event of fire?**

Yes

Fire Action Notices are displayed.

## T4

**Are there suitable arrangements for liaison and calling the Fire Service?**

Yes

Community centre users would call the Fire Service.

## T5

**Are there suitable fire assembly points away from any risk?**

Yes

Fire Action Notices have assembly point details.

## T6

**Are there adequate procedures in place for the evacuation of disabled people who are likely to be present?**

N/A

There were no persons present during the assessment. It is possible that community members using the centre could have various forms of disabilities. It is likely that they would exit the premises by the way that they entered or would be accompanied by another person.

## T7

**Are staff nominated and trained on the use of fire extinguishing appliances?**

N/A

No staff present.

## T8

**Are staff nominated and trained to assist in evacuation**

N/A

(Where applicable e.g. Offices, supported schemes)?

No staff present.

## U - Training

### U1

**Do staff receive adequate induction and annual refresher fire safety training? (To include fire risks in the premises, fire safety measures in the building, action in the event of fire and on hearing alarm, location and use of fire extinguishers, calling the fire service)**

N/A

No staff present.

Policy Principle: All touchdown points (small offices) staff receive Inductions and annual refreshers on fire safety fire safety. But at all the schemes no permanent staff are present.

### U2

**Are employees nominated to assist in the event of fire given additional training?**

N/A

No staff present.

## V - Testing and Maintenance

### V1

**Are all fire safety provisions for the building (AFD, Emergency Lighting, sprinklers etc.) routinely tested and maintained?**

Yes

Policy Principle: Alarms- FHG Greenscapes, MITIE. E/L- FHG Greenscapes, MITIE. Assets Surveyor Extinguishers- MITIE. Fire Doors- FHG Greenscapes, Assets Surveyor Final Exits/ Escape Routes- Greenscapes/ Neighbourhoods.

## W - Records

### W1

**Is all routine testing and staff training including fire drills suitably recorded and available for inspection?**

N/A

No staff present.

## X - Premises Information Box

### X1

**Is a Premises Information Box located at the premises accessible to the Fire and Rescue Service, secure from unauthorised access and kept up to date?**

N/A

There is no Premises Information Box installed.

Policy Principle: Log book is kept on SharePoint with proposed specific QR code access.

## **Y - Engagement with Residents**

**Y1**

**Has all Fire Safety information & procedures been disseminated to the residents?**

N/A

There are no residents.

## **Z - Any Other Information**

**Z1**

**Are all issues deemed satisfactory? [1]**

N/A

No further issues were identified.

**Z2**

**Are all issues deemed satisfactory? [2]**

No further issues were identified.



## Risk Rating

The following simple risk level estimator is based on a more general health and safety risk level estimator of the type contained in BS 8800:

Likelihood of fire	Potential consequences of fire		
	Slight Harm	Moderate Harm	Extreme Harm
Low	Trivial	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	Intolerable

### Likelihood of Fire

Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from fire (likelihood of fire) at these premises is:

MEDIUM

In this context, a definition of the above terms is as follows:

**Low:** Unusually low likelihood of fire as a result of negligible potential sources of ignition.

**Medium:** Normal fire hazards (e.g. potential ignition sources) for this type of occupancy, with fire hazards generally subject to appropriate controls (other than minor shortcomings).

**High:** Lack of adequate controls applied to one or more significant fire hazards, such as to result in significant increase in likelihood of fire.

### Potential Consequences of Fire

Taking into account the nature of the building and occupants, as well as the fire protection and procedural arrangements observed at the time of this fire risk assessment, it is considered that the consequences for life safety in the event of fire would be:

MODERATE HARM

Potential Consequences of Fire

In this context, a definition of the above terms is as follows:

**Slight harm:** Outbreak of fire unlikely to result in serious injury or death of any occupant.

**Moderate harmful:** Outbreak of fire could foreseeably result in injury (including serious injury) of one or more occupants, but it is unlikely to involve multiple fatalities.

**Extreme harm:** Significant potential for serious injury or death of one or more occupants likely to involve multiple fatalities.

### Premises Risk Rating

Accordingly, it is considered that the risk to life from fire at these premises is:

MODERATE

A suitable risk-based control plan should involve effort and urgency that is proportional to risk . The following risk-based control plan is based on one advocated by BS 8800 for general health and safety risks:

Risk Level	Action and time table
Trivial	No action is required and no detailed records need be kept.
Tolerable	No major additional controls required. However, there might be a need for improvements that involve minor or limited cost.
Moderate	It is essential that efforts are made to reduce the risk. Risk reduction measures should be implemented within a defined time period. Where moderate risk is associated with consequences that constitute extreme harm, further assessment might be required to establish more precisely the likelihood of harm as a basis for determining the priority for improved control measures.
Substantial	Considerable resources might have to be allocated to reduce the risk. If the building is unoccupied, it should not be occupied until the risk has been reduced. If the building is occupied, urgent action should be taken.
Intolerable	Building (or relevant area) should not be occupied until the risk is reduced.

*(Note that, although the purpose of this section is to place the risk in context, the above approach to fire risk assessment is subjective and for guidance only. All hazards and deficiencies identified in this report should be addressed by implementing all recommendations contained in the following action plan. The fire risk assessment should be reviewed regularly.)*

**On satisfactory completion of all remedial works the risk rating of this building may be reduced to**

**TOLERABLE**

## Limitations Statement

### Fire Risk Assessment – Limitations

The purpose of the fire risk assessment is solely to provide an assessment of the risk to life from fire, and, where appropriate, to make recommendations to reduce the risk to life from fire. This assessment does not address fire risks to property or business continuity.

Under Article 5(4) of the Regulatory Reform (Fire Safety) Order 2005 or other devolved equivalent regional legislation and relevant United Kingdom law, we have been appointed to provide advice to the Responsible Person only. We have no control over any part of the premises covered within this fire risk assessment, and we have no responsibility for undertaking any of the recommendations made. The assessment is intended to assist the Responsible Person to comply with their responsibilities under the Regulatory Reform (Fire Safety) Order 2005.

Any policy principles included within this Fire Risk Assessment have been provided by the responsible person or their representative and been added in good faith. We cannot take responsibility for the accuracy of the policy principles with regard to the client's internal policies, British Standards or codes of practice.

Any test certificates supplied as part of the Fire Risk Assessment process will be considered but we take no responsibility or liability whatsoever is accepted for the accuracy of such information supplied by others.

The findings of the fire risk assessment will be based upon the conditions found at the Premises at the time the assessment is to be carried out and on relevant information provided by the Responsible Person or others either prior to, during or after the Fire Risk Assessment of the premises.

We consider the External Wall System as part of the Fire Risk Assessment process, however, we take no responsibility for a fire risk appraisal of external wall construction on existing buildings and work to the guidance and limitations detailed in PAS 9980:2022 0.2 Fire risk assessments. Any information supplied to the Fire Risk Assessor is taken in good faith and we accept no responsibility for the accuracy of the information supplied.

No responsibility is accepted for any change in the conditions or circumstances prior after the Fire Risk Assessment has been undertaken.

It is stressed that the assessment should not be regarded as a structural survey for fire safety purposes as such a survey should only be entrusted to a qualified building surveyor. The Fire Risk Assessment did not involve destructive exposure (Unless specifically requested as part of a contractual arrangement), and therefore it is not always possible to survey less readily accessible areas. It is, therefore, necessary to rely on a degree of sampling and also reasonable assumptions and judgements.

All services or penetrations traversing fire resisting compartments are not confirmed as being sufficiently fire stopped with fire resisting material to the appropriate standard. If fire compartments\fire dampers\voids (ceilings, floors or other voids) are considered inaccessible for safety reasons or any other reason and cannot be physically accessed or are outside the visual range of the assessor, technical comment on these areas cannot be provided.

This fire risk assessment will not necessarily identify all minor fire-stopping issues that might exist within the building and should be considered to be a sample of fire compartmentation. Unless a full fire compartmentation survey is contractually included within the scope of the assessment. If there are reasons to suspect the fire resistance within the Premises has not been sufficiently maintained the responsibility to provide this technical information rests with the Responsible Person\duty holder.

This fire risk assessment will not necessarily identify all minor fire door issues that might exist within the building and should be considered a sample of fire doors. Unless a full fire door survey is contractually included within the scope of the assessment.

A full investigation of the design of heating, ventilation and air conditioning (HVAC) systems is outside the scope of this fire risk assessment.

Although reference in the report may be made to relevant British Standards, Codes of Practice and Guides the assessment will not, nor is it intended to, ensure compliance with any of the documents referred to in the assessment. However, deviations from generally accepted codes, standards and universally recognised good fire safety practice will be identified in the assessment.

Where an emergency escape lighting system is present, comments are based upon a visual assessment of the system coverage and condition, but no illuminance tests or verification of the installation to the relevant British Standards were carried out.

Where a fire alarm system is present, comments are based upon a visual assessment, but no audibility tests or verification of full compliance with the relevant British Standards were carried out.

Where manual firefighting equipment is present, comments are based upon a visual assessment, but no verification of full compliance with the relevant British Standards or codes of practice were carried out.

It is the expectation that any reference to the testing and maintenance of passive or active fire protection systems within the premises are undertaken to the relevant current British Standards, Codes of Practice and Guides it is the responsible person's duty to ensure this is undertaken.

There will be a brief review of procedures at the time of this fire risk assessment. An in-depth review of documentation is outside the scope of this fire risk assessment, unless otherwise stated in the contract.

The report will highlight the Significant Findings (Split into Recommendations and Action(s)) that the Fire Risk Assessor found at the time of the assessment.

It is the responsibility of the Responsible Person to ensure that any deficiencies found during the assessment and subsequently reported to the Responsible Person, by the report or other means, are their responsibility to rectify to a satisfactory standard to meet the requirements of the Regulatory Reform (Fire Safety) Order 2005.

It is wholly the responsibility of the Responsible Person and/or their agent to implement and maintain the Fire Precautions at the Premises to a satisfactory standard and condition to comply with the requirements of the Regulatory Reform (Fire Safety) Order 2005.

Failure to address and/or rectify any deficiencies mentioned in the report may result in serious harm, injury and or death to any relative person, employee, visitor, you or any other person in, on, within or without the perimeter of the Premises.

Failure to address any of the deficiencies highlighted in the report may be considered to be a breach of the Regulatory Reform (Fire Safety) Order 2005 and may result in prosecution by the enforcing authority.

Responsibility for the ongoing management of the Premises and even, if necessary, the decision to allow the Premises to be used for their present purpose, and in the current condition remains with the Responsible Person.

Responsibility for management procedures regarding, evacuation management, and maintenance of firefighting equipment, Fire alarms systems, emergency escape lighting, and any other emergency-related provisions remains a duty of the responsible person, not the fire risk assessor as this is not within their control.

Any faults or deficiencies in any emergency emergency-related staffing levels and/or staff training are the responsibility of the Responsible Person and/or the duty holder.

Portable or moveable items and items brought into the Premises are the responsibility of the Responsible Person and/or the duty holder.

It is recommended that the Assessment is reviewed annually or when there is a significant change, material alteration, change in the use of the Premises, a change in working practices, or following any incident, including fire, which may affect the Fire Precautions of the Premises.

The circumstances of the Premises may change over time and with use and/or occupancy, therefore, failure to review the fire risk assessment by the date indicated may mean that the fire risk assessment is no longer valid.

This Fire Risk Assessment is not a Health and Safety Report. A Health and Safety review should be conducted to ensure compliance with the Health and Safety at Work Act 1974.

Compliance with all other legislation is the responsibility of the Responsible Person. We accept no responsibility for loss, damage or other liability arising from a fire, loss and/or injury due to the failure to observe the safety, observance and practises identified in the Assessment

The Responsible Person will always remain responsible for the outcome of the Fire Risk

Assessment and/or its review. This includes the accuracy of details contained within this report.

By signing for, by payment for services or acknowledgement of receipt of the report you accept full responsibility and accountability for implementing the findings of the report.



## Life Safety Fire Risk Assessment Certificate of Conformity

This certificate is issued by the organization named in Part 1 of the schedule in respect of the fire risk assessment provided for the person(s) or organization named in Part 2 of the schedule at the premises and / or part of the premises identified in Part 3 of the schedule

### Schedule

<b>Part 1a - Name and Address of Certified Organisation</b>	Pennington Choices Limited
<b>Part 1b - BAFE Registration Number of Issuing Certified Organisation</b>	102119
<b>Part 1c - SSAIB 3rd Party Certificate Number</b>	CHES077
<b>Part 2 - Name of Client</b>	Futures Housing Group
<b>Part 3a - Address of premises for which the Fire Risk Assessment was carried out</b>	Community Centre Manor Farm, Queen Street: DE56 1NR
<b>Part 3b - Part or parts of the premises to which the Fire Risk Assessment applies</b>	laundry, two small sitting rooms, kitchen and entrance foyer.
<b>Part 4 - Brief description of the scope and purpose of the Fire Risk Assessment</b>	Life Safety (as agreed spec)
<b>Part 4b - Limitations of FRA</b>	See Limitations Statement
<b>Part 5 - Effective Date of the Fire Risk Assessment</b>	15 Sep 2023
<b>Part 6 - Recommended Date for Reassessment of the premises</b>	15 Sep 2025
<b>Part 7 - Unique Reference Number of this Certificate (Job Number)</b>	173529

Signed for on behalf of the Issuing Certified Organisation

James Hutton



---

**Dated:**

15 Sep 2023

---

SSAIB, 7-9 Earsdon Road, West Monkseaton, Whitley Bay, Tyne & Wear. NE25 9SX

BAFE, The Fire Service College, London Road, Moreton-in-Marsh, Gloucestershire, GL56 0RH  
01608 653 350 | [info@bafes.org.uk](mailto:info@bafes.org.uk) | [www.bafes.org.uk](http://www.bafes.org.uk)

---

## Media summary



Photo 1

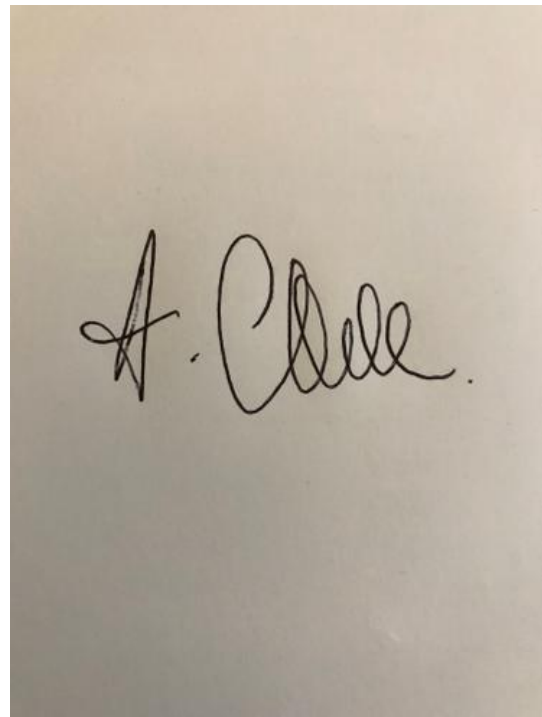


Photo 2

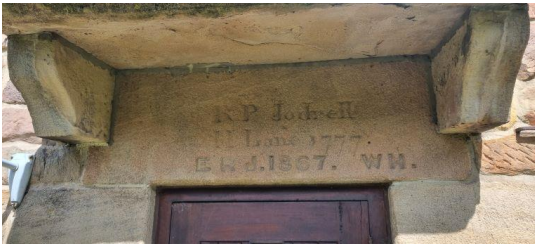


Photo 3



Photo 4



Photo 5



Photo 6





Photo 7

Photo 8

		NO	
		NO	
METER TYPE:	STANDARD	METER LOCATION:	INTERNAL
DATE:	09/05/2023	FORM ID:	880076 / 090520235540
Other	v1.00	Page 1 of 2	

Photo 9



Photo 10



Photo 11



Photo 12



Photo 13



Photo 14



Photo 15



Photo 16



Photo 17



Photo 18



Photo 19



Photo 20



Photo 21



Photo 22



Photo 23



Photo 24





Photo 25



Photo 26



Photo 27



Photo 28

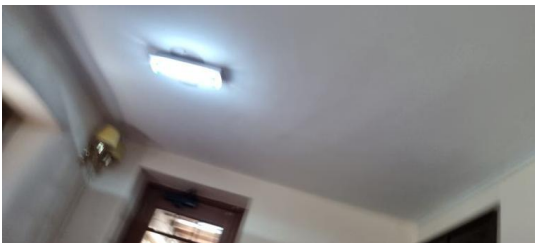


Photo 29



Photo 30



Photo 31



Photo 32



Photo 33



Photo 34



Photo 35



Photo 36



Photo 37



Photo 38



Photo 39



Photo 40



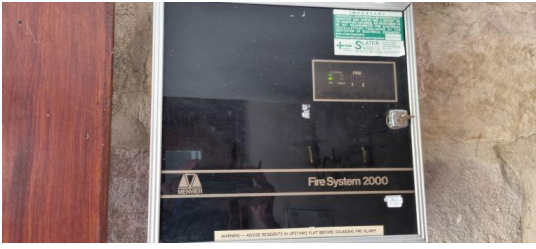


Photo 41



Photo 42



Photo 43



Photo 44





Photo 45



Photo 46



Photo 47



Photo 48



Photo 49



Photo 50



Photo 51



Photo 52

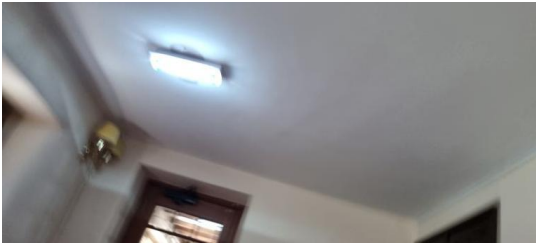


Photo 53



Photo 54



Photo 55



Photo 56



Photo 57



Photo 58



Photo 59



Photo 60



Photo 61



Photo 62



Photo 63

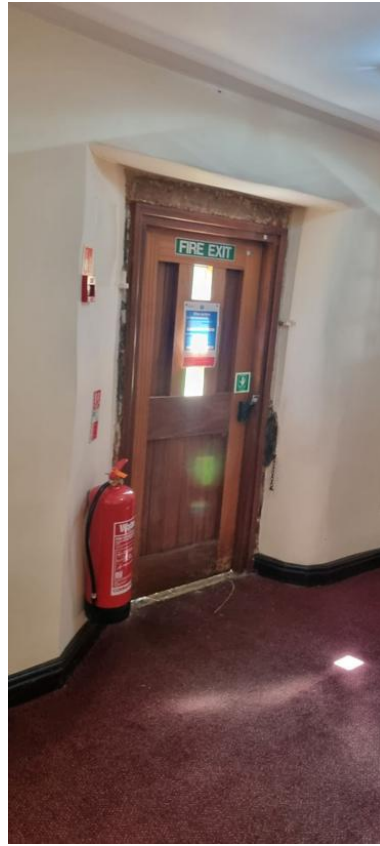


Photo 64



Photo 65



Photo 66