

FIRE RISK ASSESSMENT

PROPERTY ASSESSED: 46-56-66 Magdalene Drive Mickleover Mickleover

DE3 9DH



UPRN: 15222

Inspection Date: 22/08/2022 **Validation Date:** 01/09/2022

Valid to: 01/09/2023

FRA completed by: Pennington Choices

FRA Completed For: Futures




Executive Summary





FRA Action by Type			
Recommendations:	3		
Actions:	10		

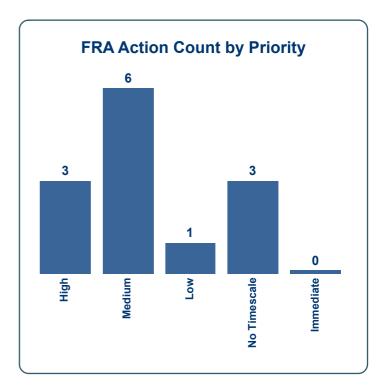

Premises Risk Rating: Moderate

Reassessment Priority: High - 1 Year

Recommended evacuation strategy for this building is: Stay Put

On satisfactory completion of all remedial works the risk rating of this building may be reduced to:: Tolerable

FRA - Summary

Responsible Person	CEO Futures
Property Designation	General needs
Management Extent	
No of Floors	3
No of Flats (if applicable)	3
Ground floor Area (m2)	40
Total Area of all floors (m2)	120

FRA Completed By:	Gary Broadhurst
FRA Type:	Type 1
QA Validation Date:	01/09/2022
QA Carried Out By:	Piotr Iwan
Validator's Signature:	



High 3

Ref.	Category		Priority	Complete By
P1	Means Of Giving Warning In Case Of Fire		High	01/Oct/2022
Finding/	Finding/Observation Action/Recommendation		n	
The prop common	perty is fitted with a domestic fire alarm system in the areas	fire alarm system is not r the rationale of providing compartmentation survey The survey should confir	m if the property supports sta	I confirm ying out a ay put or if

Image: P11



Ref.	Category		Priority	Complete By
Q4	Measures To Limit Fire Spread And Development		High	01/Oct/2022
Finding/Observation		Action/Recommendation		
No access to the roof space is provided but the roof hatch was closed		Management to check co	empartmentation within the ro	of space

Ref.	Category		Priority	Complete By
Q5	Measures To Limit Fire Spread And Development		High	01/Oct/2022
Finding/Observation Action/Recommend		Action/Recommendation	tion	
The meter cupboards were locked shut however the ceilings had exposed holes The compartmentation requires improving by finishistic stopping in the cupboards to an acceptable level where the provide the required fire separation between floors		s to an acceptable level whic		



High 3

Image: Q51





Medium 6

Ref.	Category		Priority	Complete By
G2	House-Keeping		Medium	30/Nov/2022
Finding/Observation		Action/Recommendation		
the area l	on area escape routes were clear of items other than beneath the stairs which was used to store items children's toys and a bike		combustible items noted are r neans of escape and the area	

Image: G21



Ref.	Category		Priority	Complete By
H1	Hazards Introduced By Contractors		Medium	30/Nov/2022
Finding/Observation Action/Recommendation		ion		
control ov	was not available to confirm there is satisfactory ver works carried out in the building by contractors work permits).	contractors are controlled approved industry standa work and a hot work perr	e is recommended for ensuring don site and only operate with ards. This should include a permit procedure where appropriate of the emergency procedure.	chin ermit to ate. All

Ref.	Category		Priority	Complete By
01	Fire Safety Signs & Notices		Medium	30/Nov/2022
Finding/Observation Action/Re		Action/Recommendation		
Signage requires improvements and should include a fire action notices to ensure persons in the common areas fully evacuate the building if they hear an alarm or discover a fire.		Display suitable fire action	n notices in the escape route	2 S.



Mediun	n		

P7 Means Of Giving Warning In Case Of Fire Medium Finding/Observation Action/Recommendation	30/Nov/2022		
Finding/Observation Action/Recommendation			
all circumstances". However, BS 5839-6:2019 states the detectors should be installed in every kitchen. A smoke detector should be installed in the principal habitable of the where more than one room might be used as the principal habitable room, a smoke detector should be installed in of these rooms. It is recommended that each flat is characteristic.	A category LD3 system should be considered the minimum in all circumstances". However, BS 5839-6:2019 states that "heat detectors should be installed in every kitchen. A smoke detector should be installed in the principal habitable room. Where more than one room might be used as the principal habitable room, a smoke detector should be installed in each of these rooms". It is recommended that each flat is checked to confirm that BS5839-6:2019 Grade D, LD2 detection is fitted.		

Ref.	Category		Priority	Complete By	
Q6	Measures To Limit Fire Spread And Development		Medium	30/Nov/2022	
Finding/Observation Action/Recommendation		n			
		Management should con dampers are provided as	onfirm that where and if required fire as required.		

Ref.	Category	Priority	Complete By
V1	Testing And Maintenance	Medium	30/Nov/2022



Medium		
Finding/Observation	Action/Recommendation	
All fire safety provisions require testing in accordance with the relevant guides or standards.	-Manual opening smoke vents (MOV) are provided on site which must be tested and maintained in accordance with BS EN12101-2 -The riser requires an annual pressure testing to 12Bar as dictated by BS9990:2015 and 6 monthly visual checks.	

Low 1

Ref.	ef. Category		Priority	Complete By
B1	1 Smoking Policies		Low	28/Feb/2023
Finding/Observation		Action/Recommendation		
No signs of smoking were seen inside the property at the time of the assessment.		"No smoking" signs should be displayed at the main entrance.		entrance.



No Timescale		
NO Timescale		

Ref.	Category		Priority	Complete By
F1	Lightning		No Timescale	
Finding/0	Observation	Action/Recommendation		
No lightning protection system was seen on site.		Recommend management undertake a risk assessment of the building to determine if lightning protection is required		

Ref.	. Category		Priority	Complete By
Т6	6 Procedures And Arrangements		No Timescale	
Finding/Observation		Action/Recommendation		
Unable to confirm at the time of the assessment			sk Assessments should be ca eral needs property, when req on an annual basis.	

Ref.	. Category		Priority	Complete By
Y1	Y1 Engagement With Residents		No Timescale	
Finding/Observation		Action/Recommendation		
Unknown.			ormed of all relevant fire safet cluding letters, posters, socia	•



Reassessment Priority	High - 1 Year
Responsible Person	CEO Futures
BAFE Cert	CHES077

General Information

UPRN	15222
Address	46-56-66 Magdalene Drive Mickleover Mickleover
Postcode	DE3 9DH
Fire Risk Assessor	Gary Broadhurst
Date of Inspection	22/08/2022
Checked by	Piotr Iwan
Reassessment Date	22/08/2023

General Information

Property Designation	General needs
Property Type	Purpose built flat
No of Floors	3
No of Flats (if applicable)	3
Ground floor area (m2)	40
Total area of all floors	120

Building Construction Extent of common areas	46-56-66 Magdalene Drive. The purpose built 3 storey block of flats was constructed recently in accordance with current building regulations, is semi-detached and stands back from the road with parking areas at the front The building has 3 floors and 3 apartments which his traditionally constructed of brick with a pitched and tiled roof The property has one exit door which is the main entrance door and is provided with overhead self-closing device and electronic entry system. The door is also provided with thumb turn device inside The stairs are open plan from ground to second floor All flats are provided with new FDS30S certificated fire doors which were all in good condition A dry riser inlet is provided at the main entrance and outlets are provided on each floor level Waste bins are stored outside the property in a dedicated area in the car park The escape routes other than the stairs were clear of obstruction as items such as a push bike and children's toys were being stored beneath the stairs The property is provided with suitable escape lighting and a common area fire alarm system which appears compliant with BS 5839 part 6 and covers the escape routes, however the reason for providing the fire alarm in the common areas is unknown There is no provision of firefighting equipment, and signage included, running man exit signs but was lacking with information signs including fire action notices and no smoking signs The top floor is provided with AOV connected to a manual button on the ground floor The meter room ceiling on the ground floor is not suitably fire stopped and requires attention It is recommended that a compartmentation report is carried out to establish if the building can support an initial stay put policy, and if the fire detection in the common areas can be removed No access was provided into any of the apartments Overall, the property appeared well kept, and clean and tidy
Extent of common areas	Means of escape.
Areas of the building to which access was not available	Roof space
If applicable state which flats were sample inspected	None



1. The Occupants

Ref.	Question	Policy Principles
10	Management Extent	
Answer		Finding/Observation
Partially regularly	Managed Building - Manager or Senior Staff not onsite	
Ref.	Question	Policy Principles
11	Details of any onsite management (hours onsite etc.)	
Answer		Finding/Observation
Unknow	n.	
Ref.	Question	Policy Principles
12	Person managing fire safety in premises	
Answer		Finding/Observation
Shared occupie	responsibilities between Future and residents when d.	
Ref.	Question	Policy Principles
13	Person consulted during the fire risk assessment	
Answer		Finding/Observation
Ben Wo	od	
Ref.	Question	Policy Principles
14	Number of occupants (maximum estimated)	
Answer		Finding/Observation
6		
Ref.	Question	Policy Principles
15	Approximate maximum number of employees at any one time	
Answer		Finding/Observation
1		
Ref.	Question	Policy Principles
16	Number of members of the public (maximum estimated)	
Answer		Finding/Observation
3		



Ref.	Question	Policy Principles
17	Identify any people who are especially at risk: - sleeping occupants - disabled occupants - occupants in remote areas and lone workers - young persons - others	
Answe	r	Finding/Observation
This is a "general needs" block of flats that will have sleeping occupants. It is conceivable that there may be young persons, the elderly and children within the flats as part of families who reside there. There may also be occupants with varying degrees of physical/mental impairment. In addition, lone workers may be present within common parts of the premises.		



2. Fire Safety Legislation

Ref.	Question	Policy Principles			
21	The following fire safety legislation applies to these premises				
Answer		Finding/Observation			
Regulato	ory Reform (Fire Safety) Order 2005				
Ref.	Question	Policy Principles			
22	The above legislation is enforced by				
Answer		Finding/Observation			
Derbysh	ire Fire and Rescue Service				
Ref.	Question	Policy Principles			
23	Other key fire safety legislation (other than Building Regs 2000)				
Answer		Finding/Observation			
Housing	Act 2004				
Ref.	Question	Policy Principles			
24	The other legislation referred to above is enforced by				
Answer		Finding/Observation			
Derby ci	ty Council				
Ref.	Question	Policy Principles			
25	Guidance used as applicable to premises and occupation				
Answer		Finding/Observation			
Home O Blocks	ffice (September 2021) Fire Safety in Purpose Built				
Ref.	Question	Policy Principles			
26	Is there an alteration or enforcement notice in force?				
Answer		Finding/Observation			
No					
Ref.	Question	Policy Principles			
27	Fire loss experience (since last FRA)				
Answer		Finding/Observation			
No					



A. Electrical Ignition Sources

Ref.	Question	Policy Principles		
A1	Is the fixed electrical installation periodically inspected and tested, (include dates if known)?	FHG complete Fixed wire testing in line with current regulations every 5 years and complete an annual visual inspection on all properties.		
Answer		Finding/Observation		
Yes		See principle.		
Ref.	Question	Policy Principles		
A2	Is PAT testing in common areas carried out?	PAT testing is complete at the time of the visual inspection as mentioned above. All items in the communal areas will be tested.		
Answer		Finding/Observation		
N/A		There are no portable electrical items in the common areas.		
Ref.	Question	Policy Principles		
A3	Is there a policy for personal electrical appliances (consider restrictions of communal supply points such as outlets and T pin outlets)?	All personal items are not to be left in communal areas. Mobility Scooter Policy		
Answer		Finding/Observation		
Yes		See principle.		
Ref.	Question	Policy Principles		
A4	Is the use of adapters and leads limited?			
Answer		Finding/Observation		
N/A				
Ref.	Question	Policy Principles		
A5	Are they any PV cells installed and do they have the appropriate isolation systems and signage to assist the fire and rescue service?			
Answer		Finding/Observation		
No				



B. Smoking Policies

Ref.	Question	Policy Principles	Policy Principles		
B1	Are there suitable arrangements to prevent fire as a result from smoking?	No smoking policy in	No smoking policy in all communal areas- signage displayed.		
Answer		Finding/Observatio	Finding/Observation		
Yes		No signs of smoking the assessment.	No signs of smoking were seen inside the property at the time of the assessment.		
Action/Recommendation		'	Priority	Due Date	
"No smoking" signs should be displayed at the main entrance.			Low	28/Feb/2023	

Ref.	Question	Policy Principles
B2	Is the policy being adhered to and are "No smoking" signs provided in the common areas?	
Answer		Finding/Observation
Yes		See B1

C. Arson

Ref.	Question	Policy Principles		
C1 Are premises secure against arson by outsiders? (Please state how)				
Answer		Finding/Observation		
Yes		The entrance door was locked and is provided with electronic access device and handle release inside which does not require a key. Handle is connected to the locking device to release it automatically.		
Images				

Image: C11



Ref.	Question	Policy Principles	
C2	Are bins secured or fire loading stored in a suitable location? (Please state bin type, location, if and how it is secured)		
Answer		Finding/Observation	
Yes		Waste and recycling are stored outside at the side of the building in a communal space	



D. Portable Heaters And Heating Installations

Ref.	Question	Policy Principles		
D1 If used, is the use of portable heaters regarded as safe?				
Answer		Finding/Observation		
N/A				
Ref.	Question	Policy Principles		
D2	Are fixed heating systems maintained annually?	All Safety inspections carried out annually by qualified persons.		
Answer		Finding/Observation		
N/A		No heating is provided in the common areas.		

E. Cooking

Ref.	Question	Policy Principles	
E1	Are reasonable measures in place to prevent fires as a result of cooking, including replacing filter(where necessary)?		
Answer		Finding/Observation	
N/A		No cooking facilities within the communal areas.	

F. Lightning

Ref.	Question	Policy Principles		
F1	Does the building have a lightning protection system?	No lightning protection policy in place		
Answer		Finding/Observation		
No		No lightning protection system was seen on site.		



G. House-Keeping

Ref.	Question	Policy Principles
G1	Are combustible materials kept away from any sources of ignition, including gas and electrical intake cupboards?	
Answer		Finding/Observation
Yes		

Ref.	Question	Policy Principles			
G2	Are the escape routes kept clear of items combustible materials or waste and free of any trip hazards?				
Answer		Finding/Observation	Finding/Observation		
Yes		All common area es the area beneath the including children's t	e stairs which was us		han

Madisus 200/Nav/2000	A	ction/Recommendation	Priority	Due Date
Management to ensure combustible items noted are removed from the common area/means of escape and the area kept clear.		anagement to ensure combustible items noted are removed from the common ea/means of escape and the area kept clear.	Medium	30/Nov/2022

Images

Image: G21



Ref.	Question	Policy Principles
G3	Are mobility scooters or electric vehicles stored in the means of escape? If yes has an assessment been undertaken in line with the NFCC "Mobility Scooter Guidance for Residential Buildings"?	
Answer		Finding/Observation
No		



H. Hazards Introduced By Contractors

Ref.	Question	Policy Principles		
H1	Is there satisfactory control over works carried out in the building by contractors (e.g. hot work permits)?			
Answe	or .	Finding/Observation	on	
			available to confirm to carried out in the bui	here is satisfactory ilding by contractors (e.g.
Action/Recommendation		'	Priority	Due Date
A documented procedure is recommended for ensuring all contractors a controlled on site and only operate within approved industry standards. should include a permit to work and a hot work permit procedure where appropriate. All contractors should be advised of the emergency proced hazardous areas.		ds. This ere	Medium	30/Nov/2022

I. Dangerous Substances

Ref.	Question	Policy Principles
l1	If dangerous substances are used, has a risk assessment been carried out as required by the Dangerous Substances and Explosives Atmospheres Regulations 2002 and are they stored correctly?	All contractors must submit RAMS for procurement processes, and these are reviewed annually by FHG. A specific risk assessment is to be completed for each job.
Answer		Finding/Observation
N/A		See principle.

J. Other Significant Hazards

Ref.	Question	Policy Principles
J1	Are all issues deemed satisfactory? [1]	
Answer		Finding/Observation
Yes		
Ref.	Question	Policy Principles
J2	Are all issues deemed satisfactory?	
Answer		Finding/Observation
Yes		



K. Means Of Escape

Ref.	Question	Policy Principles
K1	Is the escape route design deemed satisfactory? (Consider current design codes)	
Answer		Finding/Observation
Yes		

Ref.	Question	Policy Principles
K2	Is the fire-resisting construction (including any glazing) protecting escape routes and staircases of a suitable standard and maintained in sound condition?	
Answe	r	Finding/Observation
Yes		All flat entrance doors were solid in good condition and certificated as required.

Images

Answer Yes

Image: K21



Ref.	Question	Policy Principles
K3	Is there adequate provision of exits (including exit Widths) for the numbers who may be present?	Tensy Timespee
Answe	r	Finding/Observation
Yes		A single entrance /exit door is provided which is considered adequate for the numbers inside
Ref.	Question	Policy Principles
K4	Are doors on escape routes easily opened? (and are sliding or revolving doors avoided?)	
Answer		Finding/Observation
Yes		The main entrance door worked as it should
Ref.	Question	Policy Principles
K5	Do final exits open in the direction of escape where necessary?	
Answe	r	Finding/Observation



Ref.	Question	Policy Principles
K6	Are travels distances satisfactory? (consider single direction and more than one direction, property risk profile and occupancy characteristics)	
Answe	er	Finding/Observation
Yes		Each flat is next to the landing and or down stairs to the exit door.
Ref.	Question	Policy Principles
K7	Are there suitable precautions for all inner rooms?	
Answe	er	Finding/Observation
N/A		
Ref.	Question	Policy Principles
K8	Are escape routes separated where appropriate?	
Answer		Finding/Observation
N/A		The stairs are open plan with flat entrance doors off each landing
Ref.	Question	Policy Principles
K9	Are corridors sub-divided where appropriate?	
Answe	er	Finding/Observation
N/A		
Ref.	Question	Policy Principles
K10	Do escape routes lead to a place of safety?	
Answe	er	Finding/Observation
Yes		All escape routes lead to stairs and the final exit door.
Ref.	Question	Policy Principles
K11	Are the stairs and/or lobbies provided with adequate ventilation? (If considered satisfactory, please state provision)	
Answe	er	Finding/Observation
Yes		The stairs are provided with smoke vents

Images

Image: K112 Image: K111







Ref.	Question	Policy Principles
K12	Is there any other issues that could affect the means of escape, for example plastic conduit/loose cables not secured by fire rated fastening?	
Answer		Finding/Observation
No		

L. Flat Entrance Doors

Ref.	Question	Policy Principles
L1	Are the sample inspection flat entrance door or doors in good condition and appropriately fire rated?	
Answer		Finding/Observation
Yes		The flat entrance doors all appeared in good solid condition and have certification in place.
Images		,



Image: L11

M. Common Area Fire Doors

Ref.	Question	Policy Principles
M1	Are all common area fire door and frames in good condition and appropriately fire rated?	
Answer		Finding/Observation
Yes		The only common area doors are the cupboard doors which are, signed in good condition and were locked shut.
Images		signed in good condition and were locked shut.

Image: M11





N. Emergency Lighting

Ref.	Question	Policy Principles
N1 If emergency lighting is provided, is the coverage sufficient and in good repair? (Internal and external)		
Answe	r	Finding/Observation
Yes		The escape lights cover the escape routes and are identified by green led.
		-

Images

Image: N11



Ref.	Question	Policy Principles
N2	If EL not provided, is borrowed/artificial lighting sufficient for escape? (Internal and external)	
Answer		Finding/Observation
N/A		

O. Fire Safety Signs & Notices

Ref.	Question	Policy Principles		
01	Is there adequate provision of visible fire safety signs and notices? (Consider directional, exits, stairs, fire action notices, Fire door keep shut, fire equipment and 'do not use lift' signage)			
Answer		Finding/Observation		
No		notices to ensure pe	Signage requires improvements and should include a fire action notices to ensure persons in the common areas fully evacuate the building if they hear an alarm or discover a fire.	
Action/Recommendation		·	Priority	Due Date
Display suitable fire action notices in the escape routes.			Medium	30/Nov/2022

Ref.	Question	Policy Principles
O2	Wayfinding Signage (buildings over 11 metres in height). Are there clear markings for flat and floor recognition provided?	
Answer		Finding/Observation
N/A		



P. Means Of Giving Warning In Case Of Fire

Ref.	Question	Policy Princip	les		
P1	Is a reasonable fire detection and fire alarm system provided in the common areas, where necessary?				
Answe	er	Finding/Obser	rvation		
Unknown			The property is fitted with a domestic fire alarm system in the common areas		
Action/Recommendation			Priority	Due Date	
If the building supports an initial stay put policy a common area fire alarm system is not required. Management should confirm the rationale of providing the domestic system by carrying out a compartmentation survey. The survey should confirm if the property supports stay put or if the fire detection system requires upgrading to support a simultaneous evacuation.			High	01/Oct/2022	

Images

N/A

Image: P11



Ref.	Question	Policy Principles	
P2	If installed, is the common area AFD adequate for the occupancy and fire risk?		
Answe	r	Finding/Observation	
Unknov	vn	See P1	
Ref.	Question	Policy Principles	
P3	If not installed, are the premises deemed safe without a common area AFD system?		
Answer		Finding/Observation	
Unknown		See P1	
Ref.	Question	Policy Principles	
P4	If there is a communal fire detection and fire alarm system, does it extend into the dwellings?		
Answe	r	Finding/Observation	
No			
Ref.	Question	Policy Principles	
P5	Where appropriate, has a fire alarm zone plan been provided?		
Answe	r	Finding/Observation	



Ref.	Question	Policy Principl	es	
P6	Where appropriate, are there adequate arrangements for silencing and resetting an alarm condition?			
Answe	er	Finding/Obser	vation	
N/A		See P1		
Ref.	Question	Policy Principl	es	
P7	If applicable, is a separate domestic hard-wired smoke/heat alarm within the flats installed to a suitable standard?			
Answer		Finding/Observation		
Unkno	wn	No flats were a	No flats were accessed during the site visit	
Action	n/Recommendation		Priority	Due Date
A category LD3 system should be considered the minimum in all circumstances". However, BS 5839-6:2019 states that "heat detectors should be installed in every kitchen. A smoke detector should be installed in the principal habitable room. Where more than one room might be used as the principal habitable room, a smoke detector should be installed in each of these rooms". It is recommended that each flat is checked to confirm that BS5839-6:2019 Grade D, LD2 detection is fitted.			Medium	30/Nov/2022

Ref.	Question	Policy Principles
P8	If applicable (Sheltered scheme) is the smoke detection within the flats monitored by an alarm receiving centre/on site scheme manager via a telecare system?	
Answe	er	Finding/Observation
N/A		



Q. Measures To Limit Fire Spread And Development

Ref.	Question	Policy Principles		
Q1	Is there adequate levels of compartmentation between floors and between flats and the common escape routes?			
Answe	er	Finding/Observation	1	
Yes				
Ref.	Question	Policy Principles		
Q2	Are hidden voids appropriately enclosed and/or fire-stopped? (consider above suspended ceilings)			
Answe	er	Finding/Observation	1	
N/A				
Ref.	Question	Policy Principles		
Q3	Is there adequately fire protected service risers and/or ducts in common areas, that will restrict the spread of fire and smoke?			
Answe	er	Finding/Observation		
N/A				
Ref.	Question	Policy Principles		
Q4	Is compartmentation maintained in the roof space?			
Answe	er	Finding/Observation		
Unknown		No access to the roof space is provided but the roof hatch was closed		roof hatch was
Action	/Recommendation	,	Priority	Due Date
Manag area	gement to check compartmentation within the roof space over	the common	High	01/Oct/2022



Ref.	Question	Policy Principles			
Q5	Are electrics, including embedded meters, enclosed in fire rated construction?				
Answer		Finding/Observation	Finding/Observation		
Unknown		The meter cupboards were locked shut however the ceilings had exposed holes			
Action/Recommendation			Priority	Due Date	
cupboa	mpartmentation requires improving by finishing the fire stopping ards to an acceptable level which will provide the required fire seen floors		High	01/Oct/2022	
Images	3			-	

Image: Q51



Ref.	Question	Policy Principles		
Q6	As far as can reasonably be ascertained, are fire dampers provided as necessary to protect critical means of escape against passage of fire, smoke and products of combustion in the early stages of a fire?			
Answer		Finding/Observation		
Unknov	vn	No evidence is kept for inspection on site.		
Action/Recommendation			Priority	Due Date
Management should confirm that where and if required fire dampers are provas required.		e provided	Medium	30/Nov/2022

Ref.	Question	Policy Principles
Q7	Is there reasonable limitation of linings to escape routes that might promote fire spread?	
Answer		Finding/Observation
Yes		Walls and surface finishing's appeared to be non-flammable

Ref.	Question	Policy Principles
Q8	Are soft furnishings in common areas appropriate to limit fire spread/growth?	
Answer		Finding/Observation
N/A		



Ref.	Question	Policy Principles	
Q9	Does the premises have any external balconies, cladding or materials which may promote external fire spread?		
Answe	er	Finding/Observation	
No			
Ref.	Question	Policy Principles	
Q10	Has a note been prepared of the external walls of the building and details of construction materials used? Does the note include and identify the level of risk that the design and materials used?		
Answe	er	Finding/Observation	
N/A			
Ref.	Question	Policy Principles	
Q11	Does the External wall note include any mitigating circumstances that may have been taken to reduce the risk?		
Answer		Finding/Observation	
N/A			
Ref.	Question	Policy Principles	
Q12	Has the responsible person reviewed the external wall note on a regular basis and revised it if there have been any significant changes in the external walls.		
Answe	er	Finding/Observation	
N/A			
Ref.	Question	Policy Principles	
Q13	Are all other fire spread/compartmentation issues satisfactory?		
Answe	er	Finding/Observation	
Yes			

R. Fire Extinguishing Appliances

Ref.	Question	Policy Principles
R1 if required, is there reasonable provision of accessible portable fire extinguishers?		
Answer		Finding/Observation
N/A		Typically fire extinguishers are not provided within this type of property as residents are unlikely to have been appropriately trained.



S. Relevant Automatic Fire Extinguishing Systems

Ref.	Question	Policy Principles
S1	Are there any automatic fire suppressant systems on site?	
Answer		Finding/Observation
No		

Ref.	Question	Policy Principles
S2 Are there any fixed fire fighting mains within the premises?		
Answer		Finding/Observation
Yes		The property is provided with an inlet for the dry riser system at the side of the building and an outlet on each floor level

Images

Image: S21



Image: S22



Ref.	Question	Policy Principles
S3 If any other relevant systems / equipment is installed, state type of system and comment as necessary		
Answer		Finding/Observation
Yes		The property has an opening smoke vent at the head of the stairs with control switch located at the main entrance. See K11



T. Procedures And Arrangements

Ref.	Question	Policy Principles
T1	Recommended evacuation strategy for this building is	
Answei	r	Finding/Observation
Stay Pu	ıt	See P1
Ref.	Question	Policy Principles
T2	Has a competent person(s) been appointed to assist	1 only 1 morphes
	in undertaking the preventative and protective measures including in house checks?	
Answei	•	Finding/Observation
Yes		The visiting officer was aware of all fire safety provisions and requirements for the site, and carries out regular inspections.
Ref.	Question	Policy Principles
Т3	Are there appropriate documented fire safety arrangements and procedures in place in the event of fire?	
Answei	r	Finding/Observation
No		No Fire action notices are provided in the property. See 01
Ref.	Question	Policy Principles
T4	Are there suitable arrangements for liasion and calling the Fire Service?	
Answer		Finding/Observation
Yes		Staff, contractors, residents or visitors when the building is occupied will call 999.
Ref.	Question	Policy Principles
T5	Are there suitable fire assembly points away from any risk?	
Answei	r	Finding/Observation
Yes		The fire assembly point is outside and is clear of the building.
Ref.	Question	Policy Principles
Т6	Are there adequate procedures in place for the evacuation of disabled people who are likely to be present?	
Answei	r	Finding/Observation
Unknown		Unable to confirm at the time of the assessment
Ref.	Question	Policy Principles
T7	Are staff nominated and trained on the use of fire extinguishing appliances?	
Answei	r	Finding/Observation
N/A		No staff on site.



Ref.	Question	Policy Principles
Т8	Are staff nominated and trained to assist in evacuation (Where applicable e.g. Offices, supported schemes)?	
Answer		Finding/Observation
N/A		No staff on site.

U. Training

Ref.	Question	Policy Principles		
U1 Do staff receive adequate induction and annual refresher fire safety training? (To include fire risks in the premises, fire safety measures in the building, action in the event of fire and on hearing alarm, location and use of fire extinguishers, calling the fire service)		All touchdown points (small offices) staff receive Inductions and annual refreshers on fire safety fire safety. But at all the schemes no permanent staff are present.		
Answer		Finding/Observation		
N/A		No staff on site.		
Ref.	Question	Policy Principles		
U2	Are employees nominated to assist in the event of fire given additional training?			
Answer		Finding/Observation		
N/A		No staff on site.		

V. Testing And Maintenance

Ref.	Question	Policy Principles	i	
V1	Are all fire safety provisions for the building (AFD, Emergency Lighting, sprinklers etc.) routinely tested and maintained?	E/L- FHG Greens Extinguishers- MI Fire Doors- FHG	eenscapes, MITIE scapes, MITIE, Assets ITIE Greenscapes, Assets pe Routes- Greenscap	Surveyor
Answe	r	Finding/Observa	tion	
Yes		, ,	All fire safety provisions require testing in accordance with the relevant guides or standards.	
Action/Recommendation			Priority	Due Date
-Manual opening smoke vents (MOV) are provided on site which must be to and maintained in accordance with BS EN12101-2 -The riser requires an annual pressure testing to 12Bar as dictated by BS9990:2015 and 6 monthly visual checks.			Medium	30/Nov/2022

W. Records

Ref.	Question	Policy Principles
W1	Is all routine testing and staff training including fire drills suitably recorded and available for inspection?	
Answer		Finding/Observation
Yes		Records are available to view on line.



X. Premises Information Box

Ref.	Question	Policy Principles	
X1 Is a Premises Information Box located at the premises accessible to the Fire and Rescue Service, secure from unauthorised access and kept up to date?		Log book is kept on SharePoint with proposed specific QR code access.	
Answei	•	Finding/Observation	
N/A		Not required.	

Y. Engagement With Residents

Ref. Question		Policy Principles
Y1	Has all Fire Safety information & procedures been disseminated to the residents?	
Answer		Finding/Observation
Unknown		Unknown.

Z. Any Other Information

re all issues deemed satisfactory? [1]			
	Finding/Observation		
uestion	Policy Principles		
re all issues deemed satisfactory?			
	Finding/Observation		
_	uestion e all issues deemed satisfactory?		



ZAAR. Assessment Risk Ratings

Ref.	Question	Policy Principles
ZAAR1	Likelihood of Fire Low: Unusually low likelihood of fire as a result of negligible potential sources of ignition. Medium: Normal fire hazards (e.g. potential ignition sources) for this type of occupancy, with fire hazards generally subject to appropriate controls (other than minor shortcomings). High: Lack of adequate controls applied to one or more significant fire hazards, such as to result in significant increase in likelihood of fire	
Answer		Finding/Observation
Medium		

Ref.	Question	Policy Principles
ZAAR2	Potential Consequences of Fire Slight harm: Outbreak of fire unlikely to result in serious injury or death of any occupant. Moderate harmful: Outbreak of fire could foreseeably result in injury (including serious injury) of one or more occupants, but it is unlikely to involve multiple fatalities. Extreme harm: Significant potential for serious injury or death of one or more occupants likely to involve multiple fatalities	
Answer		Finding/Observation
Moderate Harm		

Ref.	Question	Policy Principles
ZAAR3	Premises Risk Rating	
	Trivial: No action is required and no detailed records	
	need be kept	
	Tolerable: No major additional controls required.	
	However, there might be a need for improvements that	
	involve minor or	
	limited cost.	
	Moderate: It is essential that efforts are made to	
	reduce the risk. Risk reduction measures should be	
	implemented within a	
	defined time period. Where moderate risk is	
	associated with consequences that constitute	
	extreme harm, further	
	assessment might be required to establish more	
	precisely the likelihood of harm as a basis for	
	determining the	
	priority for improved control measures.	
	Substantial: Considerable resources might have to be	
	allocated to reduce the risk. If the building is	
	unoccupied, it should not	
	be occupied until the risk has been reduced. If the	
	building is occupied, urgent action should be taken.	
	Intolerable: Building (or relevant area) should not be	
	occupied until the risk is reduced	
Answer		Finding/Observation
Moderat	e	

Ref. Question		Policy Principles		
ZAAR4 On satisfactory completion of all remedial works the risk rating of this building may be reduced to:				
Answer		Finding/Observation		
Tolerable				

Risk Rating



The following simple risk level estimator is based on a more general health and safety risk level estimator of the type contained in BS 8800:

Libelihaad of five	Potential consequences of fire				
Likelihood of fire	Slight Harm	Moderate Harm	Extreme Harm		
Low	Trivial	Tolerable	Moderate		
Medium	Tolerable	Moderate	Substantial		
High	Moderate	Substantial	Intolerable		

Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from fire (likelihood of fire) at these premises is:

Medium

In this context, a definition of the above terms is as follows:

Low: Unusually low likelihood of fire as a result of negligible potential sources of ignition.

Medium: Normal fire hazards (e.g. potential ignition sources) for this type of occupancy, with fire hazards generally subject to appropriate controls (other than minor shortcomings).

High: Lack of adequate controls applied to one or more significant fire hazards, such as to result in significant increase in likelihood of fire

Taking into account the nature of the building and occupants, as well as the fire protection and procedural arrangements observed at the time of this fire risk assessment, it is considered that the consequences for life safety in the event of fire would be:

Moderate Harm

In this context, a definition of the above terms is as follows:

Slight harm: Outbreak of fire unlikely to result in serious injury or death of any occupant.

Moderate harmful: Outbreak of fire could foreseeably result in injury (including serious injury) of one or more occupants, but it is unlikely to involve multiple fatali-ties.

Extreme harm: Significant potential for serious injury or death of one or more occupants likely to involve multiple fatalities.

Accordingly, it is considered that the risk to life from fire at these premises is:

Moderate

A suitable risk-based control plan should involve effort and urgency that is proportional to risk. The following risk-based control plan is based on one advocated by BS 8800 for general health and safety risks:

Risk Level	Action and time table
Trivial	No action is required and no detailed records need be kept.
Tolerable No major additional controls required. However, there might be a need for improvements that involve minor or limited cost.	
Moderate	It is essential that efforts are made to reduce the risk. Risk reduction measures should be implemented within a defined time pe-riod. Where moderate risk is associated with consequences that constitute extreme harm, further assessment might be required to establish more precisely the likelihood of harm as a basis for determining the priority for improved control measures.
Substantial	Considerable resources might have to be allocated to reduce the risk. If the building is unoccupied, it should not be occupied until the risk has been reduced. If the building is occupied, urgent action should be taken.
Intolerable	Building (or relevant area) should not be occupied until the risk is reduced.

(Note that, although the purpose of this section is to place the risk in context, the above approach to fire risk assessment is subjective and for guidance only. All hazards and deficiencies identified in this report should be addressed by implementing all recommendations contained in the following action plan. The fire risk assessment should be reviewed regularly.)





Life Safety Fire Risk Assessment Certificate of Conformity

This certificate is issued by the organization named in Part 1 of the schedule in respect of fire risk assessment provided for the person(s) or organization named in Part 2 of the schedule at the premises and / or part of the premises identified in Part 3 of the schedule.

Schedule:

Part 1a	Name & Address of Certified Organisation:
	Pennington Choices, Broofield House, Grimsditch Lane, WA4 4EA
Part 1b	BAFE registration number of issuing Certified Organization:
	102119
Part 1c	SSAIB 3rd Party Certificate Number:
	CHES077
Part 2	Name of Client:
	CEO Futures
Part 3a	Address of premises for which the fire risk assessment was carried out:
	46-56-66 Magdalene Drive Mickleover Mickleover DE3 9DH
Part 3b	Part or parts of the premises to which the fire risk assessment applies:
	Common Parts only (not dwellings, where applicable)
Part 4	Brief description of the scope and purpose of the fire risk assessment:
	Life Safety (as per agreed Specification)
Part 5	Effective date of the fire risk assessment:
	22/08/2022
Part 6	Recommended date for reassessment of the premises:
	22/08/2023
Part 7	Unique reference number of this certificate:
	109695

Signed for and on behalf of the issuing Certificated Organization:

James Hutton

Dated: 9/1/2022

Appendix 1. Action Details

Ref.	Category	Priority	Comments	Recommendation	Quantity	To Be Completed By	Photo Ref.
B1	SMOKING POLICIES	Low	No signs of smoking were seen inside the property at the time of the assessment.	"No smoking" signs should be displayed at the main entrance.		28/02/2023	
F1	LIGHTNING	No Timescale	No lightning protection system was seen on site.	Recommend management undertake a risk assessment of the building to determine if lightning protection is required			
G2	HOUSE-KEEPING	Medium	All common area escape routes were clear of items other than the area beneath the stairs which was used to store items including children's toys and a bike	Management to ensure combustible items noted are removed from the common area/means of escape and the area kept clear.		30/11/2022	G21
H1	HAZARDS INTRODUCED BY CONTRACTORS	Medium	Evidence was not available to confirm there is satisfactory control over works carried out in the building by contractors (e.g. hot work permits).	A documented procedure is recommended for ensuring all contractors are controlled on site and only operate within approved industry standards. This should include a permit to work and a hot work permit procedure where appropriate. All contractors should be advised of the emergency procedures and hazardous areas.		30/11/2022	
O1	FIRE SAFETY SIGNS & NOTICES	Medium	Signage requires improvements and should include a fire action notices to ensure persons in the common areas fully evacuate the building if they hear an alarm or discover a fire.	Display suitable fire action notices in the escape routes.		30/11/2022	
P1	MEANS OF GIVING WARNING IN CASE OF FIRE	High	The property is fitted with a domestic fire alarm system in the common areas	If the building supports an initial stay put policy a common area fire alarm system is not required. Management should confirm the rationale of providing the domestic system by carrying out a compartmentation survey The survey should confirm if the property supports stay put or if the fire detection system requires upgrading to support a simultaneous evacuation.		01/10/2022	P11

Ref.	Category	Priority	Comments	Recommendation	Quantity	To Be Completed By Photo Ref.
P7	MEANS OF GIVING WARNING IN CASE OF FIRE	Medium	No flats were accessed during the site visit	A category LD3 system should be considered the minimum in all circumstances". However, BS 5839-6:2019 states that "heat detectors should be installed in every kitchen. A smoke detector should be installed in the principal habitable room. Where more than one room might be used as the principal habitable room, a smoke detector should be installed in each of these rooms". It is recommended that each flat is checked to confirm that BS5839-6:2019 Grade D, LD2 detection is fitted.		30/11/2022
Q4	MEASURES TO LIMIT FIRE SPREAD AND DEVELOPMENT	High	No access to the roof space is provided but the roof hatch was closed	Management to check compartmentation within the roof space over the common area		01/10/2022
Q5	MEASURES TO LIMIT FIRE SPREAD AND DEVELOPMENT	High	The meter cupboards were locked shut however the ceilings had exposed holes	The compartmentation requires improving by finishing the fire stopping in the cupboards to an acceptable level which will provide the required fire separation between floors		01/10/2022 Q51
Q6	MEASURES TO LIMIT FIRE SPREAD AND DEVELOPMENT	Medium	No evidence is kept for inspection on site.	Management should confirm that where and if required fire dampers are provided as required.		30/11/2022
Т6	PROCEDURES AND ARRANGEMENTS	No Timescale	Unable to confirm at the time of the assessment	Person Centered Fire Risk Assessments should be carried out on all tenants in general needs property, when required, and should be reviewed on an annual basis.		
V1	TESTING AND MAINTENANCE	Medium	All fire safety provisions require testing in accordance with the relevant guides or standards.	-Manual opening smoke vents (MOV) are provided on site which must be tested and maintained in accordance with BS EN12101-2 -The riser requires an annual pressure testing to 12Bar as dictated by BS9990:2015 and 6 monthly visual checks.		30/11/2022
Y1	ENGAGEMENT WITH RESIDENTS	No Timescale	Unknown.	Ensure residents are informed of all relevant fire safety matters using different formats including letters, posters, social media etc.		