

## Futures Fire Risk Assessment

Futures Homescape, Flats 1-6 Booth Street: DE5 3DP, - UPRN: FB254 / 173525 / QA Approved / Andy Cloke

**Complete**

Flagged items	2	Actions	20
---------------	---	---------	----

### SITE NAME:

Futures Homescape, Flats 1-6  
Booth Street: DE5 3DP, - UPRN:  
FB254, Fire Risk Assessments,  
Futures Homescape

### PROPERTY IMAGE



Photo 1

### UPRN:

FB254

### JOB NUMBER:

173525

### FRA COMPLETED BY:

Pennington Choices Limited

### FIRE RISK ASSESSOR NAME:

Adrian Gallimore

### INSPECTION DATE:

14 Sep 2023

### REPORT STATUS:

QA Approved

### REASSESSMENT PRIORITY

Medium - 2 Years

### VALID TO: (QA Use Only)

7 Oct 2025

### VALIDATION DATE: (QA Use Only)

7 Oct 2023

### VALIDATED BY: (QA Use Only)

Andy Cloke

### VALIDATOR'S SIGNATURE: (QA Use Only)



Photo 2

---

## Flagged items & Actions

2 flagged, 20 actions

### Flagged items

2 flagged, 0 actions

Assessment Risk Ratings / Premises Risk Rating

**Accordingly, it is considered that the risk to life from fire at these premises is:**

MODERATE

Assessment Risk Ratings

**On satisfactory completion of all remedial works the risk rating of this building may be reduced to**

TOLERABLE

### Other actions

20 actions

Detailed Risk Assessment Part 2 / A - Electrical Ignition Sources / A1

**Is the fixed electrical installation periodically inspected and tested, (include dates if known)?**

Unknown

The date label on the distribution board has been crossed out. It was not possible to establish the date of the last fixed wiring test. Refer to Policy Principle.



Photo 3

**Open** | Priority Low | Due 8 Oct 2024 1:47 PM UTC | Created by Adrian Gallimore

A1

Management should ensure that the fixed wiring has been tested in line with Policy Principle.

Detailed Risk Assessment Part 2 / A - Electrical Ignition Sources / A3

**Is there a policy for personal electrical appliances (consider restrictions of communal supply points such as outlets and T pin outlets)?**

Unknown

The assessor was not able to confirm the policy of personal electrical appliances within common areas as the information was not available at the time of assessment. No personal electrical appliances were identified within common areas at the time of assessment.

**Open** | Created by Adrian Gallimore

A3

Management should confirm the policy on the use of personal electrical appliances within common areas and ensure that the policy is communicated to residents.

Detailed Risk Assessment Part 2 / B - Smoking Policies / B2

**Is the policy being adhered to and are "No smoking" signs**

No

### provided in the common areas?

There was no evidence of illicit smoking within common areas at the time of assessment. There are no 'No Smoking' signs displayed within common areas.

**Open** | Priority Low | Due 8 Oct 2024 1:50 PM UTC | Created by Adrian Gallimore

B2

Management should display 'No Smoking' signage at point of entry to the common area. It is also advisable that 'No Smoking' signs are displayed on first and second floor landings.

Detailed Risk Assessment Part 2 / C - Arson / C1

**Are premises secure against arson by outsiders? (Please state how)**

No

A standard security lock and intercom is fitted. The door was left wedged open and accessible at the time of assessment.



Photo 4

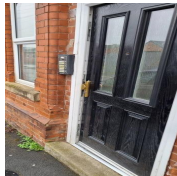


Photo 5

**Open** | Priority Medium | Due 8 Jan 2024 2:53 PM UTC | Created by Adrian Gallimore

C1

Management should liaise with residents to ensure that the entrance door is locked when not in use in order to maintain adequate measures of security.

Detailed Risk Assessment Part 2 / F - Lightning / F1

**Does the building have a lightning protection system?**

No

FHG Policy Principal confirms that there is no lightning protection installed.

**Open** | Created by Adrian Gallimore

F1

It is PCL recommendation that advice is sought from a competent person to determine whether lightning protection is required or not for the building in accordance with BS EN 62305-2:2012.

Detailed Risk Assessment Part 2 / G - Housekeeping / G3

**Are mobility scooters or electric vehicles stored in the means of escape? If yes has an assessment been undertaken in line with the NFCC "Mobility Scooter Guidance for Residential Buildings"?**

Unknown

There was a mobility scooter located outside the rear entrance. It was not possible to establish the charging arrangements or if a risk assessment has been completed as the information was not available at the time of assessment.



Photo 7

**Open** | Priority Medium | Due 8 Jan 2024 3:00 PM UTC | Created by Adrian Gallimore

### G3

Management should establish the arrangements for charging of mobility scooters. Management should ensure that a risk assessment has been completed in line with NFCC Mobility Scooter Guidance in residential buildings. Any risk assessment should account for Lithium Ion battery risks where necessary.

Detailed Risk Assessment Part 2 / K - Means of Escape / K8

#### Are escape routes separated where appropriate?

No

There is a fire door to which separates the small entrance hallway from the small corridor. Intumescent strips are fitted and a self closure device. A Georgian reinforced glass viewing panel is fitted. The door has an excessive gap to the bottom of the door. The door is not labelled and it was not possible to establish fire rating.



Photo 9

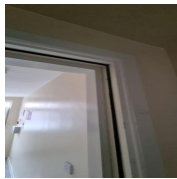


Photo 10

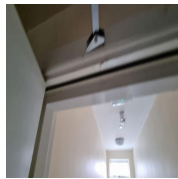


Photo 11

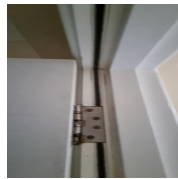


Photo 12

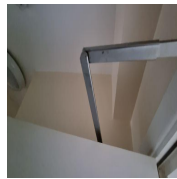


Photo 13



Photo 14

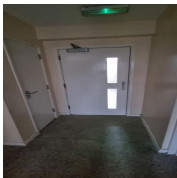


Photo 15

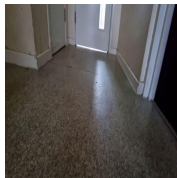


Photo 16

**Open** | Priority Medium | Due 8 Jan 2024 3:10 PM UTC | Created by Adrian Gallimore

### K8

Management should confirm fire rating of the separating fire door. Where the door does not conform to FD30 specification it should be replaced with a certified FD30 fire door set. Any installation or repair should only be completed by a certified third party contractor.

Detailed Risk Assessment Part 2 / L - Flat Entrance Doors / L1

#### Are the sample inspection flat entrance door or doors in good condition and appropriately fire rated?

No

Flat 1 was sampled. Intumescent strips are and concealed self-closure devices are fitted. The door was not labelled and it was not possible to establish fire rating. Gaps to the door were excessive. In addition, it was not possible to establish fire rating or condition of other dwelling doors as no other flats were sampled.



Photo 19

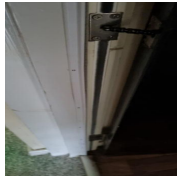


Photo 20

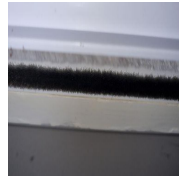


Photo 21

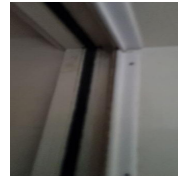


Photo 22



Photo 23

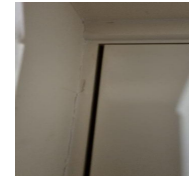


Photo 24

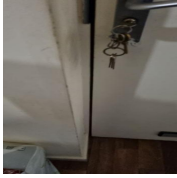


Photo 25

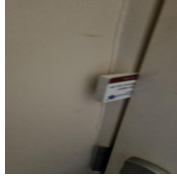


Photo 26

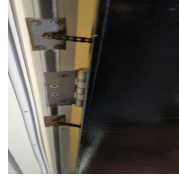


Photo 27

**Open** | Priority Medium | Due 8 Jan 2024 3:20 PM UTC | Created by Adrian Gallimore

L1

Management should confirm fire rating of the dwelling sampled and repair or replace the door with a certified self closing fire door set to a minimum of FD30 specification. Management should also inspect all other dwelling doors to establish fire rating and condition. Where doors do not conform or if damage is identified, doors should be repaired or replaced with certified FD30 fire doors sets. Any installation or repair should only be conducted by a certified third-party contractor.

Detailed Risk Assessment Part 2 / N - Emergency Lighting / N2

**If EL not provided, is borrowed/artificial lighting sufficient for escape? (Internal and external)**

Unknown

There was no external emergency lighting installed above the front exit. It was not possible to establish if borrowed lighting is sufficient as the assessment was conducted during day light hours.

**Open** | Priority Low | Due 8 Oct 2024 2:24 PM UTC | Created by Adrian Gallimore

N2

Management should install external emergency lighting above the front door.

Detailed Risk Assessment Part 2 / O - Fire Safety Signs and Notices / O1

**Is there adequate provision of visible fire safety signs and notices? (Consider directional, exits, stairs, fire action notices, Fire door keep shut, fire equipment and 'do not use lift' signage)**

No

A Fire Action Notice is displayed to the common area. There is no signage attached to the fire door to the ground floor. In addition, there is no signage attached to fire alarm call points.



Photo 34



Photo 35

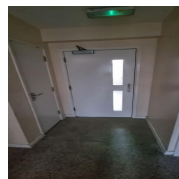


Photo 36

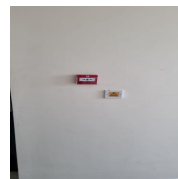


Photo 37



Photo 38

**Open** | Priority Low | Due 8 Oct 2024 2:28 PM UTC | Created by Adrian Gallimore

O1

Management should display fire door signs to both sides of the fire door. Call point signage should be displayed at MCPs.

Detailed Risk Assessment Part 2 / P - Means of Giving Warning in Case of Fire / P6

**Where appropriate, are there adequate arrangements for silencing and resetting an alarm condition?**

Unknown

It was not possible to establish the arrangements for silencing and resetting the alarm system.

**Open** | Priority Medium | Due 8 Jan 2024 3:40 PM UTC | Created by Adrian Gallimore

P6

Management should confirm the arrangements for silencing and resetting the alarm system and ensure that it is communicated to residents.

Detailed Risk Assessment Part 2 / P - Means of Giving Warning in Case of Fire / P7

**If applicable, is a separate domestic hard-wired smoke/heat alarm within the flats installed to a suitable standard?**

Unknown

Hard-wired linked detection is installed to the hallway of the dwelling sampled. It was not possible to establish if detection is installed to other rooms within the dwelling. In addition, it was not possible to establish the level of detection to other dwellings as no other flats were sampled.

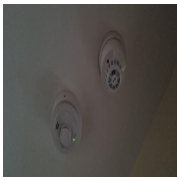


Photo 48

**Open** | Priority Medium | Due 8 Jan 2024 3:43 PM UTC | Created by Adrian Gallimore

P7

Management should ensure that hard-wired smoke / heat detection is installed to all flats within the block, in accordance with BS5389-6:2019 (Grade D, LD3 smoke alarms interlinked) in-line with LACORS Guidance. If found not to be, install to this standard. All work to be carried out by a third-party accredited fire alarm company.

Detailed Risk Assessment Part 2 / Q - Measures to Limit Fire Spread and Development / Q1

**Is there adequate levels of compartmentation between floors and between flats and the common escape routes?**

Unknown

Walls are emulsion painted plaster / plasterboard. Ceilings are emulsion painted plasterboard. Floors and stairs are of wooden construction. There are plastic electrical blanking plates fitted to walls within the common area; it was not possible to establish fire rating.

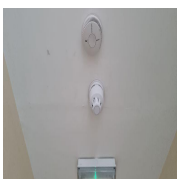


Photo 49



Photo 50



Photo 51



Photo 52



Photo 53

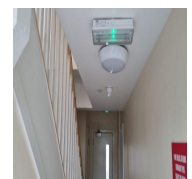


Photo 54



Photo 55

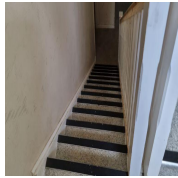


Photo 56

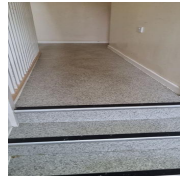


Photo 57



Photo 58

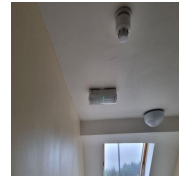


Photo 59

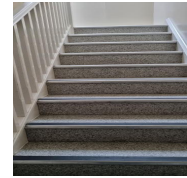


Photo 60



Photo 61

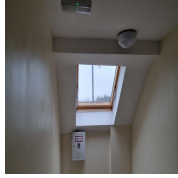


Photo 62

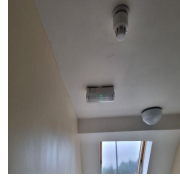


Photo 63

**Open** | Priority Medium | Due 8 Jan 2024 3:50 PM UTC | Created by Adrian Gallimore

### Q1

Management should ensure that electrical blanking plates are fire rated and correctly sealed. Where blanking plates are found not to be fire rated, they should be replaced with fire rated type.

Detailed Risk Assessment Part 2 / Q - Measures to Limit Fire Spread and Development / Q3

**Is there adequately fire protected service risers and/or ducts in common areas, that will restrict the spread of fire and smoke?**

No

There is a ceiling missing to the service riser on the first floor. Doors to service risers have intumescent strips fitted however they are not labelled and it was not possible to establish fire rating. Gaps to the second floor service riser were excessive.

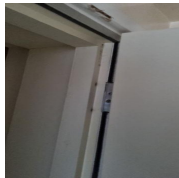


Photo 64

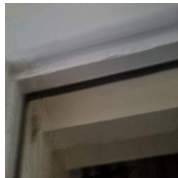


Photo 65

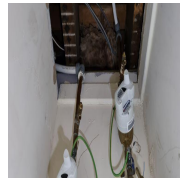


Photo 66



Photo 67

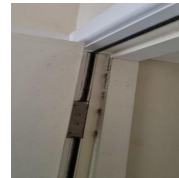


Photo 68

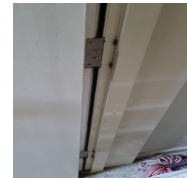


Photo 69

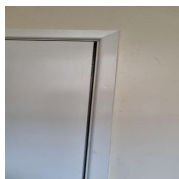


Photo 70

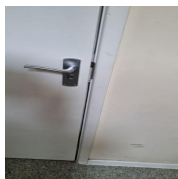


Photo 71

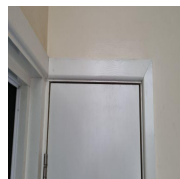


Photo 72

**Open** | Priority Medium | Due 8 Jan 2024 3:56 PM UTC | Created by Adrian Gallimore

### Q3

Management should confirm fire rating of doors to service risers. Where they do not conform to a minimum of FD30 specification, they should be replaced with certified FD30 fire doors sets. The ceiling to the first floor service riser and gaps to the second floor door require attention. Any fire doors installation or fire stopping should only be conducted by a certified third-party contractor.

Detailed Risk Assessment Part 2 / Q - Measures to Limit Fire Spread and Development / Q5

**Are electrics, including embedded meters, enclosed in fire rated construction?**

Unknown



The electrical intake cupboard is fitted with intumescent strips and is labelled to confirm that it is a PWL certified fire door to FD30. No penetrations were identified within. There is a wooden box on the landing; it was not possible to establish if there are any electrical ignition risks within.



Photo 77

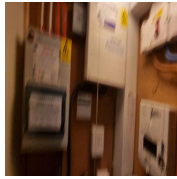


Photo 78



Photo 79

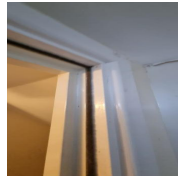


Photo 80

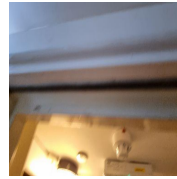


Photo 81

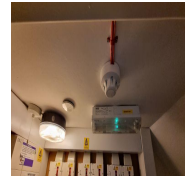


Photo 82

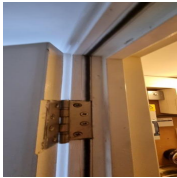


Photo 83



Photo 84



Photo 85

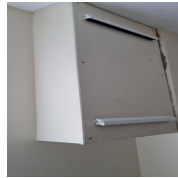


Photo 86

**Open** | Priority Medium | Due 8 Jan 2024 4:10 PM UTC | Created by Adrian Gallimore

Q5

Where electrical ignition risks are present, the wooden box should be replaced with a fire rated enclosure.

Detailed Risk Assessment Part 2 / S - Relevant Automatic Fire Extinguishing Systems / S2

**Are there any fixed fire fighting mains within the premises?**

Unknown

There is a sprinkler system installed with the pump located within the ground floor service riser next to the electrical intake cupboard. Sprinkler heads were not visible as ceiling covers are fitted. It was not possible to establish if the sprinkler system is tested and maintained as the information was not available at the time of assessment.

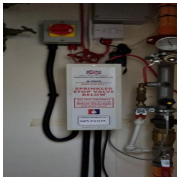


Photo 87

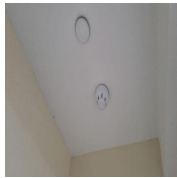


Photo 88



Photo 89

**Open** | Priority Medium | Due 8 Jan 2024 10:33 AM UTC | Created by Adrian Gallimore

S2

Management should ensure that the sprinkler system is appropriately tested and maintained and that adequate records are retained.

Detailed Risk Assessment Part 2 / T - Procedures and Arrangements / T1

**Recommended evacuation strategy for this building is:**

Simultaneous Evacuation

There is an automatic fire alarm system with linked detection installed to the dwelling sampled. There current evacuation strategy detailed on the Fire Action Notice advises of a 'Stay Put' policy which is not appropriate for the alarm system.



Photo 90

**Open** | Priority Medium | Due 8 Jan 2024 4:29 PM UTC | Created by Adrian Gallimore

T1

Management should amend the Fire Action Notice to a simultaneous evacuation.

Detailed Risk Assessment Part 2 / T - Procedures and Arrangements / T2

**Has a competent person(s) been appointed to assist in undertaking the preventative and protective measures including in house checks?**

Unknown

It was not possible to ascertain if there is a competent person appointed for this property.

**Open** | Created by Adrian Gallimore

T2

Management should confirm that there is a competent person in place to undertake the preventative and protective measures for this property.

Detailed Risk Assessment Part 2 / T - Procedures and Arrangements / T6

**Are there adequate procedures in place for the evacuation of disabled people who are likely to be present?**

Unknown

Although this is a general needs block, it was not possible to establish if there were any disabled persons present.

**Open** | Created by Adrian Gallimore

T6

Management should establish if there are any persons with disabilities or special needs that may require assistance, require a PEEPs and/or PCFRA. An appropriate procedure should be put in place once a PEEPS or PCFRA has been completed.

Detailed Risk Assessment Part 2 / Y - Engagement with Residents / Y1

**Has all Fire Safety information & procedures been disseminated to the residents?**

Unknown

It was not possible to establish what fire safety information has been disseminated to residents as the information was not available at the time of assessment.

**Open** | Priority Low | Due 8 Oct 2024 3:35 PM UTC | Created by Adrian Gallimore

Y1

Management should ensure that all residents have received necessary fire safety information and are aware of any procedures already in place.

## Detailed Risk Assessment Part 1

### 1. General Information

<b>1.1 FRA Type:</b>	Type 1 (Non-Destructive)
<b>1.2 Property Type:</b>	Converted Detached House
<b>1.3 Property Designation:</b>	General Needs
<b>1.4 Responsible Person:</b>	Lindsey Williams - CEO Futures Housing Group
<b>1.5 No of Floors:</b>	3
<b>1.6 No of Flats (if applicable):</b>	6
<b>1.7 Ground Floor Area (m2):</b>	100
<b>1.8 Total Area of all Floors (m2)</b>	300

#### 1.9 Building Description:

A converted detached dwelling for general needs. The entrance leads to entrance hallway with small corridor with a single stairway. There are two flats to each floor over three floors (6 flats in total). There are two exits which are via the front entrance and door to the rear communal yard.

#### 1.10 Building Construction:

Brick built property with tiled pitched roof. Walls within the common area are studded plasterboard / solid plastered walls with emulsion painted finish. Ceilings are emulsion painted plaster / plasterboard. Floors and stairway is of wooden construction.

#### 1.11 Extent of common areas:

Entrance hallway, stairs and landings.

#### 1.12 Areas of the building to which access was not available:

All of the common area was accessible.

#### 1.13 If applicable, state which flats were sample inspected:

Flat 1 was sampled.

### 2. The Occupants

#### 2.1 Management Extent

Non Managed – eg GN

#### 2.2 Details of any onsite Management

There are no on-site management at this property.

### 2.3 Person managing fire safety in the premises

Lindsey Williams, CEO, Futures Housing Group.

### 2.4 Person consulted during the fire risk assessment

No persons were consulted during the assessment.

### 2.5 Number of occupants (maximum estimated)

It was not possible to establish the total number of occupants however, a maximum occupancy is estimated at 24 (4 per dwelling).

### 2.6 Approximate maximum number of employees at any one time

There are no employees at this location.

### 2.7 Number of members of the public (maximum estimated)

1-2. There were no members of the public on site during the assessment however, there may be persons visiting periodically such as residents' families, contractors and postal workers etc.

### 2.8 Identify any people who are especially at risk (Sleeping Occupants, Disabled Occupants, Occupants in remote areas and Lone Workers, Young Persons, Others)

This is a "general needs" block of flats that will have sleeping occupants. It is conceivable that there may be young persons, the elderly and children within the flats as part of families who reside there. There may also be occupants with varying degrees of physical/mental impairment. In addition, lone workers may be present within common parts of the premises.

## 3. Fire Safety Legislation

### 3.1 The following fire safety legislation applies to these premises

Regulatory Reform (Fire Safety) Order 2005

### 3.2 The above legislation is enforced by

Derbyshire Fire and Rescue Service

### 3.3 Other key fire safety legislation (other than Building Regs 2000)

Housing Act 2004

### 3.4 The other legislation referred to above is enforced by

Local Governing Authority.

### 3.5 Guidance used as applicable to premises and occupation

LACORS

### 3.6 Is there an alteration or enforcement notice in force?

Unknown

None known to the assessor.

### 3.7 Fire loss experience (since last FRA)

Unknown

None known to the assessor. There was no evidence of fire loss or damage at the time of assessment.

---

## Detailed Risk Assessment Part 2

20 actions

### A - Electrical Ignition Sources

2 actions

#### A1

1 action

**Is the fixed electrical installation periodically inspected and tested, (include dates if known)?**

Unknown

The date label on the distribution board has been crossed out. It was not possible to establish the date of the last fixed wiring test. Refer to Policy Principle.

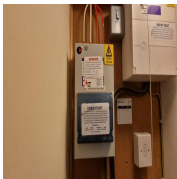


Photo 3

**Open** | Priority Low | Due 8 Oct 2024 1:47 PM UTC | Created by Adrian Gallimore

#### A1

Management should ensure that the fixed wiring has been tested in line with Policy Principle.

Policy Principle: FHG complete Fixed wire testing in line with current regulations every 5 years and complete an annual visual inspection on all properties.

**Action/Recommendation Required?:**

Yes

**Action Priority:**

Low - 12 Months

#### A2

**Is PAT testing in common areas carried out?**

N/A

There were no portable electrical appliances identified within common areas at the time of assessment.

Policy Principle: PAT testing is complete at the time of the visual inspection as mentioned above. All items in the communal areas will be tested.

#### A3

1 action

**Is there a policy for personal electrical appliances (consider restrictions of communal supply points such as outlets and T pin outlets)?**

Unknown

The assessor was not able to confirm the policy of personal electrical appliances within common areas as the information was not available at the time of assessment. No personal electrical appliances were identified within common areas at the time of assessment.

**Open** | Created by Adrian Gallimore

### A3

Management should confirm the policy on the use of personal electrical appliances within common areas and ensure that the policy is communicated to residents.

Policy Principle: PAT testing is complete at the time of the visual inspection as mentioned above. All items in the communal areas will be tested.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Recommendation - No Timescale

### A4

**Is the use of adapters and leads limited?**

N/A

No adaptors or leads were identified within common areas at the time of assessment.

### A5

**Are there any PV cells installed and do they have the appropriate isolation systems and signage to assist the fire and rescue service?**

N/A

None identified.

## B - Smoking Policies

1 action

### B1

**Are there suitable arrangements to prevent fire as a result from smoking?**

Yes

Policy Principle: No smoking policy in all communal areas- signage displayed.

### B2

1 action

**Is the policy being adhered to and are "No smoking" signs provided in the common areas?**

No

There was no evidence of illicit smoking within common areas at the time of assessment. There are no 'No Smoking' signs displayed within common areas.

**Open** | Priority Low | Due 8 Oct 2024 1:50 PM UTC | Created by Adrian Gallimore

### B2

Management should display 'No Smoking' signage at point of entry to the common area. It is also advisable that 'No Smoking' signs are displayed on first and second floor landings.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Low - 12 Months

## C - Arson

1 action

### C1

1 action

**Are premises secure against arson by outsiders? (Please state how)**

No

A standard security lock and intercom is fitted. The door was left wedged open and accessible at the time of assessment.



Photo 4



Photo 5

**Open** | Priority Medium | Due 8 Jan 2024 2:53 PM UTC | Created by Adrian Gallimore

### C1

Management should liaise with residents to ensure that the entrance door is locked when not in use in order to maintain adequate measures of security.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

### C2

**Are bins secured or fire loading stored in a suitable location? (Please state bin type, location, if and how it is secured)**

Yes

Wheelie bins are located in the rear communal yard and are stored away from the building.

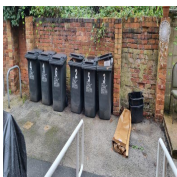


Photo 6

## D - Portable Heaters and Installations

### D1

**If used, is the use of portable heaters regarded as safe?**

N/A

There were no portable heaters within common areas.

### D2



**Are fixed heating systems maintained annually?**

Yes

There are no fixed heating systems located within common areas. Refer to Policy Principle for dwelling fixed heating maintenance.

Policy Principle: All Safety inspections carried out annually by qualified persons.

## E - Cooking

**E1**

**Are reasonable measures in place to prevent fires as a result of cooking, including replacing filter(where necessary)?**

N/A

There are no cooking facilities within common areas.

## F - Lightning

1 action

**F1**

1 action

**Does the building have a lightning protection system?**

No

FHG Policy Principal confirms that there is no lightning protection installed.

**Open** | Created by Adrian Gallimore

**F1**

It is PCL recommendation that advice is sought from a competent person to determine whether lightning protection is required or not for the building in accordance with BS EN 62305-2:2012.

Policy Principle: No lightning protection policy in place

**Action/Recommendation Required?**

Yes

**Action Priority:**

Recommendation - No Timescale

## G - Housekeeping

1 action

**G1**

**Are combustible materials kept away from any sources of ignition, including gas and electrical intake cupboards?**

N/A

No issues were identified at the time of assessment.

**G2**

**Are the escape routes kept clear of items combustible materials or waste and free of any trip hazards?**

Yes

Escape routes were clear at the time of assessment.

**G3**

1 action

**Are mobility scooters or electric vehicles stored in the means of escape? If yes has an assessment been undertaken in line with the NFCC "Mobility Scooter Guidance for Residential Buildings"?**

Unknown

There was a mobility scooter located outside the rear entrance. It was not possible to establish the charging arrangements or if a risk assessment has been completed as the information was not available at the time of assessment.

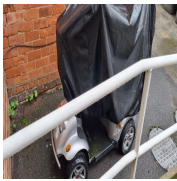


Photo 7

**Open** | Priority Medium | Due 8 Jan 2024 3:00 PM UTC | Created by Adrian Gallimore

**G3**

Management should establish the arrangements for charging of mobility scooters. Management should ensure that a risk assessment has been completed in line with NFCC Mobility Scooter Guidance in residential buildings. Any risk assessment should account for Lithium Ion battery risks where necessary.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

## H - Hazards Introduced by Contractors

**H1**

**Is there satisfactory control over works carried out in the building by contractors (e.g. hot work permits)?**

Yes

Policy Principle: All contractors must submit RAMS for procurement processes, and these are reviewed annually by FHG. A specific risk assessment is to be completed for each job.

## I - Dangerous Substances

**I1**

**If dangerous substances are used, has a risk assessment been carried out as required by the Dangerous Substances and Explosives Atmospheres Regulations 2002 and are they stored correctly?**

N/A

It was not possible to establish contractor control procedures as the information was not available

at the time of assessment.

## J - Other Significant Hazards

### J1

**Are all issues deemed satisfactory? [1]**

N/A

There were no additional significant hazards identified at the time of assessment.

### J2

**Are all issues deemed satisfactory? [2]**

N/A

There were no additional significant hazards identified at the time of assessment.

## K - Means of Escape

1 action

### K1

**Is the escape route design deemed satisfactory? (Consider current design codes)**

Yes

The escape route is satisfactory.

### K2

**Is the fire-resisting construction (including any glazing) protecting escape routes and staircases of a suitable standard and maintained in sound condition?**

Yes

Walls are emulsion painted plaster / studded plasterboard. Ceilings are emulsion painted plaster / plasterboard. Floors and stairs are of wooden construction.

### K3

**Is there adequate provision of exits (including exit Widths) for the numbers who may be present?**

Yes

There are two exits from the common area which are via the front door and door to the rear communal yard.

### K4

**Are doors on escape routes easily opened? (and are sliding or revolving doors avoided?)**

Yes

Thumb turn locks are fitted to exits.

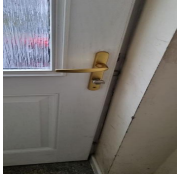


Photo 8

### K5

**Do final exits open in the direction of escape where necessary?**

N/A

Exits open inwardly to the hallway of the common area however, occupancy and the risk profile are low.

### K6

**Are travel distances satisfactory? (consider single direction and more than one direction, property risk profile and occupancy characteristics)**

Yes

Travel distances are acceptable.

### K7

**Are there suitable precautions for all inner rooms?**

N/A

There are no inner room scenarios.

### K8

1 action

**Are escape routes separated where appropriate?**

No

There is a fire door to which separates the small entrance hallway from the small corridor. Intumescent strips are fitted and a self closure device. A Georgian reinforced glass viewing panel is fitted. The door has an excessive gap to the bottom of the door. The door is not labelled and it was not possible to establish fire rating.



Photo 9

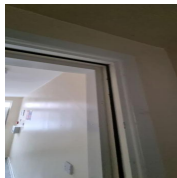


Photo 10

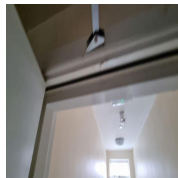


Photo 11

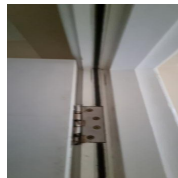


Photo 12

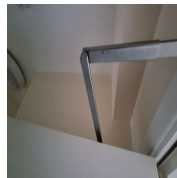


Photo 13



Photo 14

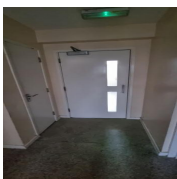


Photo 15

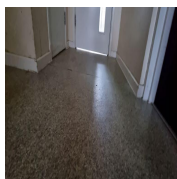


Photo 16

Management should confirm fire rating of the separating fire door. Where the door does not conform to FD30 specification it should be replaced with a certified FD30 fire door set. Any installation or repair should only be completed by a certified third party contractor.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

**K9**

**Are corridors sub-divided where appropriate?**

N/A

Not required.

**K10**

**Do escape routes lead to a place of safety?**

Yes

Escapes lead to the external environment.

**K11**

**Are the stairs and/or lobbies provided with adequate ventilation? (If considered satisfactory, please state provision)**

Yes

There is a automatic operating smoke vent fitted to the second floor landing.



Photo 17

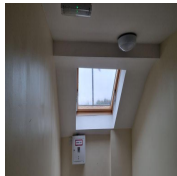


Photo 18

**K12**

**Are there any other issues that could affect the means of escape, for example plastic conduit/loose cables not secured by fire rated fastening?**

N/A

No issues were identified.

**L - Flat Entrance Doors**

1 action

**L1**

1 action

**Are the sample inspection flat entrance door or doors in good condition and appropriately fire rated?**

No

Flat 1 was sampled. Intumescent strips are and concealed self-closure devices are fitted. The door was not labelled and it was not possible to establish fire rating. Gaps to the door were excessive. In addition, it was not possible to establish fire rating or condition of other dwelling doors as no other

flats were sampled.

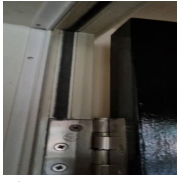


Photo 19

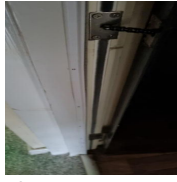


Photo 20

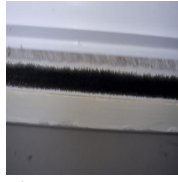


Photo 21

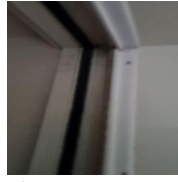


Photo 22



Photo 23

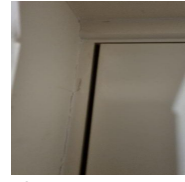


Photo 24

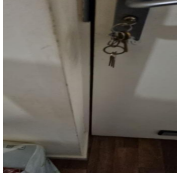


Photo 25

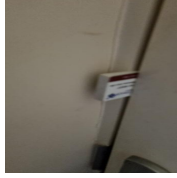


Photo 26

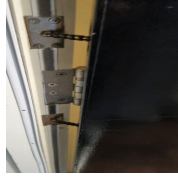


Photo 27

**Open** | Priority Medium | Due 8 Jan 2024 3:20 PM UTC | Created by Adrian Gallimore

### L1

Management should confirm fire rating of the dwelling sampled and repair or replace the door with a certified self closing fire door set to a minimum of FD30 specification. Management should also inspect all other dwelling doors to establish fire rating and condition. Where doors do not conform or if damage is identified, doors should be repaired or replaced with certified FD30 fire doors sets. Any installation or repair should only be conducted by a certified third-party contractor.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

## M - Common Area Fire Doors

### M1

**Are all common area fire door and frames in good condition and appropriately fire rated?**

No

Defects were identified to the separating fire door to the ground floor. Refer to K8.

## N - Emergency Lighting

1 action

### N1

**If emergency lighting is provided, is the coverage sufficient and in good repair? (Internal and external)**

Yes

Emergency lighting is installed and appeared to be adequate. No defects were identified. (See Limitations Statement).



Photo 28



Photo 29



Photo 30

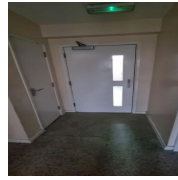


Photo 31

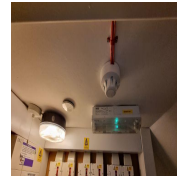


Photo 32



Photo 33

## N2

1 action

**If EL not provided, is borrowed/artificial lighting sufficient for escape? (Internal and external)**

Unknown

There was no external emergency lighting installed above the front exit. It was not possible to establish if borrowed lighting is sufficient as the assessment was conducted during day light hours.

**Open** | Priority Low | Due 8 Oct 2024 2:24 PM UTC | Created by Adrian Gallimore

## N2

Management should install external emergency lighting above the front door.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Low - 12 Months

## O - Fire Safety Signs and Notices

1 action

## O1

1 action

**Is there adequate provision of visible fire safety signs and notices? (Consider directional, exits, stairs, fire action notices, Fire door keep shut, fire equipment and 'do not use lift' signage)**

No

A Fire Action Notice is displayed to the common area. There is no signage attached to the fire door to the ground floor. In addition, there is no signage attached to fire alarm call points.



Photo 34



Photo 35

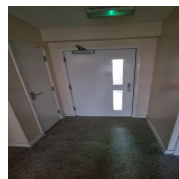


Photo 36

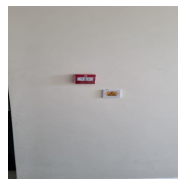


Photo 37



Photo 38

**Open** | Priority Low | Due 8 Oct 2024 2:28 PM UTC | Created by Adrian Gallimore

## O1

Management should display fire door signs to both sides of the fire door. Call point signage should be displayed at MCPs.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Low - 12 Months

## O2

**Wayfinding Signage (buildings over 11 metres in height). Are there clear markings for flat and floor recognition provided?**

N/A

The building is below 11 metres.

## P - Means of Giving Warning in Case of Fire

2 actions

### P1

**Is a reasonable fire detection and fire alarm system provided in the common areas, where necessary?**

Yes

A fire alarm system is installed to BS5389: L2/L3 specification with AFD installed to common areas and electrical intake cupboards. A linked detector was installed to the flat sampled (1). The alarm panel is located within the ground floor corridor and; no defects were identified at the time of assessment.

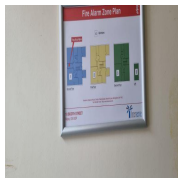


Photo 39



Photo 40



Photo 41

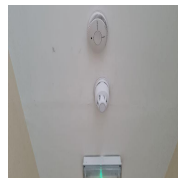


Photo 42

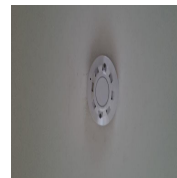


Photo 43

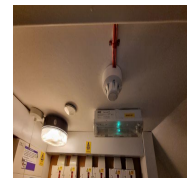


Photo 44

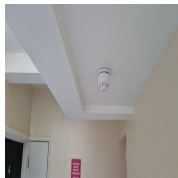


Photo 45

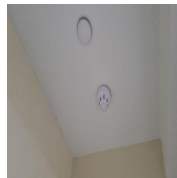


Photo 46

### P2

**If installed, is the common area AFD adequate for the occupancy and fire risk?**

Yes

AFD is adequate within common areas.

### P3

**If not installed, are the premises deemed safe without a common area AFD system?**

N/A

AFD is installed to common areas.

### P4

**If there is a communal fire detection and fire alarm system, does it extend into the dwellings?**

Unknown



Linked detection is installed to the hallway of the flat sampled. It was not possible to establish if linked detection is installed to other dwellings within the block. Refer to P7.

## P5

**Where appropriate, has a fire alarm zone plan been provided?**

Yes

A fire alarm zone plan is displayed by the fire alarm panel.



Photo 47

## P6

1 action

**Where appropriate, are there adequate arrangements for silencing and resetting an alarm condition?**

Unknown

It was not possible to establish the arrangements for silencing and resetting the alarm system.

**Open** | Priority Medium | Due 8 Jan 2024 3:40 PM UTC | Created by Adrian Gallimore

## P6

Management should confirm the arrangements for silencing and resetting the alarm system and ensure that it is communicated to residents.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

## P7

1 action

**If applicable, is a separate domestic hard-wired smoke/heat alarm within the flats installed to a suitable standard?**

Unknown

Hard-wired linked detection is installed to the hallway of the dwelling sampled. It was not possible to establish if detection is installed to other rooms within the dwelling. In addition, it was not possible to establish the level of detection to other dwellings as no other flats were sampled.

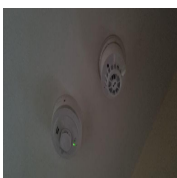


Photo 48

**Open** | Priority Medium | Due 8 Jan 2024 3:43 PM UTC | Created by Adrian Gallimore

## P7

Management should ensure that hard-wired smoke / heat detection is installed to all flats within

the block, in accordance with BS5389-6:2019 (Grade D, LD3 smoke alarms interlinked) in-line with LACORS Guidance. If found not to be, install to this standard. All work to be carried out by a third-party accredited fire alarm company.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

**P8**

**If applicable (Sheltered scheme) is the smoke detection within the flats monitored by an alarm receiving centre/on site scheme manager via a telecare system?**

N/A

The premises is a general needs block.

## Q - Measures to Limit Fire Spread and Development

3 actions

**Q1**

1 action

**Is there adequate levels of compartmentation between floors and between flats and the common escape routes?**

Unknown

Walls are emulsion painted plaster / plasterboard. Ceilings are emulsion painted plasterboard. Floors and stairs are of wooden construction. There are plastic electrical blanking plates fitted to walls within the common area; it was not possible to establish fire rating.

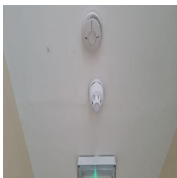


Photo 49



Photo 50



Photo 51



Photo 52



Photo 53

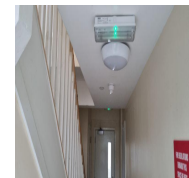


Photo 54



Photo 55

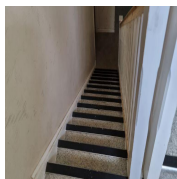


Photo 56

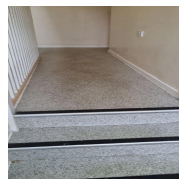


Photo 57

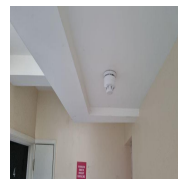


Photo 58

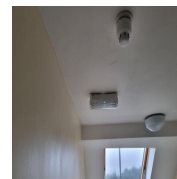


Photo 59

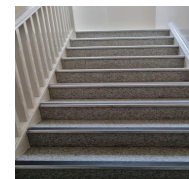


Photo 60



Photo 61

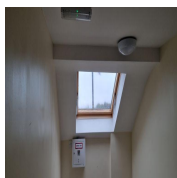


Photo 62

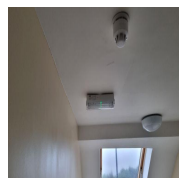


Photo 63

**Open** | Priority Medium | Due 8 Jan 2024 3:50 PM UTC | Created by Adrian Gallimore

**Q1**

Management should ensure that electrical blanking plates are fire rated and correctly sealed. Where blanking plates are found not to be fire rated, they should be replaced with fire rated type.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

**Q2**

**Are hidden voids appropriately enclosed and/or fire-stopped?  
(consider above suspended ceilings)**

N/A

No hidden voids identified.

**Q3**

1 action

**Is there adequately fire protected service risers and/or ducts  
in common areas, that will restrict the spread of fire and  
smoke?**

No

There is a ceiling missing to the service riser on the first floor. Doors to service risers have intumescent strips fitted however they are not labelled and it was not possible to establish fire rating. Gaps to the second floor service riser were excessive.

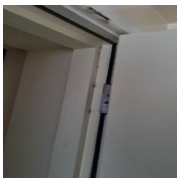


Photo 64

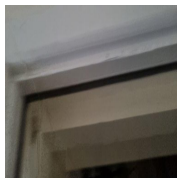


Photo 65

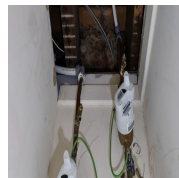


Photo 66



Photo 67

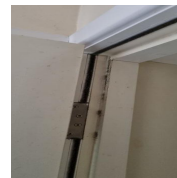


Photo 68



Photo 69

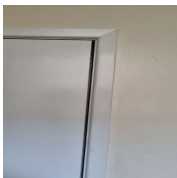


Photo 70

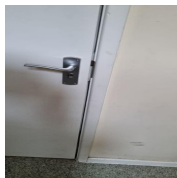


Photo 71

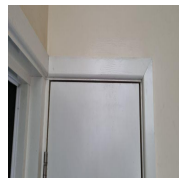


Photo 72

**Open** | Priority Medium | Due 8 Jan 2024 3:56 PM UTC | Created by Adrian Gallimore

**Q3**

Management should confirm fire rating of doors to service risers. Where they do not conform to a minimum of FD30 specification, they should be replaced with certified FD30 fire doors sets. The ceiling to the first floor service riser and gaps to the second floor door require attention. Any fire doors installation or fire stopping should only be conducted by a certified third-party contractor.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

**Q4**

**Is compartmentation maintained in the roof space?**

Yes

A head and shoulders inspection of the roof void was completed. A fire -break curtain has been installed and no further issues were identified.



Photo 73



Photo 74

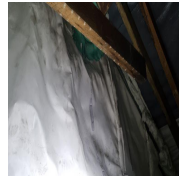


Photo 75



Photo 76

### Q5

1 action

**Are electrics, including embedded meters, enclosed in fire rated construction?**

Unknown

The electrical intake cupboard is fitted with intumescent strips and is labelled to confirm that it is a PWL certified fire door to FD30. No penetrations were identified within. There is a wooden box on the landing; it was not possible to establish if there are any electrical ignition risks within.

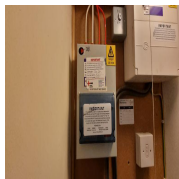


Photo 77

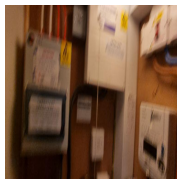


Photo 78

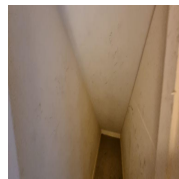


Photo 79

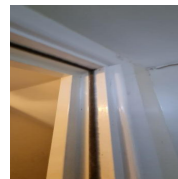


Photo 80

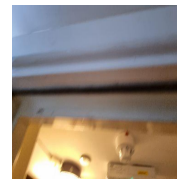


Photo 81

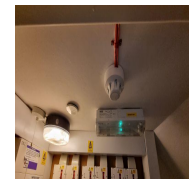


Photo 82

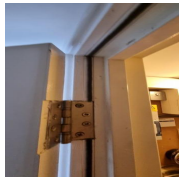


Photo 83

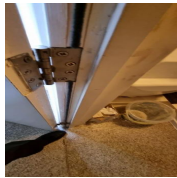


Photo 84



Photo 85



Photo 86

**Open** | Priority Medium | Due 8 Jan 2024 4:10 PM UTC | Created by Adrian Gallimore

### Q5

Where electrical ignition risks are present, the wooden box should be replaced with a fire rated enclosure.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

### Q6

**As far as can reasonably be ascertained, are fire dampers provided as necessary to protect critical means of escape against passage of fire, smoke and products of combustion in the early stages of a fire?**

N/A

None present.

### Q7

**Is there reasonable limitation of linings to escape routes that might promote fire spread?**

Yes

Walls are emulsion painted plaster / plasterboard. Ceilings are emulsion painted plasterboard. Floors and stairs are of wooden construction.

---

## Q8

---

**Are soft furnishings in common areas appropriate to limit fire spread/growth?**

N/A

There are no soft furnishings to the common area.

---

## Q9

---

**Does the premises have any external balconies, cladding or materials which may promote external fire spread?**

N/A

None present.

---

## Q10

---

**Has a note been prepared of the external walls of the building and details of construction materials used? Does the note include and identify the level of risk that the design and materials used?**

N/A

Not required.

---

## Q11

---

**Does the External wall note include any mitigating circumstances that may have been taken to reduce the risk?**

N/A

Not required.

---

## Q12

---

**Has the responsible person reviewed the external wall note on a regular basis and revised it if there have been any significant changes in the external walls.**

N/A

Not required.

---

## Q13

---

**Are all other fire spread/compartmentation issues satisfactory?**

N/A

No further compartmentation issues were identified at the time of assessment.

---

## R - Fire Extinguishing Appliances

---

### R1

---

**If required, is there reasonable provision of accessible portable fire extinguishers?**

N/A

No FFE installed and none required.

## S - Relevant Automatic Fire Extinguishing Systems

1 action

### S1

**Are there any automatic fire suppressant systems on site?**

Yes

There is a sprinkler pump located within the service riser adjacent to the electrical intake cupboard. Refer to S2.

### S2

1 action

**Are there any fixed fire fighting mains within the premises?**

Unknown

There is a sprinkler system installed with the pump located within the ground floor service riser next to the electrical intake cupboard. Sprinkler heads were not visible as ceiling covers are fitted. It was not possible to establish if the sprinkler system is tested and maintained as the information was not available at the time of assessment.

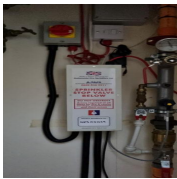


Photo 87

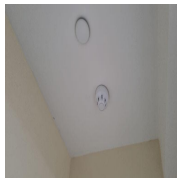


Photo 88

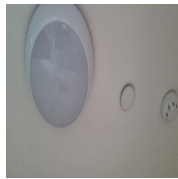


Photo 89

**Open** | Priority Medium | Due 8 Jan 2024 10:33 AM UTC | Created by Adrian Gallimore

### S2

Management should ensure that the sprinkler system is appropriately tested and maintained and that adequate records are retained.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Medium - 3 Months

### S3

**If any other relevant systems / equipment is installed, state type of system and comment as necessary**

N/A

No further systems identified.

## T - Procedures and Arrangements

3 actions

### T1

1 action

**Recommended evacuation strategy for this building is:**

Simultaneous Evacuation

There is an automatic fire alarm system with linked detection installed to the dwelling sampled. There current evacuation strategy detailed on the Fire Action Notice advises of a 'Stay Put' policy which is not appropriate for the alarm system.



Photo 90

**Open** | Priority Medium | Due 8 Jan 2024 4:29 PM UTC | Created by Adrian Gallimore

T1

Management should amend the Fire Action Notice to a simultaneous evacuation.

T2

1 action

**Has a competent person(s) been appointed to assist in undertaking the preventative and protective measures including in house checks?**

Unknown

It was not possible to ascertain if there is a competent person appointed for this property.

**Open** | Created by Adrian Gallimore

T2

Management should confirm that there is a competent person in place to undertake the preventative and protective measures for this property.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Recommendation - No Timescale

T3

**Are there appropriate documented fire safety arrangements and procedures in place in the event of fire?**

No

The Fire Action Notice displayed advises of a 'Stay Put' policy. Refer to T1.

T4

**Are there suitable arrangements for liaison and calling the Fire Service?**

Yes

Residents would call the fire service.

T5

**Are there suitable fire assembly points away from any risk?**

N/A

Not required.

**T6**

1 action

**Are there adequate procedures in place for the evacuation of disabled people who are likely to be present?**

Unknown

Although this is a general needs block, it was not possible to establish if there were any disabled persons present.

**Open** | Created by Adrian Gallimore

**T6**

Management should establish if there are any persons with disabilities or special needs that may require assistance, require a PEEPs and/or PCFRA. An appropriate procedure should be put in place once a PEEPS or PCFRA has been completed.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Recommendation - No Timescale

**T7**

**Are staff nominated and trained on the use of fire extinguishing appliances?**

N/A

No staff present and no FFE installed.

**T8**

**Are staff nominated and trained to assist in evacuation (Where applicable e.g. Offices, supported schemes)?**

N/A

No staff present.

## **U - Training**

**U1**

**Do staff receive adequate induction and annual refresher fire safety training? (To include fire risks in the premises, fire safety measures in the building, action in the event of fire and on hearing alarm, location and use of fire extinguishers, calling the fire service)**

N/A

No staff present.

Policy Principle: All touchdown points (small offices) staff receive Inductions and annual refreshers on fire safety fire safety. But at all the schemes no permanent staff are present.



## U2

**Are employees nominated to assist in the event of fire given additional training?**

N/A

No staff present.

## V - Testing and Maintenance

### V1

**Are all fire safety provisions for the building (AFD, Emergency Lighting, sprinklers etc.) routinely tested and maintained?**

Yes

Policy Principle: Alarms- FHG Greenscapes, MITIE. E/L- FHG Greenscapes, MITIE. Assets Surveyor Extinguishers- MITIE. Fire Doors- FHG Greenscapes, Assets Surveyor Final Exits/ Escape Routes- Greenscapes/ Neighbourhoods.

## W - Records

### W1

**Is all routine testing and staff training including fire drills suitably recorded and available for inspection?**

N/A

No staff present.

## X - Premises Information Box

### X1

**Is a Premises Information Box located at the premises accessible to the Fire and Rescue Service, secure from unauthorised access and kept up to date?**

N/A

No Premises Information Box installed.

Policy Principle: Log book is kept on SharePoint with proposed specific QR code access.

## Y - Engagement with Residents

1 action

### Y1

1 action

**Has all Fire Safety information & procedures been disseminated to the residents?**

Unknown

It was not possible to establish what fire safety information has been disseminated to residents as the information was not available at the time of assessment.

Y1

Management should ensure that all residents have received necessary fire safety information and are aware of any procedures already in place.

**Action/Recommendation Required?**

Yes

**Action Priority:**

Low - 12 Months

## Z - Any Other Information

Z1

**Are all issues deemed satisfactory? [1]**

N/A

No further issues were identified at the time of assessment.

Z2

**Are all issues deemed satisfactory? [2]**

N/A

No further issues were identified at the time of assessment.

## Risk Rating

The following simple risk level estimator is based on a more general health and safety risk level estimator of the type contained in BS 8800:

Likelihood of fire	Potential consequences of fire		
	Slight Harm	Moderate Harm	Extreme Harm
Low	Trivial	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	Intolerable

### Likelihood of Fire

Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from fire (likelihood of fire) at these premises is:

MEDIUM

In this context, a definition of the above terms is as follows:

**Low:** Unusually low likelihood of fire as a result of negligible potential sources of ignition.

**Medium:** Normal fire hazards (e.g. potential ignition sources) for this type of occupancy, with fire hazards generally subject to appropriate controls (other than minor shortcomings).

**High:** Lack of adequate controls applied to one or more significant fire hazards, such as to result in significant increase in likelihood of fire.

### Potential Consequences of Fire

Taking into account the nature of the building and occupants, as well as the fire protection and procedural arrangements observed at the time of this fire risk assessment, it is considered that the consequences for life safety in the event of fire would be:

MODERATE HARM

Potential Consequences of Fire

In this context, a definition of the above terms is as follows:

**Slight harm:** Outbreak of fire unlikely to result in serious injury or death of any occupant.

**Moderate harmful:** Outbreak of fire could foreseeably result in injury (including serious injury) of one or more occupants, but it is unlikely to involve multiple fatalities.

**Extreme harm:** Significant potential for serious injury or death of one or more occupants likely to involve multiple fatalities.

### Premises Risk Rating

Accordingly, it is considered that the risk to life from fire at these premises is:

MODERATE

A suitable risk-based control plan should involve effort and urgency that is proportional to risk . The following risk-based control plan is based on one advocated by BS 8800 for general health and safety risks:

Risk Level	Action and time table
Trivial	No action is required and no detailed records need be kept.
Tolerable	No major additional controls required. However, there might be a need for improvements that involve minor or limited cost.
Moderate	It is essential that efforts are made to reduce the risk. Risk reduction measures should be implemented within a defined time period. Where moderate risk is associated with consequences that constitute extreme harm, further assessment might be required to establish more precisely the likelihood of harm as a basis for determining the priority for improved control measures.
Substantial	Considerable resources might have to be allocated to reduce the risk. If the building is unoccupied, it should not be occupied until the risk has been reduced. If the building is occupied, urgent action should be taken.
Intolerable	Building (or relevant area) should not be occupied until the risk is reduced.

*(Note that, although the purpose of this section is to place the risk in context, the above approach to fire risk assessment is subjective and for guidance only. All hazards and deficiencies identified in this report should be addressed by implementing all recommendations contained in the following action plan. The fire risk assessment should be reviewed regularly.)*

**On satisfactory completion of all remedial works the risk rating of this building may be reduced to**

**TOLERABLE**

## Limitations Statement

### Fire Risk Assessment – Limitations

The purpose of the fire risk assessment is solely to provide an assessment of the risk to life from fire, and, where appropriate, to make recommendations to reduce the risk to life from fire. This assessment does not address fire risks to property or business continuity.

Under Article 5(4) of the Regulatory Reform (Fire Safety) Order 2005 or other devolved equivalent regional legislation and relevant United Kingdom law, we have been appointed to provide advice to the Responsible Person only. We have no control over any part of the premises covered within this fire risk assessment, and we have no responsibility for undertaking any of the recommendations made. The assessment is intended to assist the Responsible Person to comply with their responsibilities under the Regulatory Reform (Fire Safety) Order 2005.

Any policy principles included within this Fire Risk Assessment have been provided by the responsible person or their representative and been added in good faith. We cannot take responsibility for the accuracy of the policy principles with regard to the client's internal policies, British Standards or codes of practice.

Any test certificates supplied as part of the Fire Risk Assessment process will be considered but we take no responsibility or liability whatsoever is accepted for the accuracy of such information supplied by others.

The findings of the fire risk assessment will be based upon the conditions found at the Premises at the time the assessment is to be carried out and on relevant information provided by the Responsible Person or others either prior to, during or after the Fire Risk Assessment of the premises.

We consider the External Wall System as part of the Fire Risk Assessment process, however, we take no responsibility for a fire risk appraisal of external wall construction on existing buildings and work to the guidance and limitations detailed in PAS 9980:2022 0.2 Fire risk assessments. Any information supplied to the Fire Risk Assessor is taken in good faith and we accept no responsibility for the accuracy of the information supplied.

No responsibility is accepted for any change in the conditions or circumstances prior after the Fire Risk Assessment has been undertaken.

It is stressed that the assessment should not be regarded as a structural survey for fire safety purposes as such a survey should only be entrusted to a qualified building surveyor. The Fire Risk Assessment did not involve destructive exposure (Unless specifically requested as part of a contractual arrangement), and therefore it is not always possible to survey less readily accessible areas. It is, therefore, necessary to rely on a degree of sampling and also reasonable assumptions and judgements.

All services or penetrations traversing fire resisting compartments are not confirmed as being sufficiently fire stopped with fire resisting material to the appropriate standard. If fire compartments\fire dampers\voids (ceilings, floors or other voids) are considered inaccessible for safety reasons or any other reason and cannot be physically accessed or are outside the visual range of the assessor, technical comment on these areas cannot be provided.

This fire risk assessment will not necessarily identify all minor fire-stopping issues that might exist within the building and should be considered to be a sample of fire compartmentation. Unless a full fire compartmentation survey is contractually included within the scope of the assessment. If there are reasons to suspect the fire resistance within the Premises has not been sufficiently maintained the responsibility to provide this technical information rests with the Responsible Person\duty holder.

This fire risk assessment will not necessarily identify all minor fire door issues that might exist within the building and should be considered a sample of fire doors. Unless a full fire door survey is contractually included within the scope of the assessment.

A full investigation of the design of heating, ventilation and air conditioning (HVAC) systems is outside the scope of this fire risk assessment.

Although reference in the report may be made to relevant British Standards, Codes of Practice and Guides the assessment will not, nor is it intended to, ensure compliance with any of the documents referred to in the assessment. However, deviations from generally accepted codes, standards and universally recognised good fire safety practice will be identified in the assessment.

Where an emergency escape lighting system is present, comments are based upon a visual assessment of the system coverage and condition, but no illuminance tests or verification of the installation to the relevant British Standards were carried out.

Where a fire alarm system is present, comments are based upon a visual assessment, but no audibility tests or verification of full compliance with the relevant British Standards were carried out.

Where manual firefighting equipment is present, comments are based upon a visual assessment, but no verification of full compliance with the relevant British Standards or codes of practice were carried out.

It is the expectation that any reference to the testing and maintenance of passive or active fire protection systems within the premises are undertaken to the relevant current British Standards, Codes of Practice and Guides it is the responsible person's duty to ensure this is undertaken.

There will be a brief review of procedures at the time of this fire risk assessment. An in-depth review of documentation is outside the scope of this fire risk assessment, unless otherwise stated in the contract.

The report will highlight the Significant Findings (Split into Recommendations and Action(s)) that the Fire Risk Assessor found at the time of the assessment.

It is the responsibility of the Responsible Person to ensure that any deficiencies found during the assessment and subsequently reported to the Responsible Person, by the report or other means, are their responsibility to rectify to a satisfactory standard to meet the requirements of the Regulatory Reform (Fire Safety) Order 2005.

It is wholly the responsibility of the Responsible Person and/or their agent to implement and maintain the Fire Precautions at the Premises to a satisfactory standard and condition to comply with the requirements of the Regulatory Reform (Fire Safety) Order 2005.

Failure to address and/or rectify any deficiencies mentioned in the report may result in serious harm, injury and or death to any relative person, employee, visitor, you or any other person in, on, within or without the perimeter of the Premises.

Failure to address any of the deficiencies highlighted in the report may be considered to be a breach of the Regulatory Reform (Fire Safety) Order 2005 and may result in prosecution by the enforcing authority.

Responsibility for the ongoing management of the Premises and even, if necessary, the decision to allow the Premises to be used for their present purpose, and in the current condition remains with the Responsible Person.

Responsibility for management procedures regarding, evacuation management, and maintenance of firefighting equipment, Fire alarms systems, emergency escape lighting, and any other emergency-related provisions remains a duty of the responsible person, not the fire risk assessor as this is not within their control.

Any faults or deficiencies in any emergency emergency-related staffing levels and/or staff training are the responsibility of the Responsible Person and/or the duty holder.

Portable or moveable items and items brought into the Premises are the responsibility of the Responsible Person and/or the duty holder.

It is recommended that the Assessment is reviewed annually or when there is a significant change, material alteration, change in the use of the Premises, a change in working practices, or following any incident, including fire, which may affect the Fire Precautions of the Premises.

The circumstances of the Premises may change over time and with use and/or occupancy, therefore, failure to review the fire risk assessment by the date indicated may mean that the fire risk assessment is no longer valid.

This Fire Risk Assessment is not a Health and Safety Report. A Health and Safety review should be conducted to ensure compliance with the Health and Safety at Work Act 1974.

Compliance with all other legislation is the responsibility of the Responsible Person. We accept no responsibility for loss, damage or other liability arising from a fire, loss and/or injury due to the failure to observe the safety, observance and practises identified in the Assessment

The Responsible Person will always remain responsible for the outcome of the Fire Risk

Assessment and/or its review. This includes the accuracy of details contained within this report.

By signing for, by payment for services or acknowledgement of receipt of the report you accept full responsibility and accountability for implementing the findings of the report.



## Life Safety Fire Risk Assessment Certificate of Conformity

This certificate is issued by the organization named in Part 1 of the schedule in respect of the fire risk assessment provided for the person(s) or organization named in Part 2 of the schedule at the premises and / or part of the premises identified in Part 3 of the schedule

### Schedule

<b>Part 1a - Name and Address of Certified Organisation</b>	Pennington Choices Limited
<b>Part 1b - BAFE Registration Number of Issuing Certified Organisation</b>	102119
<b>Part 1c - SSAIB 3rd Party Certificate Number</b>	CHES077
<b>Part 2 - Name of Client</b>	Futures Housing Group
<b>Part 3a - Address of premises for which the Fire Risk Assessment was carried out</b>	Flats 1-6 Booth Street: DE5 3DP
<b>Part 3b - Part or parts of the premises to which the Fire Risk Assessment applies</b>	Entrance hallway, stairs and landings.
<b>Part 4 - Brief description of the scope and purpose of the Fire Risk Assessment</b>	Life Safety (as agreed spec)
<b>Part 4b - Limitations of FRA</b>	See Limitations Statement
<b>Part 5 - Effective Date of the Fire Risk Assessment</b>	7 Oct 2023
<b>Part 6 - Recommended Date for Reassessment of the premises</b>	7 Oct 2025
<b>Part 7 - Unique Reference Number of this Certificate (Job Number)</b>	173525

Signed for on behalf of the Issuing Certified Organisation



James Hutton



---

**Dated:**

7 Oct 2023

---

SSAIB, 7-9 Earsdon Road, West Monkseaton, Whitley Bay, Tyne & Wear. NE25 9SX

BAFE, The Fire Service College, London Road, Moreton-in-Marsh, Gloucestershire, GL56 0RH  
01608 653 350 | [info@bafep.org.uk](mailto:info@bafep.org.uk) | [www.bafep.org.uk](http://www.bafep.org.uk)

---

## Media summary



Photo 1

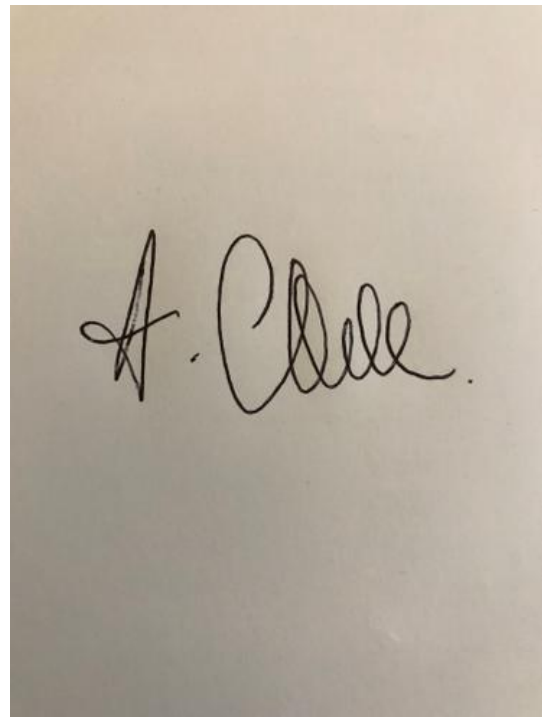


Photo 2



Photo 3



Photo 4



Photo 5



Photo 6



Photo 7



Photo 8



Photo 9

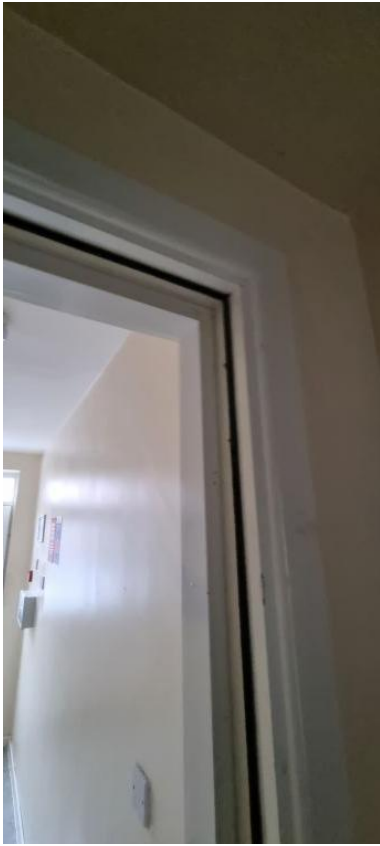


Photo 10



Photo 11



Photo 12



Photo 13



Photo 14



Photo 15



Photo 16



Photo 17



Photo 18



Photo 19



Photo 20





Photo 21

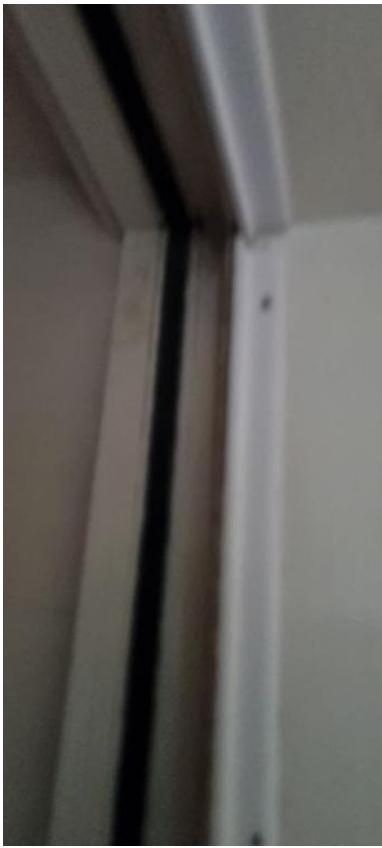


Photo 22



Photo 23



Photo 24



Photo 25



Photo 26



Photo 27



Photo 28





Photo 29



Photo 30



Photo 31



Photo 32



Photo 33



Photo 34



Photo 35



Photo 36



Photo 37



Photo 38



Photo 39



Photo 40



Photo 41



Photo 42



Photo 43



Photo 44



Photo 45



Photo 46



Photo 47



Photo 48



Photo 49



Photo 50



Photo 51



Photo 52



Photo 53



Photo 54



Photo 55



Photo 56



Photo 57



Photo 58



Photo 60



Photo 59





Photo 61



Photo 62



Photo 64



Photo 63



Photo 65



Photo 66



Photo 67



Photo 68



Photo 69



Photo 70



Photo 71



Photo 72



Photo 73



Photo 74



Photo 75



Photo 76



Photo 77

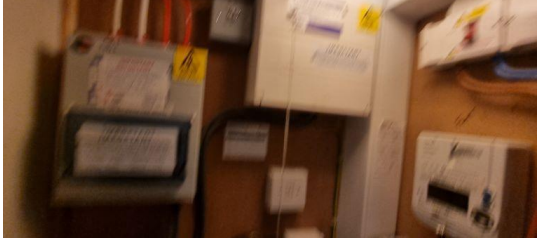


Photo 78





Photo 79



Photo 80

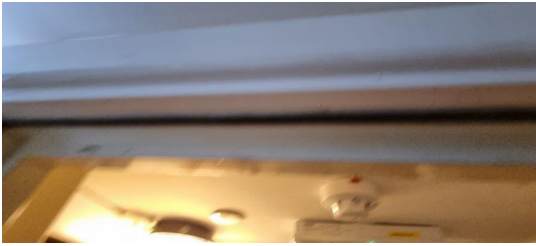


Photo 81



Photo 82



Photo 83



Photo 84



Photo 85



Photo 86



Photo 87



Photo 88



Photo 89



Photo 90