

Futures Fire Risk Assessment

Futures Homescape, 44 King Street:
NG16 6NL, - UPRN: IL11520 / 173591 / QA
Approved / Andy Cloke

Complete

Flagged items	2	Actions	8
---------------	---	---------	---

SITE NAME:

**Futures Homescape, 44 King
Street: NG16 6NL, - UPRN:
IL11520, Fire Risk Assessments,
Futures Homescape**

PROPERTY IMAGE



Photo 1

UPRN: **IL11520**

JOB NUMBER: **173591**

FRA COMPLETED BY: **Pennington Choices Limited**

FIRE RISK ASSESSOR NAME: **Adrian Gallimore**

INSPECTION DATE: **16 Nov 2023**

REPORT STATUS: **QA Approved**

REASSESSMENT PRIORITY: **High - 1 Year**

VALID TO: (QA Use Only) **29 Nov 2024**

VALIDATION DATE: (QA Use Only) **29 Nov 2023**

VALIDATED BY: (QA Use Only) **Andy Cloke**

VALIDATOR'S SIGNATURE: (QA Use Only)



Photo 2

Flagged items & Actions

2 flagged, 8 actions

Flagged items

2 flagged, 0 actions

Assessment Risk Ratings / Premises Risk Rating

Accordingly, it is considered that the risk to life from fire at these premises is:

MODERATE

Assessment Risk Ratings

On satisfactory completion of all remedial works the risk rating of this building may be reduced to

TOLERABLE

Other actions

8 actions

Detailed Risk Assessment Part 2 / F - Lightning / F1

Does the building have a lightning protection system?

No

FHG Policy Principal confirms that there is no lightning protection installed.

Open | Priority **Low** | Created by **Adrian Gallimore**

F1

It is PCL recommendation that advice is sought from a competent person to determine whether lightning protection is required or not for the building in accordance with BS EN 62305-2:2012.

Detailed Risk Assessment Part 2 / G - Housekeeping / G2

Are the escape routes kept clear of items combustible materials or waste and free of any trip hazards?

No

A trailing garden hose was identified to the garden path which is likely to present a trip hazard.

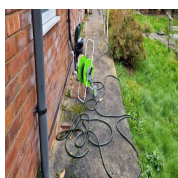


Photo 8

Open | Priority **High** | Due **29 Dec 2023 12:36 PM GMT** | Created by **Adrian Gallimore**

G2

Management should ensure that external escape routes are kept clear of trip hazards.

Detailed Risk Assessment Part 2 / M - Common Area Fire Doors / M1

Are all common area fire door and frames in good condition and appropriately fire rated?

No

Fire doors are fitted to all rooms. Doors are not labelled and it was not possible to confirm fire rating. All doors have automatic closure devices fitted and intumescent strips fitted however, gaps to doors were excessive throughout.



Photo 12



Photo 13

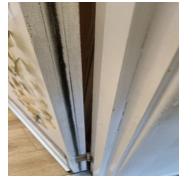


Photo 14

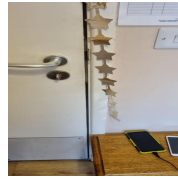


Photo 15



Photo 16



Photo 17



Photo 18

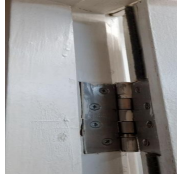


Photo 19



Photo 20



Photo 21



Photo 22



Photo 23



Photo 24

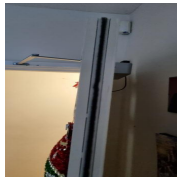


Photo 25

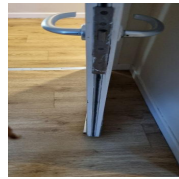


Photo 26



Photo 27



Photo 28



Photo 29



Photo 30



Photo 31



Photo 32



Photo 33

Open | Priority **Medium** | Due **29 Feb 2024 12:42 PM GMT** | Created by **Adrian Gallimore**

M1

Management should inspect all doors to the premises to establish condition and fire rating and repair or replace doors with certificated FD30S self-closing fire door(s) and frame sets where necessary. These should be fitted by an approved, third-party certified installation contractor.

Detailed Risk Assessment Part 2 / Q - Measures to Limit Fire Spread and Development / Q8

Are soft furnishings in common areas appropriate to limit fire spread/growth?

Unknown

As to avoid disturbing residents it was not possible to establish if soft furnishings are fire retardant.

Open | Priority **Medium** | Due **29 Feb 2024 12:52 PM GMT** | Created by **Adrian Gallimore**

Q8

Management should ensure that all soft furnishings are of fire retardant materials. Where materials do not conform, they should be replaced with fire retardant type.

Detailed Risk Assessment Part 2 / R - Fire Extinguishing Appliances / R1

If required, is there reasonable provision of accessible portable fire extinguishers?

No

There are 3 x 6Ltr 21A Foam fire extinguishers and 2 x 2Kg CO2 units. Extinguishers are maintained under service contract with Harmony. The last inspection was completed in February 2023. Some unit within the entrance hallway are not appropriately mounted / signed. There is no extinguisher located within the laundry.



Photo 63

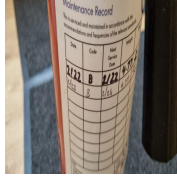


Photo 64



Photo 65

Open | Priority **Low** | Due **29 Nov 2024 12:56 PM GMT** | Created by **Adrian Gallimore**

R1

Management should ensure that extinguishers are appropriately mounted on wall brackets or floor stand with signage displayed. It is advisable that a CO2 unit within the hallway is relocated to the laundry.

Detailed Risk Assessment Part 2 / T - Procedures and Arrangements / T2

Has a competent person(s) been appointed to assist in undertaking the preventative and protective measures including in house checks?

Unknown

It was not possible to ascertain if there is a competent person appointed for this property.

Open | Priority **Low** | Created by **Adrian Gallimore**

T2

Management should confirm there is a competent person in place to undertake the preventative and protective measures for this property.

Detailed Risk Assessment Part 2 / U - Training / U1

Do staff receive adequate induction and annual refresher fire safety training? (To include fire risks in the premises, fire safety measures in the building, action in the event of fire and on hearing alarm, location and use of fire extinguishers, calling the fire service)

Unknown

Staff training is the responsibility of Real Life Options. The duty member of staff confirmed that PEEPS are in place and that staff have been trained to assist residents in the event of an emergency. Staff also confirmed that they are trained using an on-line portal which covers fire awareness and the use of fire extinguishers. Training records / course content was not seen by the assessor and it was not possible to establish the extent of training.

Open | Priority **Low** | Created by **Adrian Gallimore**

U1

Real Life Options management should ensure that staff training is adequate and appropriate for their job roles and that training is regularly reviewed.

Detailed Risk Assessment Part 2 / Z - Any Other Information / Z1

Are all issues deemed satisfactory? [1]

Unknown

The Responsible Person for the Property is the CEO of Futures Housing Group. Responsibility of day to day management, employees and care of the resident is the CEO of Real Life Options'. It was not possible if there has been consultation between duty holders.

Z1

Futures Housing Group and Real Life Options should coordinate regarding fire safety measures. In accordance with their agreed roles and responsibilities and contractual agreements, as described under Article 5 Regulatory Reform (Fire Safety) Order 2005. There is a duty to Co-operate and co-ordinate under Article 22 of the Regulatory Reform (Fire Safety) Order 2005.

Detailed Risk Assessment Part 1

1. General Information

1.1 FRA Type: **Type 1 (Non-Destructive)**

1.2 Property Type: **Converted Bungalow**

1.3 Property Designation: **Supported Accommodation**

1.4 Responsible Person: **Lindsey Williams - CEO Futures Housing Group**

1.5 No of Floors: **1**

1.6 No of Flats (if applicable): **N/A**

The property is a supported living property with no separate flats. There are three resident's bedrooms and one bedroom for sleeping in staff.

1.7 Ground Floor Area (m2): **126**

1.8 Total Area of all Floors (m2) **126**

1.9 Building Description:

The property is a converted bungalow for supported living disabled residents. There are three bedrooms with own sitting rooms and one staff bedroom. There is a kitchen and laundry. There are three exits which are via the front door, kitchen to the rear and one exit via a resident's sitting room which also leads to the rear of the property.

1.10 Building Construction:

Traditional brick built property with tiled pitched roof. All walls are solid construction with plaster-boarded, emulsion painted finish. Some walls are wallpapered.

1.11 Extent of common areas: **Entrance hallway, kitchen, laundry, bedrooms and toilets.**

1.12 Areas of the building to which access was not available: **There were no inaccessible areas of the property.**

1.13 If applicable, state which flats were sample inspected: **N/A - There are no flats to the dwelling.**

2. The Occupants

2.1 Management Extent **Managed Building - Manager or Senior Staff Onsite Regularly**

2.2 Details of any onsite Management

There are a total of 9 staff present with 2-3 person present within the day and 2 persons on night shift.

2.3 Person managing fire safety in the premises

The Responsible Person for the Property is Lindsey Williams, the CEO of Futures Housing Group. Responsibility of day to day management, employees and care of the residents is the responsibility of the CEO of Real Life Options.

2.4 Person consulted during the fire risk assessment

A duty member of staff (Colleen) was consulted during the assessment.

2.5 Number of occupants (maximum estimated)

There are 3 residents with 9 members of staff working a shift rota system. There are 3 members of staff present between 10 am and 4pm with two persons present during other times of day. There are 2 members of staff during night shift with one working and one sleeping.

2.6 Approximate maximum number of employees at any one time

Refer to 2.6.

2.7 Number of members of the public (maximum estimated)

Low numbers estimated.

2.8 Identify any people who are especially at risk (Sleeping Occupants, Disabled Occupants, Occupants in remote areas and Lone Workers, Young Persons, Others)

There are sleeping residents and staff. Residents have varying degrees of physical and mental disabilities. Two residents are mobile and one resident that is wheelchair bound. There is unlikely to be lone working.

3. Fire Safety Legislation

3.1 The following fire safety legislation applies to these premises

Regulatory Reform (Fire Safety) Order 2005

3.2 The above legislation is enforced by

Derbyshire Fire and Rescue Service

Although the property has a Nottinghamshire postcode the area is in Derbyshire.

3.3 Other key fire safety legislation (other than Building Regs 2000)

Housing Act 2004

3.4 The other legislation referred to above is enforced by

Local Governing Authority.

3.5 Guidance used as applicable to premises and occupation

NFCC - Specialised Housing Guidance

3.6 Is there an alteration or enforcement notice in force?

Unknown

Members of staff confirmed that there is currently no enforcement notice in force.

3.7 Fire loss experience (since last FRA)

Unknown

Members of staff confirmed that there has been no fire loss. There was no evidence of fire loss or damage at the time of assessment.

Detailed Risk Assessment Part 2

8 actions

A - Electrical Ignition Sources

A1

Is the fixed electrical installation periodically inspected and tested, (include dates if known)?

Yes

The label on the consumer unit within the property confirmed that the fixed wiring was last inspected on March 2019.



Photo 3

Policy Principle: FHG complete Fixed wire testing in line with current regulations every 5 years and complete an annual visual inspection on all properties.

A2

Is PAT testing in common areas carried out?

Yes

Labels on appliances confirmed that PAT testing was completed in July 2023.



Photo 4

Policy Principle: PAT testing is complete at the time of the visual inspection as mentioned above. All items in the communal areas will be tested.

A3

Is there a policy for personal electrical appliances (consider restrictions of communal supply points such as outlets and T pin outlets)?

Yes

Policy Principle: PAT testing is complete at the time of the visual inspection as mentioned above. All items in the communal areas will be tested.

A4

Is the use of adapters and leads limited?

N/A

No adapters or leads were identified at the time of assessment.

A5

Are there any PV cells installed and do they have the appropriate isolation systems and signage to assist the fire and rescue service?

N/A

None present.

B - Smoking Policies

B1

Are there suitable arrangements to prevent fire as a result from smoking?

Yes

Policy Principle: No smoking policy in all communal areas- signage displayed.

B2

Is the policy being adhered to and are "No smoking" signs provided in the common areas?

Yes

There was no evidence of illicit smoking. Signage is not required due to the nature of the premises and staff on site 24/7.

C - Arson

C1

Are premises secure against arson by outsiders? (Please state how)

Yes

Standard security locks are fitted to the property. The door is kept locked at all times and only opened by a member of staff.

C2

Are bins secured or fire loading stored in a suitable location? (Please state bin type, location, if and how it is secured)

Yes

Domestic waste bins are located to the rear of the premise.

D - Portable Heaters and Installations

D1

If used, is the use of portable heaters regarded as safe?

N/A

There were no portable heaters identified at the time of assessment.

D2

Are fixed heating systems maintained annually?

Yes

There is a domestic gas boiler located within the laundry room. The last Gas Safety Inspection was completed on 24/03/2023.



Photo 5

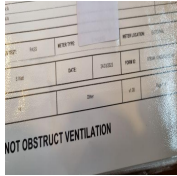


Photo 6

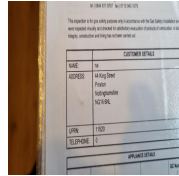


Photo 7

Policy Principle: All Safety inspections carried out annually by qualified persons.

E - Cooking

E1

Are reasonable measures in place to prevent fires as a result of cooking, including replacing filter(where necessary)?

Yes

There is a domestic electric cooker within the kitchen. Cooking is completed by a member of staff.

F - Lightning

1 action

F1

1 action

Does the building have a lightning protection system?

No

FHG Policy Principal confirms that there is no lightning protection installed.

Open | Priority **Low** | Created by **Adrian Gallimore**

F1

It is PCL recommendation that advice is sought from a competent person to determine whether lightning protection is required or not for the building in accordance with BS EN 62305-2:2012.

Policy Principle: No lightning protection policy in place

Action/Recommendation Required?

Yes

Action Priority:

Recommendation - No Timescale

G - Housekeeping

1 action

G1

Are combustible materials kept away from any sources of ignition, including gas and electrical intake cupboards?

Yes

No issues were identified at the time of assessment. Housekeeping standards were found to be good.

G2

1 action

Are the escape routes kept clear of items combustible materials or waste and free of any trip hazards?

No

A trailing garden hose was identified to the garden path which is likely to present a trip hazard.

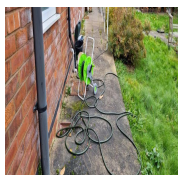


Photo 8

Open | Priority **High** | Due **29 Dec 2023 12:36 PM GMT** | Created by **Adrian Gallimore**

G2

Management should ensure that external escape routes are kept clear of trip hazards.

Action/Recommendation Required?

Yes

Action Priority:

High - 1 Month

G3

Are mobility scooters or electric vehicles stored in the means of escape? If yes has an assessment been undertaken in line with the NFCC "Mobility Scooter Guidance for Residential Buildings"?

N/A

None present at the time of assessment.

H - Hazards Introduced by Contractors

H1

Is there satisfactory control over works carried out in the building by contractors (e.g. hot work permits)?

Yes

Policy Principle: All contractors must submit RAMS for procurement processes, and these are reviewed annually by FHG. A specific risk assessment is to be completed for each job.

I - Dangerous Substances

I1

If dangerous substances are used, has a risk assessment been carried out as required by the

Dangerous Substances and Explosives Atmospheres Regulations 2002 and are they stored correctly?

N/A

There were no dangerous substances identified. Refer to Policy Principle.

J - Other Significant Hazards

J1

Are all issues deemed satisfactory? [1]

N/A

No additional significant hazards were identified at the time of assessment.

J2

Are all issues deemed satisfactory? [2]

N/A

No additional significant hazards were identified at the time of assessment.

K - Means of Escape

K1

Is the escape route design deemed satisfactory? (Consider current design codes)

Yes

The escape route is satisfactory.

K2

Is the fire-resisting construction (including any glazing) protecting escape routes and staircases of a suitable standard and maintained in sound condition?

Yes

Walls are solid with emulsion paint / wall papered finish. Ceilings are emulsion painted plastered finish throughout.

K3

Is there adequate provision of exits (including exit Widths) for the numbers who may be present?

Yes

Exits are via the front door, kitchen to the rear garden and an exit from the left hand sitting room to the rear garden.

K4

Are doors on escape routes easily opened? (and are sliding or revolving doors avoided?)

Yes

Exit doors are fitted with thumb turn locks.

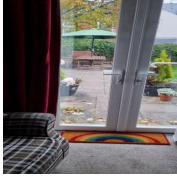


Photo 9



Photo 10

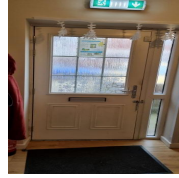


Photo 11

K5

Do final exits open in the direction of escape where necessary?

N/A

All exits open inwardly however, occupancy levels are low.

K6

Are travel distances satisfactory? (consider single direction and more than one direction, property risk profile and occupancy characteristics)

Yes

Travel distances are acceptable.

K7

Are there suitable precautions for all inner rooms?

N/A

There are no inner room scenarios

K8

Are escape routes separated where appropriate?

N/A

Not required.

K9

Are corridors sub-divided where appropriate?

N/A

Not required.

K10

Do escape routes lead to a place of safety?

Yes

Escape routes are acceptable.

K11

Are the stairs and/or lobbies provided with adequate ventilation?
(If considered satisfactory, please state provision)

Yes

The premise is a domestic bungalow with opening windows and doors throughout.

K12

Are there any other issues that could affect the means of escape, for example plastic conduit/loose cables not secured by fire rated fastening?

N/A

No issues were identified.

L - Flat Entrance Doors

L1

Are the sample inspection flat entrance door or doors in good condition and appropriately fire rated?

N/A

There are no flats to the building.

M - Common Area Fire Doors

1 action

M1

1 action

Are all common area fire door and frames in good condition and appropriately fire rated?

No

Fire doors are fitted to all rooms. Doors are not labelled and it was not possible to confirm fire rating. All doors have automatic closure devices fitted and intumescent strips fitted however, gaps to doors were excessive throughout.

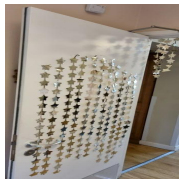


Photo 12



Photo 13

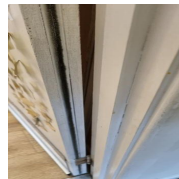


Photo 14

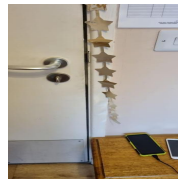


Photo 15



Photo 16



Photo 17



Photo 18

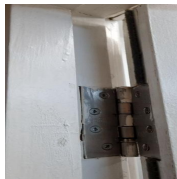


Photo 19



Photo 20

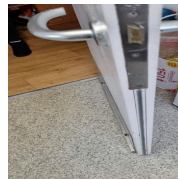


Photo 21



Photo 22



Photo 23



Photo 24

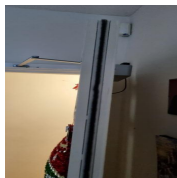


Photo 25

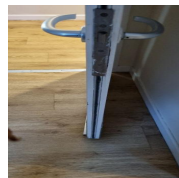


Photo 26

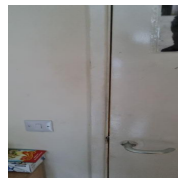


Photo 27

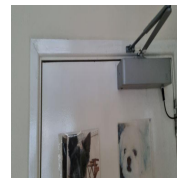


Photo 28



Photo 29



Photo 30



Photo 31



Photo 32



Photo 33

M1

Management should inspect all doors to the premises to establish condition and fire rating and repair or replace doors with certificated FD30S self-closing fire door(s) and frame sets where necessary. These should be fitted by an approved, third-party certified installation contractor.

Action/Recommendation Required?

Yes

Action Priority:

Medium - 3 Months

N - Emergency Lighting

N1

If emergency lighting is provided, is the coverage sufficient and in good repair? (Internal and external)

Yes

Emergency lighting is fitted to all rooms and hallways. No defects were identified.

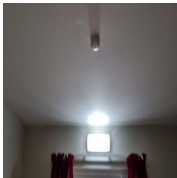


Photo 34

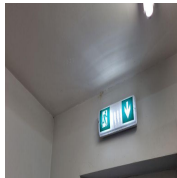


Photo 35



Photo 36



Photo 37

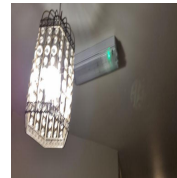


Photo 38

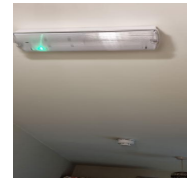


Photo 39



Photo 40



Photo 41

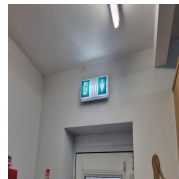


Photo 42

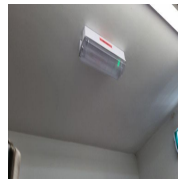


Photo 43

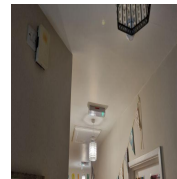


Photo 44



Photo 45

N2

If EL not provided, is borrowed/artificial lighting sufficient for escape? (Internal and external)

Yes

External emergency lighting is installed to exits.

O - Fire Safety Signs and Notices

O1

Is there adequate provision of visible fire safety signs and notices? (Consider directional, exits, stairs, fire action notices, Fire door keep shut, fire equipment and 'do not use lift' signage)

Yes

Illuminated signs are displayed to exits.

O2

Wayfinding Signage (buildings over 11 metres in height). Are there clear markings for flat and

floor recognition provided?

N/A

N/A - The property is a single storey bungalow.

P - Means of Giving Warning in Case of Fire

P1

Is a reasonable fire detection and fire alarm system provided in the common areas, where necessary?

Yes

An automatic alarm system is installed with AFD to all habitable rooms, kitchen, laundry and hallway to BS5839:L2 specification. The alarm panel is situated within the entrance hallway and was in a healthy condition with no faults identified



Photo 46

P2

If installed, is the common area AFD adequate for the occupancy and fire risk?

Yes

AFD is installed to all habitable rooms, kitchen, laundry and hallway.

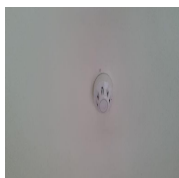


Photo 47

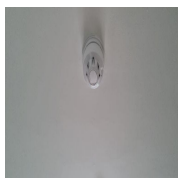


Photo 48

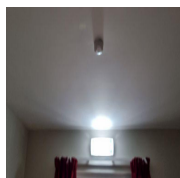


Photo 49

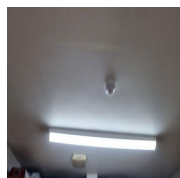


Photo 50

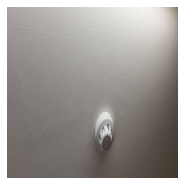


Photo 51

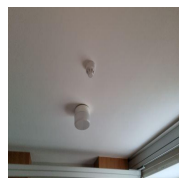


Photo 52

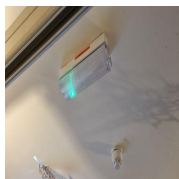


Photo 53



Photo 54

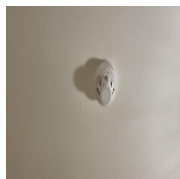


Photo 55

P3

If not installed, are the premises deemed safe without a common area AFD system?

N/A

AFD is installed.

P4

If there is a communal fire detection and fire alarm system, does it extend into the dwellings?

N/A

The property is a converted bungalow with no separate flats. AFD is installed to all habitable rooms.

P5

Where appropriate, has a fire alarm zone plan been provided?

Yes

A zone plan is installed to the fire alarm panel.



Photo 56

P6

Where appropriate, are there adequate arrangements for silencing and resetting an alarm condition?

Yes

There is a member of staff present at all times that are able to silence and reset the alarm.

P7

If applicable, is a separate domestic hard-wired smoke/heat alarm within the flats installed to a suitable standard?

N/A

The property is a converted bungalow with no separate flats. AFD is installed to all habitable rooms, kitchen and hallway.

P8

If applicable (Sheltered scheme) is the smoke detection within the flats monitored by an alarm receiving centre/on site scheme manager via a telecare system?

Yes

The property is a supported living dwelling with a member of staff on site at all times.

Q - Measures to Limit Fire Spread and Development

1 action

Q1

Is there adequate levels of compartmentation between floors and between flats and the common escape routes?

Yes

Walls are solid construction with wallpapered / emulsion painted finish. Ceilings are emulsion painted plasterboard. No compartmentation breaches were identified.

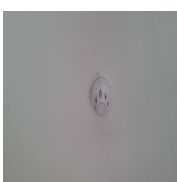


Photo 57

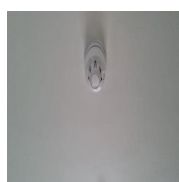


Photo 58

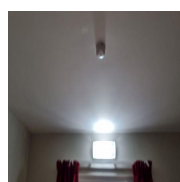


Photo 59



Photo 60

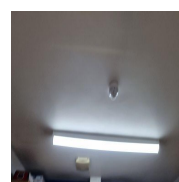


Photo 61

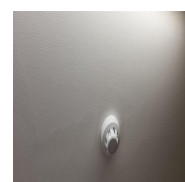


Photo 62

Q2

Are hidden voids appropriately enclosed and/or fire-stopped?
(consider above suspended ceilings)

N/A

None present.

Q3

Is there adequately fire protected service risers and/or ducts in common areas, that will restrict the spread of fire and smoke?

N/A

None present.

Q4

Is compartmentation maintained in the roof space?

N/A

The bungalow if a detached property with minimal risk of fire spread.

Q5

Are electrics, including embedded meters, enclosed in fire rated construction?

N/A

There is a consumer unit within the laundry which does not require enclosing.

Q6

As far as can reasonably be ascertained, are fire dampers provided as necessary to protect critical means of escape against passage of fire, smoke and products of combustion in the early stages of a fire?

N/A

None present.

Q7

Is there reasonable limitation of linings to escape routes that might promote fire spread?

Yes

Walls are solid construction with wallpapered / emulsion painted finish. Ceilings are emulsion painted plasterboard. No compartmentation breaches were identified.

Q8

1 action

Are soft furnishings in common areas appropriate to limit fire spread/growth?

Unknown

As to avoid disturbing residents it was not possible to establish if soft furnishings are fire retardant.

Q8

Management should ensure that all soft furnishings are of fire retardant materials. Where materials do not conform, they should be replaced with fire retardant type.

Action/Recommendation Required?

Yes

Action Priority:

Medium - 3 Months

Q9

Does the premises have any external balconies, cladding or materials which may promote external fire spread?

N/A

None present.

Q10

Has a note been prepared of the external walls of the building and details of construction materials used? Does the note include and identify the level of risk that the design and materials used?

N/A

Not required.

Q11

Does the External wall note include any mitigating circumstances that may have been taken to reduce the risk?

N/A

Not required.

Q12

Has the responsible person reviewed the external wall note on a regular basis and revised it if there have been any significant changes in the external walls.

N/A

Not required.

Q13

Are all other fire spread/compartmentation issues satisfactory?

N/A

No compartmentation issues were identified at the time of assessment.

R - Fire Extinguishing Appliances

1 action

R1

1 action

If required, is there reasonable provision of accessible portable

No

fire extinguishers?



There are 3 x 6Ltr 21A Foam fire extinguishers and 2 x 2Kg CO2 units. Extinguishers are maintained under service contract with Harmony. The last inspection was completed in February 2023. Some unit within the entrance hallway are not appropriately mounted / signed. There is no extinguisher located within the laundry.



Photo 63

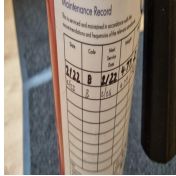


Photo 64



Photo 65

Open | Priority **Low** | Due **29 Nov 2024 12:56 PM GMT** | Created by **Adrian Gallimore**

R1

Management should ensure that extinguishers are appropriately mounted on wall brackets or floor stand with signage displayed. It is advisable that a CO2 unit within the hallway is relocated to the laundry.

Action/Recommendation Required?

Yes

Action Priority:

Low - 12 Months

S - Relevant Automatic Fire Extinguishing Systems

S1

Are there any automatic fire suppressant systems on site?

N/A

None present.

S2

Are there any fixed fire fighting mains within the premises?

N/A

None present.

S3

If any other relevant systems / equipment is installed, state type of system and comment as necessary

N/A

None present.

T - Procedures and Arrangements

1 action

T1

Recommended evacuation strategy for this building is:

Simultaneous Evacuation

T2

1 action

Has a competent person(s) been appointed to assist in undertaking the preventative and protective measures including in house checks?

Unknown

It was not possible to ascertain if there is a competent person appointed for this property.

Open | Priority **Low** | Created by **Adrian Gallimore**

T2

Management should confirm there is a competent person in place to undertake the preventative and protective measures for this property.

Action/Recommendation Required?

Yes

Action Priority:

Recommendation - No Timescale

T3

Are there appropriate documented fire safety arrangements and procedures in place in the event of fire?

Yes

Fire procedures for residents and staff are the responsibility of Real Life Options. The duty member of staff that there are procedures in place for staff and residents.

T4

Are there suitable arrangements for liaison and calling the Fire Service?

Yes

Staff would call the fire service.

T5

Are there suitable fire assembly points away from any risk?

Yes

Staff and residents would evacuate to a place of relative safety on the street.

T6

Are there adequate procedures in place for the evacuation of disabled people who are likely to be present?

Yes

Staff training is the responsibility of United Response. The duty member of staff confirmed that PEEPS are in place and that they have been trained to assist the resident in the event of an emergency. Training records were not seen by the assessor at time of assessment.

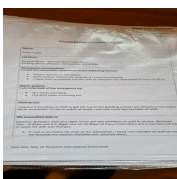


Photo 66

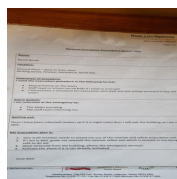


Photo 67

T7

Are staff nominated and trained on the use of fire extinguishing appliances?

Unknown

Staff stated that they are trained using Real Life Options on-line portal which covers the use of Fire Extinguishers. It was not possible to establish if training was acceptable as the course content was not seen by the assessor. Refer to U1

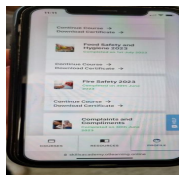


Photo 68

T8

Are staff nominated and trained to assist in evacuation (Where applicable e.g. Offices, supported schemes)?

Yes

Staff training is the responsibility of Real Life Options. The duty member of staff confirmed that PEEPS are in place and that they have been trained to assist residents in the event of an emergency. Training records were not seen by the assessor at time of assessment.

U - Training

1 action

U1

1 action

Do staff receive adequate induction and annual refresher fire safety training? (To include fire risks in the premises, fire safety measures in the building, action in the event of fire and on hearing alarm, location and use of fire extinguishers, calling the fire service)

Unknown

Staff training is the responsibility of Real Life Options. The duty member of staff confirmed that PEEPS are in place and that staff have been trained to assist residents in the event of an emergency. Staff also confirmed that they are trained using an on-line portal which covers fire awareness and the use of fire extinguishers. Training records / course content was not seen by the assessor and it was not possible to establish the extent of training.

Open | Priority **Low** | Created by **Adrian Gallimore**

U1

Real Life Options management should ensure that staff training is adequate and appropriate for their job roles and that training is regularly reviewed.

Policy Principle: All touchdown points (small offices) staff receive Inductions and annual refreshers on fire safety fire safety. But at all the schemes no permanent staff are present.

Action/Recommendation Required?

Yes

Action Priority:

Recommendation - No Timescale

U2

Are employees nominated to assist in the event of fire given additional training?

Unknown

Refer to U2.

V - Testing and Maintenance

V1

Are all fire safety provisions for the building (AFD, Emergency Lighting, sprinklers etc.) routinely tested and maintained?

Yes

Refer to Policy Principle for FHG testing / maintenance. Real Life Options also complete in-house checking regimes which are recorded in a fire log folder.

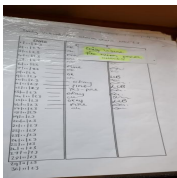


Photo 69

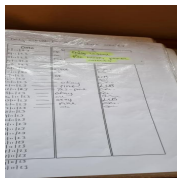


Photo 70

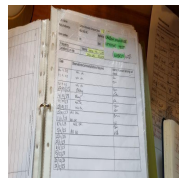


Photo 71

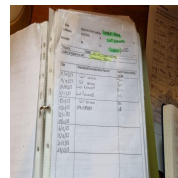


Photo 72



Photo 73



Photo 74

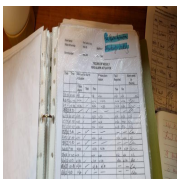


Photo 75

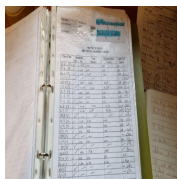


Photo 76

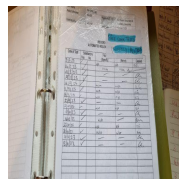


Photo 77

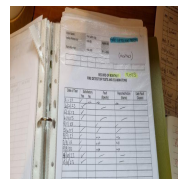


Photo 78

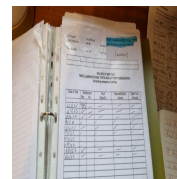


Photo 79

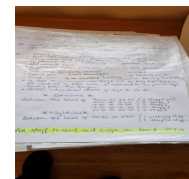


Photo 80

Policy Principle: Alarms- FHG Greenscapes, MITIE. E/L- FHG Greenscapes, MITIE. Assets Surveyor Extinguishers- MITIE. Fire Doors- FHG Greenscapes, Assets Surveyor Final Exits/ Escape Routes- Greenscapes/ Neighbourhoods.

W - Records

W1

Is all routine testing and staff training including fire drills suitably recorded and available for inspection?

Unknown

Staff training is the responsibility of Real Life Options (see U1). A Fire Drill was completed in November 2023.

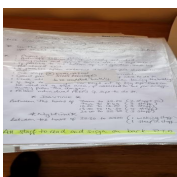


Photo 81

X - Premises Information Box

X1

Is a Premises Information Box located at the premises accessible to the Fire and Rescue Service, secure from unauthorised access and kept up to date?

Yes

No Premises Information Box installed. Real Life Options complete a fire log.

Policy Principle: Log book is kept on SharePoint with proposed specific QR code access.

Y - Engagement with Residents

Y1

Has all Fire Safety information & procedures been disseminated to the residents?

N/A

Procedures / Fire Safety information is the responsibility of Real Life Options.

Z - Any Other Information

1 action

Z1

1 action

Are all issues deemed satisfactory? [1]

Unknown

The Responsible Person for the Property is the CEO of Futures Housing Group. Responsibility of day to day management, employees and care of the resident is the CEO of Real Life Options'. It was not possible if there has been consultation between duty holders.

Open | Priority **Low** | Due **29 Nov 2024 1:14 PM GMT** | Created by **Adrian Gallimore**

Z1

Futures Housing Group and Real Life Options should coordinate regarding fire safety measures. In accordance with their agreed roles and responsibilities and contractual agreements, as described under Article 5 Regulatory Reform (Fire Safety) Order 2005. There is a duty to Co-operate and co-ordinate under Article 22 of the Regulatory Reform (Fire Safety) Order 2005.

Action/Recommendation Required?

Yes

Action Priority:

Low - 12 Months

Z2

Are all issues deemed satisfactory? [2]

N/A

No further issues were identified.

Assessment Risk Ratings

2 flagged

Risk Rating

The following simple risk level estimator is based on a more general health and safety risk level estimator of the type contained in BS 8800:

Likelihood of fire	Potential consequences of fire		
	Slight Harm	Moderate Harm	Extreme Harm
Low	Trivial	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	Intolerable

Likelihood of Fire

Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from fire (likelihood of fire) at these premises is:

MEDIUM

In this context, a definition of the above terms is as follows:

Low: Unusually low likelihood of fire as a result of negligible potential sources of ignition.

Medium: Normal fire hazards (e.g. potential ignition sources) for this type of occupancy, with fire hazards generally subject to appropriate controls (other than minor shortcomings).

High: Lack of adequate controls applied to one or more significant fire hazards, such as to result in significant increase in likelihood of fire.

Potential Consequences of Fire

Taking into account the nature of the building and occupants, as well as the fire protection and procedural arrangements observed at the time of this fire risk assessment, it is considered that the consequences for life safety in the event of fire would be:

MODERATE HARM

Potential Consequences of Fire

In this context, a definition of the above terms is as follows:

Slight harm: Outbreak of fire unlikely to result in serious injury or death of any occupant.

Moderate harmful: Outbreak of fire could foreseeably result in injury (including serious injury) of one or more occupants, but it is unlikely to involve multiple fatalities.

Extreme harm: Significant potential for serious injury or death of one or more occupants likely to involve multiple fatalities.

Premises Risk Rating

1 flagged

Accordingly, it is considered that the risk to life from fire at these premises is:

MODERATE

A suitable risk-based control plan should involve effort and urgency that is proportional to risk. The following risk-based control plan is based on one advocated by BS 8800 for general health and safety risks:

Risk Level	Action and time table
Trivial	No action is required and no detailed records need be kept.
Tolerable	No major additional controls required. However, there might be a need for improvements that involve minor or limited cost.
Moderate	It is essential that efforts are made to reduce the risk. Risk reduction measures should be implemented within a defined time period. Where moderate risk is associated with consequences that constitute extreme harm, further assessment might be required to establish more precisely the likelihood of harm as a basis for determining the priority for improved control measures.
Substantial	Considerable resources might have to be allocated to reduce the risk. If the building is unoccupied, it should not be occupied until the risk has been reduced. If the building is occupied, urgent action should be taken.
Intolerable	Building (or relevant area) should not be occupied until the risk is reduced.

(Note that, although the purpose of this section is to place the risk in context, the above approach to fire risk assessment is subjective and for guidance only. All hazards and deficiencies identified in this report should be addressed by implementing all recommendations contained in the following action plan. The fire risk assessment should be reviewed regularly.)

On satisfactory completion of all remedial works the risk rating of this building may be reduced to

TOLERABLE

Limitations Statement

Fire Risk Assessment – Limitations

The purpose of the fire risk assessment is solely to provide an assessment of the risk to life from fire, and, where appropriate, to make recommendations to reduce the risk to life from fire. This assessment does not address fire risks to property or business continuity.

Under Article 5(4) of the Regulatory Reform (Fire Safety) Order 2005 or other devolved equivalent regional legislation and relevant United Kingdom law, we have been appointed to provide advice to the Responsible Person only. We have no control over any part of the premises covered within this fire risk assessment, and we have no responsibility for undertaking any of the recommendations made. The assessment is intended to assist the Responsible Person to comply with their responsibilities under the Regulatory Reform (Fire Safety) Order 2005.

Any policy principles included within this Fire Risk Assessment have been provided by the responsible person or their representative and been added in good faith. We cannot take responsibility for the accuracy of the policy principles with regard to the client's internal policies, British Standards or codes of practice.

Any test certificates supplied as part of the Fire Risk Assessment process will be considered but we take no responsibility or liability whatsoever is accepted for the accuracy of such information supplied by others.

The findings of the fire risk assessment will be based upon the conditions found at the Premises at the time the assessment is to be carried out and on relevant information provided by the Responsible Person or others either prior to, during or after the Fire Risk Assessment of the premises.

We consider the External Wall System as part of the Fire Risk Assessment process, however, we take no responsibility for a fire risk appraisal of external wall construction on existing buildings and work to the guidance and limitations detailed in PAS 9980:2022 0.2 Fire risk assessments. Any information supplied to the Fire Risk Assessor is taken in good faith and we accept no responsibility for the accuracy of the information supplied.

No responsibility is accepted for any change in the conditions or circumstances prior after the Fire Risk Assessment has been undertaken.

It is stressed that the assessment should not be regarded as a structural survey for fire safety purposes as such a survey should only be entrusted to a qualified building surveyor. The Fire Risk Assessment did not involve destructive exposure (Unless specifically requested as part of a contractual arrangement), and therefore it is not always possible to survey less readily accessible areas. It is, therefore, necessary to rely on a degree of sampling and also reasonable assumptions and judgements.

All services or penetrations traversing fire resisting compartments are not confirmed as being sufficiently fire stopped with fire resisting material to the appropriate standard. If fire compartments\fire dampers\voids (ceilings, floors or other voids) are considered inaccessible for safety reasons or any other reason and cannot be physically accessed or are outside the visual range of the assessor, technical comment on these areas cannot be provided.

This fire risk assessment will not necessarily identify all minor fire-stopping issues that might exist within the building and should be considered to be a sample of fire compartmentation. Unless a full fire compartmentation survey is contractually included within the scope of the assessment. If there are reasons to suspect the fire resistance within the Premises has not been sufficiently maintained the responsibility to provide this technical information rests with the Responsible Person\duty holder.

This fire risk assessment will not necessarily identify all minor fire door issues that might exist within the building and should be considered a sample of fire doors. Unless a full fire door survey is contractually included within the scope of the assessment.

A full investigation of the design of heating, ventilation and air conditioning (HVAC) systems is outside the scope of this fire risk assessment.

Although reference in the report may be made to relevant British Standards, Codes of Practice and Guides the assessment will not, nor is it intended to, ensure compliance with any of the documents referred to in the assessment. However, deviations from generally accepted codes, standards and universally recognised good fire safety practice will be identified in the assessment.

Where an emergency escape lighting system is present, comments are based upon a visual assessment of the system coverage and condition, but no illuminance tests or verification of the installation to the relevant British Standards were carried out.

Where a fire alarm system is present, comments are based upon a visual assessment, but no audibility tests or verification of full compliance with the relevant British Standards were carried out.

Where manual firefighting equipment is present, comments are based upon a visual assessment, but no verification of full compliance with the relevant British Standards or codes of practice were carried out.

It is the expectation that any reference to the testing and maintenance of passive or active fire protection systems within the premises are undertaken to the relevant current British Standards, Codes of Practice and Guides it is the responsible person's duty to ensure this is undertaken.

There will be a brief review of procedures at the time of this fire risk assessment. An in-depth review of documentation is outside the scope of this fire risk assessment, unless otherwise stated in the contract.

The report will highlight the Significant Findings (Split into Recommendations and Action(s)) that the Fire Risk Assessor found at the time of the assessment.

It is the responsibility of the Responsible Person to ensure that any deficiencies found during the assessment and subsequently reported to the Responsible Person, by the report or other means, are their responsibility to rectify to a satisfactory standard to meet the requirements of the Regulatory Reform (Fire Safety) Order 2005.

It is wholly the responsibility of the Responsible Person and/or their agent to implement and maintain the Fire Precautions at the Premises to a satisfactory standard and condition to comply with the requirements of the Regulatory Reform (Fire Safety) Order 2005.

Failure to address and/or rectify any deficiencies mentioned in the report may result in serious harm, injury and or death to any relative person, employee, visitor, you or any other person in, on, within or without the perimeter of the Premises.

Failure to address any of the deficiencies highlighted in the report may be considered to be a breach of the Regulatory Reform (Fire Safety) Order 2005 and may result in prosecution by the enforcing authority.

Responsibility for the ongoing management of the Premises and even, if necessary, the decision to allow the Premises to be used for their present purpose, and in the current condition remains with the Responsible Person.

Responsibility for management procedures regarding, evacuation management, and maintenance of firefighting equipment, Fire alarms systems, emergency escape lighting, and any other emergency-related provisions remains a duty of the responsible person, not the fire risk

assessor as this is not within their control.

Any faults or deficiencies in any emergency emergency-related staffing levels and/or staff training are the responsibility of the Responsible Person and/or the duty holder.

Portable or moveable items and items brought into the Premises are the responsibility of the Responsible Person and/or the duty holder.

It is recommended that the Assessment is reviewed annually or when there is a significant change, material alteration, change in the use of the Premises, a change in working practices, or following any incident, including fire, which may affect the Fire Precautions of the Premises.

The circumstances of the Premises may change over time and with use and/or occupancy, therefore, failure to review the fire risk assessment by the date indicated may mean that the fire risk assessment is no longer valid.

This Fire Risk Assessment is not a Health and Safety Report. A Health and Safety review should be conducted to ensure compliance with the Health and Safety at Work Act 1974.

Compliance with all other legislation is the responsibility of the Responsible Person. We accept no responsibility for loss, damage or other liability arising from a fire, loss and/or injury due to the failure to observe the safety, observance and practises identified in the Assessment

The Responsible Person will always remain responsible for the outcome of the Fire Risk Assessment and/or its review. This includes the accuracy of details contained within this report.

By signing for, by payment for services or acknowledgement of receipt of the report you accept full responsibility and accountability for implementing the findings of the report.

BAFE Certificate (QA Use Only)



Life Safety Fire Risk Assessment Certificate of Conformity

This certificate is issued by the organization named in Part 1 of the schedule in respect of the fire risk assessment provided for the person(s) or organization named in Part 2 of the schedule at the premises and / or part of the premises identified in Part 3 of the schedule

Schedule

Part 1a - Name and Address of Certified Organisation	Pennington Choices Limited
Part 1b - BAFE Registration Number of Issuing Certified Organisation	102119
Part 1c - SSAIB 3rd Party Certificate Number	CHES077
Part 2 - Name of Client	Futures Housing Group
Part 3a - Address of premises for which the Fire Risk Assessment was carried out	44 King Street: NG16 6NL
Part 3b - Part or parts of the premises to which the Fire Risk Assessment applies	Entrance hallway, kitchen, laundry, bedrooms and toilets.
Part 4 - Brief description of the scope and purpose of the Fire Risk Assessment	Life Safety (as agreed spec)
Part 4b - Limitations of FRA	See Limitations Statement
Part 5 - Effective Date of the Fire Risk Assessment	29 Nov 2023
Part 6 - Recommended Date for Reassessment of the premises	29 Nov 2024
Part 7 - Unique Reference Number of this Certificate (Job Number)	173591

Signed for on behalf of the Issuing Certified Organisation

James Hutton



Dated:

29 Nov 2023

SSAIB, 7-9 Earsdon Road, West Monkseaton, Whitley Bay, Tyne & Wear. NE25 9SX

BAFE, The Fire Service College, London Road, Moreton-in-Marsh, Gloucestershire, GL56 0RH
01608 653 350 | info@bafes.org.uk | www.bafes.org.uk

Media summary



Photo 1

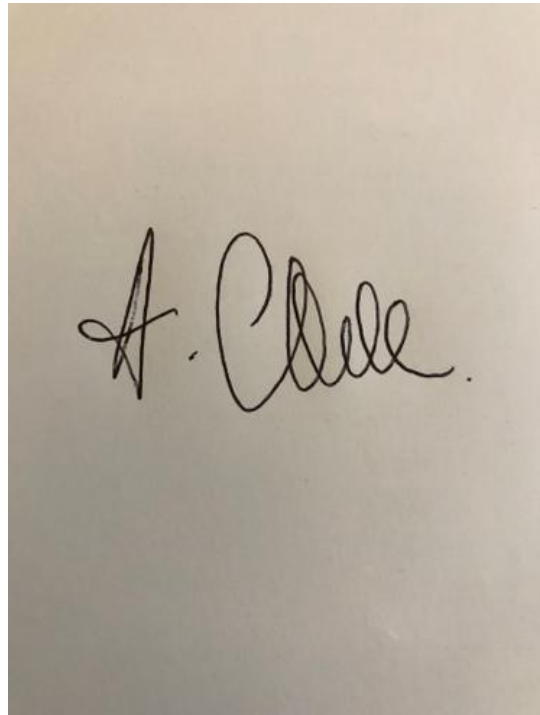


Photo 2

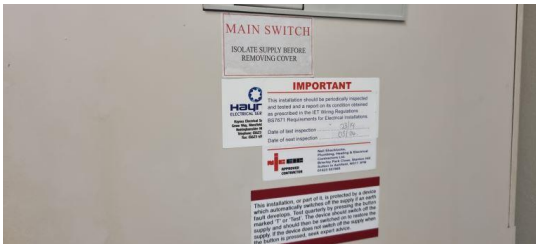


Photo 3



Photo 4

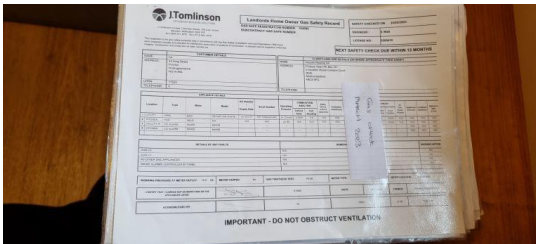


Photo 5



Photo 6

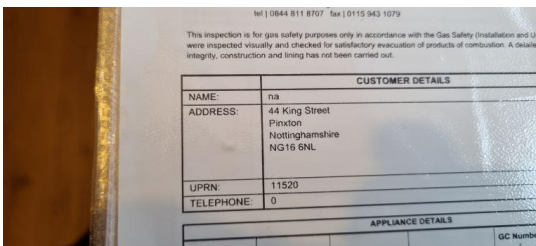


Photo 7

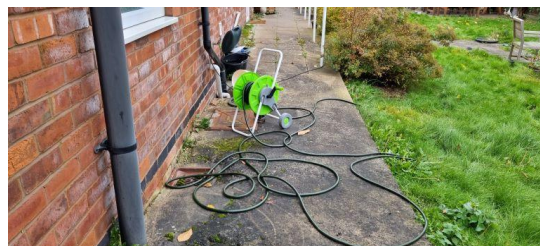


Photo 8



Photo 9



Photo 10



Photo 11



Photo 12



Photo 13



Photo 14



Photo 15



Photo 16



Photo 17



Photo 18



Photo 19



Photo 20



Photo 21



Photo 22



Photo 23



Photo 24



Photo 25



Photo 26



Photo 27



Photo 28



Photo 29



Photo 30



Photo 31



Photo 32



Photo 33

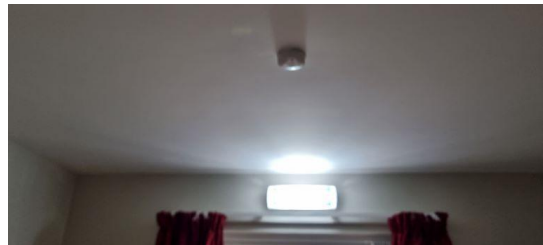


Photo 34



Photo 35



Photo 36



Photo 37



Photo 38



Photo 39



Photo 40



Photo 41



Photo 42



Photo 43

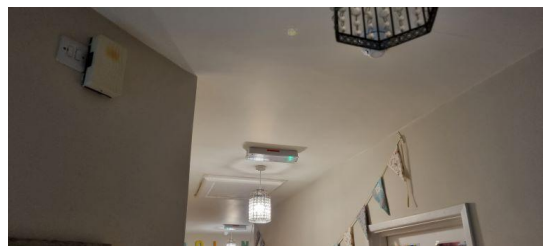


Photo 44



Photo 45



Photo 46



Photo 47



Photo 48

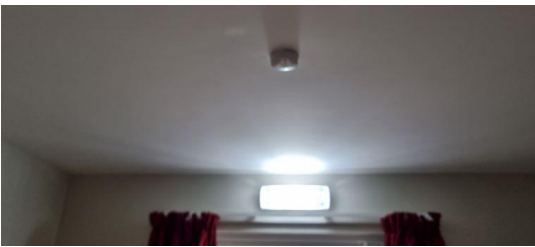


Photo 49

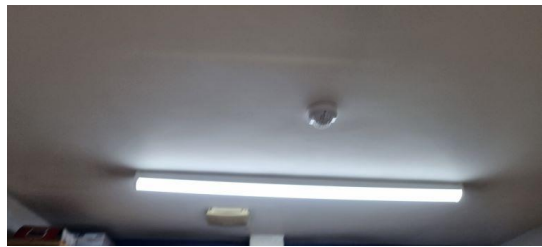


Photo 50



Photo 51



Photo 52



Photo 53



Photo 54



Photo 55



Photo 56



Photo 57



Photo 58

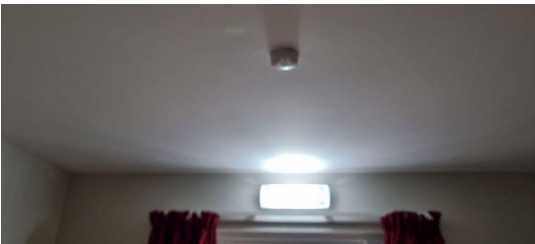


Photo 59



Photo 60

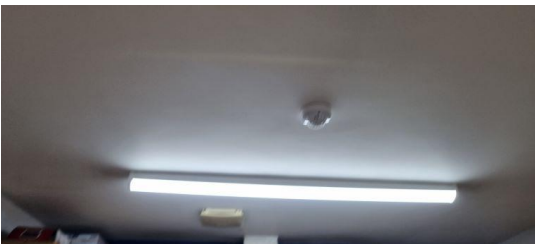


Photo 61



Photo 62



Photo 63

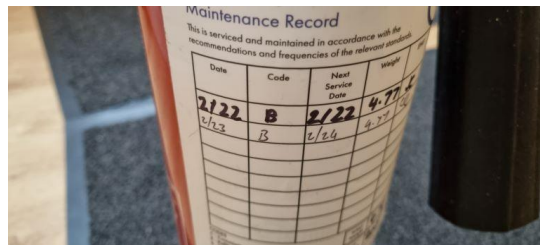


Photo 64



Photo 65

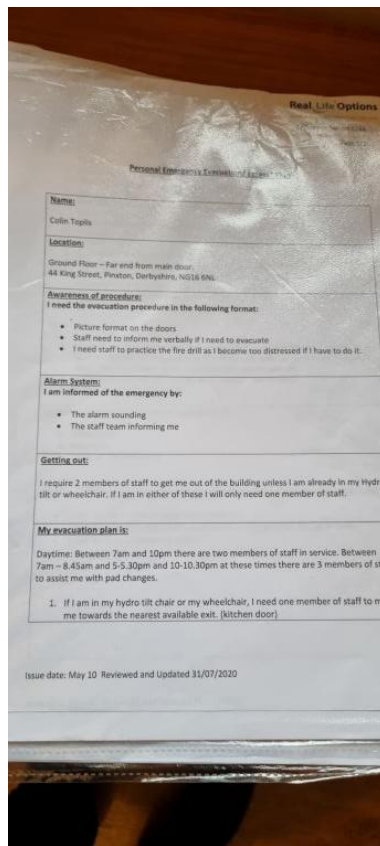


Photo 66

Real Life Options
Reference No: 1982241
Page 1/3

Personal Emergency Evacuation/Egress Plan

Name:
David Booth

Location:
Ground Floor – Next to main door,
44 King Street, Pinxton, Derbyshire, NG18 6NL

Awareness of procedures:
I need the evacuation procedure in the following format:

- Picture format on the doors
- Staff need to inform me verbally if I need to evacuate
- I will practice a simulated fire evacuation with staff and this will be recorded in the red file folder.

Alarm System:
I am informed of the emergency by:

- The alarm sounding
- The staff team informing me

Getting out:
Once I have been informed (woken up if it is night time) then I will exit the building as I am mobile.

My evacuation plan is:

- One staff member needs to escort me out of the nearest and safest evacuation exit.
- If I am in bed, guide me towards the nearest safest exit which is located in my lounge safe to do so).
- Once removed from the building, phone the emergency services.
- Activate the alarm if it is not already activated.

Issue date:

Headquarters: The Old Hall, Burton Road, Littleover, Derby DE23 6EH
Telephone No 01332 771221 Fax No 01332 271900 Minicom No 01332 271900

Photo 67

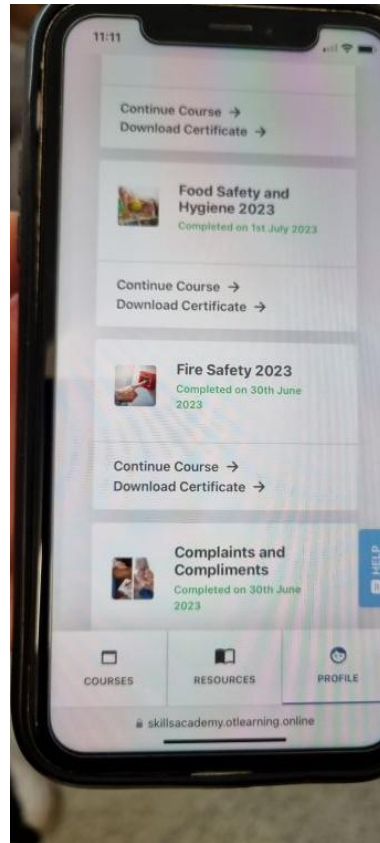


Photo 68

Daily visual fire alarm check notes 2/3

Date	C	Notes
1/11/23	ok	
2/11/23	ok	
3/11/23	ok	
4/11/23	ok	
5/11/23	ok	
6/11/23	fine	
7/11/23	ok	
8/11/23	ok	
9/11/23	ok	
10/11/23	ok	
11/11/23	okay	
12/11/23	fine	
13/11/23	yes - fine	
14/11/23	okay	
15/11/23	ok	
16/11/23	okay	
17/11/23	fine	
18/11/23	ok	
19/11/23		
20/11/23		
21/11/23		
22/11/23		
23/11/23		
24/11/23		
25/11/23		
26/11/23		
27/11/23		
28/11/23		
29/11/23		
30/11/23		

Handwritten note: Daily visual fire alarm check notes 2/3

Photo 69

Daily visual fire alarm check notes 2/3

Date	C	Notes
1/11/23	ok	
2/11/23	ok	
3/11/23	fine	
4/11/23	ok	
5/11/23	ok	
6/11/23	fine	
7/11/23	ok	
8/11/23	ok	
9/11/23	ok	
10/11/23	okay	
11/11/23	fine	
12/11/23	yes - fine	
13/11/23	okay	
14/11/23	ok	
15/11/23	okay	
16/11/23	fine	
17/11/23	ok	
18/11/23		
19/11/23		
20/11/23		
21/11/23		
22/11/23		
23/11/23		
24/11/23		
25/11/23		
26/11/23		
27/11/23		
28/11/23		
29/11/23		
30/11/23		

Handwritten note: Daily visual fire alarm check notes 2/3

Photo 70

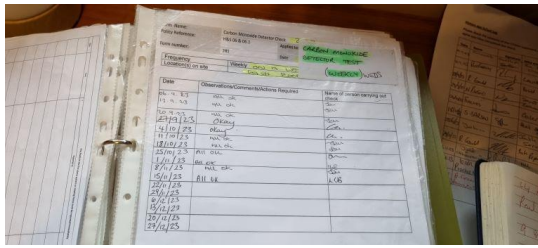


Photo 71

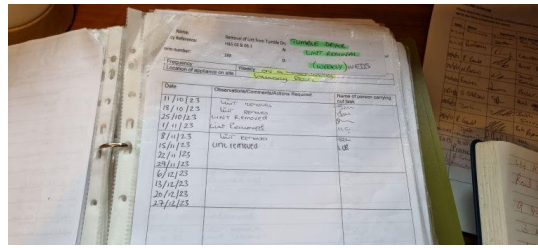


Photo 72



Photo 73

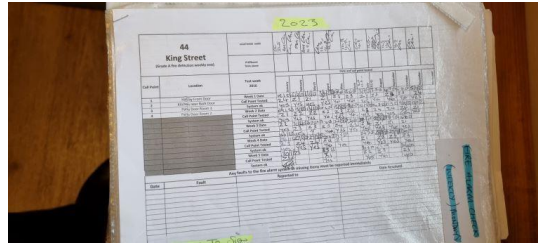


Photo 74

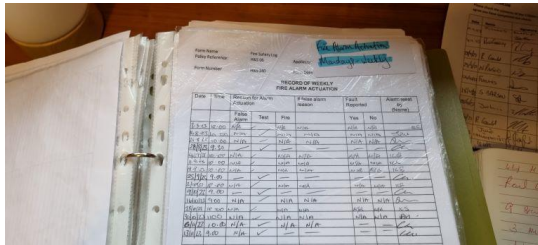


Photo 75

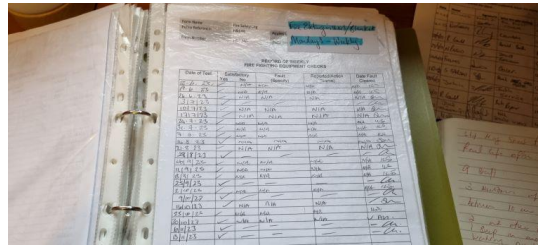


Photo 76

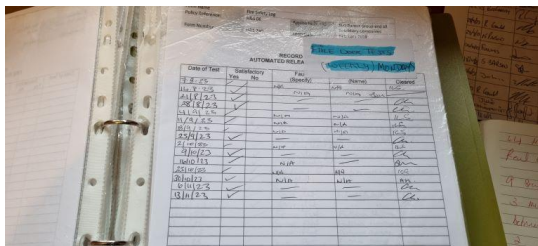


Photo 77

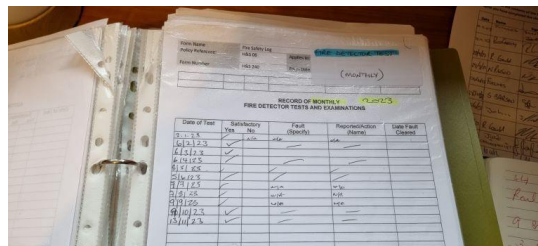


Photo 78

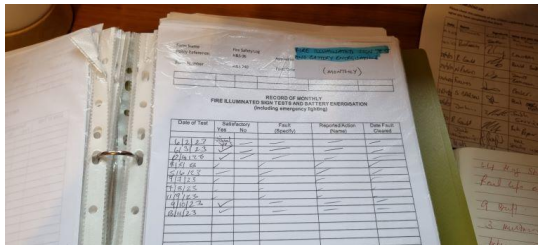


Photo 79

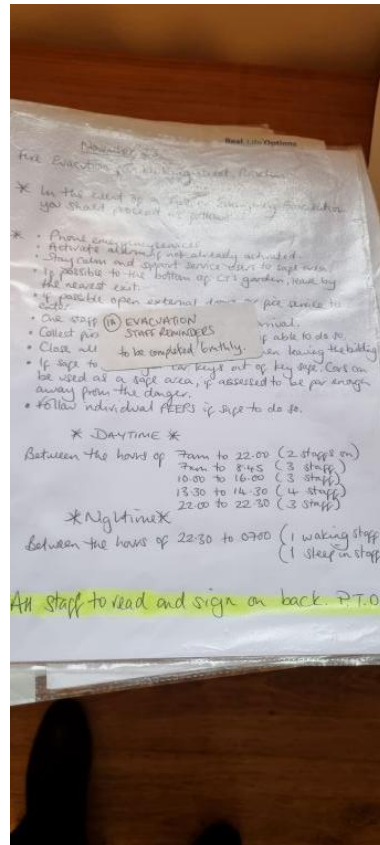


Photo 80

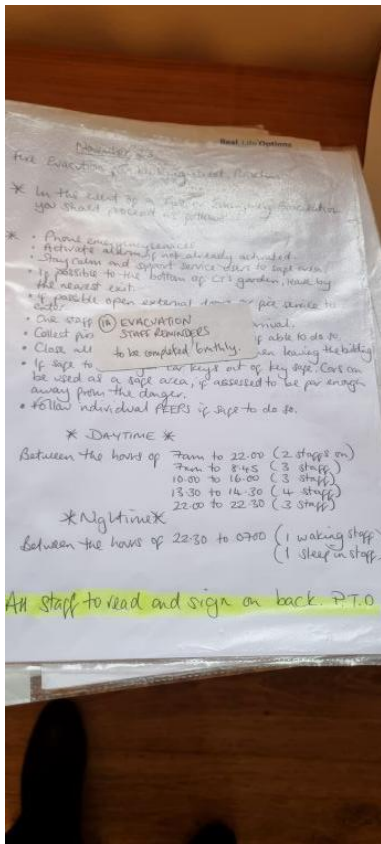


Photo 81